

MODELAPROII

MDX-540S MDX-540 USER'S MANUAL

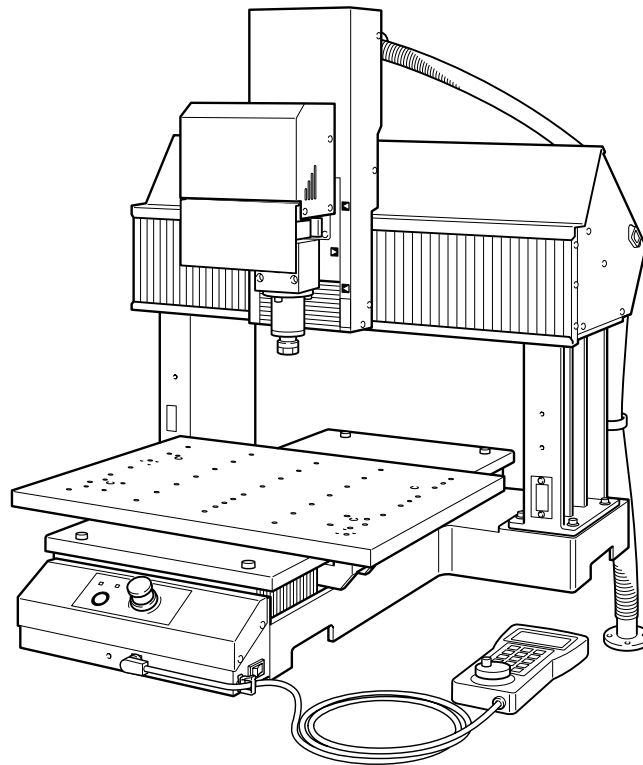

Thank you very much for purchasing this product.

- To ensure correct and safe usage with a full understanding of this product's performance, please be sure to read through this manual completely and store it in a safe location.
- Unauthorized copying or transferral, in whole or in part, of this manual is prohibited.
- The contents of this operation manual and the specifications of this product are subject to change without notice.
- The operation manual and the product have been prepared and tested as much as possible. If you find any misprint or error, please inform us.
- Roland DG Corp. assumes no responsibility for any direct or indirect loss or damage which may occur through use of this product, regardless of any failure to perform on the part of this product.
- Roland DG Corp. assumes no responsibility for any direct or indirect loss or damage which may occur with respect to any article made using this product.

For the USA

**FEDERAL COMMUNICATIONS COMMISSION RADIO
FREQUENCY INTERFERENCE STATEMENT**

NOTE:

This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense.

Unauthorized changes or modification to this system can void the users authority to operate this equipment.

Use only I/O cables that have been designed and manufactured specifically for this device.

NOTICE

Grounding Instructions

In the event of a malfunction or breakdown, grounding provides a path of least resistance for electric current to reduce the risk of electric shock. This tool is equipped with an electric cord having an equipment-grounding conductor and a grounding plug. The plug must be plugged into a matching outlet that is properly installed and grounded in accordance with all local codes and ordinances.

Do not modify the plug provided - if it will not fit the outlet, have the proper outlet installed by a qualified electrician.

Improper connection of the equipment-grounding conductor can result in a risk of electric shock. The conductor with insulation having an outer surface that is green with or without yellow stripes is the equipment-grounding conductor. If repair or replacement of the electric cord or plug is necessary, do not connect the equipment-grounding conductor to a live terminal.

Check with a qualified electrician or service personnel if the grounding instructions are not completely understood, or if in doubt as to whether the tool is properly grounded.

Use only 3-wire extension cords that have 3-prong grounding plugs and 3-pole receptacles that accept the tool's plug.

Repair or replace damaged or worn cord immediately.

For Canada

NOTICE

This Class A digital apparatus meets all requirements of the Canadian Interference-Causing Equipment Regulations.

AVIS

Cet appareil numérique de la classe A respecte toutes les exigences du Règlement sur le matériel brouilleur du Canada.

For EU Countries

WARNING

This is a Class A product. In a domestic environment this product may cause radio interference in which case the user may be required to take adequate measures.

For California



WARNING: This product can expose you to chemicals including lead, which is known to the State of California to cause cancer and birth defects or other reproductive harm. For more information go to www.P65Warnings.ca.gov.

For EU Countries



Manufacturer:
ROLAND DG CORPORATION
1-6-4 Shinmiyakoda, Kita-ku, Hamamatsu-shi, Shizuoka-ken, 431-2103 JAPAN

The importer in the EU:
Roland DG Europe Holdings B.V.
Prof. J.H. Bavincklaan 2, 1183 AT, Amstelveen, The Netherlands

Operating Instructions

KEEP GUARDS IN PLACE and in working order.

REMOVE ADJUSTING KEYS AND WRENCHES. Form habit of checking to see that keys and adjusting wrenches are removed from tool before turning it on.

KEEP WORK AREA CLEAN. Cluttered areas and benches invite accidents.

DON'T USE IN DANGEROUS ENVIRONMENT. Don't use power tools in damp or wet locations, or expose them to rain. Keep work area well lighted.

KEEP CHILDREN AWAY. All visitors should be kept safe distance from work area.

MAKE WORKSHOP KID PROOF with padlocks, master switches, or by removing starter keys.

DON'T FORCE TOOL. It will do the job better and safer at the rate for which it was designed.

USE RIGHT TOOL. Don't force tool or attachment to do a job for which it was not designed.

USE PROPER EXTENSION CORD. Make sure your extension cord is in good condition. When using an extension cord, be sure to use one heavy enough to carry the current your product will draw. An undersized cord will cause a drop in line voltage resulting in loss of power and overheating.

WEAR PROPER APPAREL. Do not wear loose clothing, gloves, neckties, rings, bracelets, or other jewelry which may get caught in moving parts. Non-slip footwear is recommended. Wear protective hair covering to contain long hair.

USE SAFETY GLASSES, face or dust mask if cutting or cleaning operation is dusty. Everyday eyeglasses only have impact resistant lenses, they are NOT safety glasses.

SECURE WORK. Use clamps or a vise to hold work when practical.

DON'T OVERREACH. Keep proper footing and balance at all times.

MAINTAIN TOOLS WITH CARE. Keep tools sharp and clean for best and safest performance. Follow instructions for lubricating and changing accessories.

DISCONNECT TOOLS before servicing; when changing accessories, such as blades, bits, cutters, and the like.

REDUCE THE RISK OF UNINTENTIONAL STARTING. Make sure switch is in off position before plugging in.

USE RECOMMENDED ACCESSORIES. Consult the owner's manual for recommended accessories. The use of improper accessories may cause risk of injury to persons.

NEVER STAND ON TOOL. Serious injury could occur if the tool is tipped or if the cutting tool is unintentionally contacted.

CHECK DAMAGED PARTS. Before further use of the tool, a guard or other part that is damaged should be carefully checked to determine that it will operate properly and perform its intended function - check for alignment of moving parts, binding of moving parts, breakage of parts, mounting, and any other conditions that may affect its operation. A guard or other part that is damaged should be properly repaired or replaced.

NEVER LEAVE TOOL RUNNING UNATTENDED. TURN POWER OFF. Don't leave tool until it comes to a complete stop.

USE POWER SUPPLY CORD WHICH IS ATTACHED WITH PRODUCTS. Do not use other power supply cord.

For China

产品中有毒有害物质或元素的名称及含量

部件名称	有毒有害物质或元素					
	铅(Pb)	汞(Hg)	镉(Cd)	六价铬(Cr(VI))	多溴联苯(PBB)	多溴二苯醚(PBDE)
印刷电路板	×	○	×	○	○	○
头部	×	○	○	○	○	○
壳体、底架	×	○	○	○	○	○
电源	×	○	×	○	○	○
其他(电缆、附件等)	×	○	○	○	○	○

○：表示该有毒有害物质在该部件所有均质材料中的含量均在 GB/T26572-2011 标准规定的限量要求以下。
 ×：表示该有毒有害物质至少在该部件的某一均质材料中的含量超出 GB/T26572-2011 标准规定的限量要求。

环保使用期限



此标志适用于在中国国内销售的电子信息产品，表示环保使用期限的年数。所谓环保使用期限是指在自制造日起的规定的期限内，产品中所含的有害物质不致引起环境污染，不会对人身、财产造成严重的不良影响。环保使用期限仅在遵照产品使用说明书，正确使用产品的条件下才有效。不当的使用，将会导致有害物质泄漏的危险。

For EU Countries



This product must be disposed of separately at your local waste recycling center. Do not dispose of in household waste bin.



Lever dit product in bij een lokaal afvalverzamelpunt. NIET met normaal huishoudelijk afval afvoeren.



Bitte führen Sie dieses Produkt separat Ihrer örtlichen Entsorgungsstelle zu. Bitte nicht mit dem normalen Hausmüll entsorgen.



Dette Produkt skal smides særskilt væk på den lokale affalds- og genbrugsstation. Må ikke smides ud sammen med almindeligt husholdningsaffald.



Ne jetez pas le produit avec vos ordures ménagères. Portez-le dans un centre recyclage des déchets.



Tätä tuotetta ei saa hävittää normaalien talousjätteiden mukana, vaan se on toimitettava ongelmajätteiden keräilypisteeseen hävitettäväksi.



Questo prodotto deve essere smaltito negli appositi contenitori per la raccolta differenziata, non buttare nel cestino dei rifiuti casalinghi.



Produkten måste kasseras separat på din lokala återvinningscentral. Släng inte produkten tillsammans med hushållssoporna.



Este producto debe devolverse al centro de reciclaje más cercano a su domicilio para su correcta eliminación. No lo tire a la basura.



Μην πετάξετε το αντικείμενο αυτό στο καλάθι των απορριμμάτων. Αφαιρέστε τις μπαταρίες και προσκομίστε το στο τοπικό κέντρο ανακύκλωσης.



Deite fora separadamente este produto no seu centro de reciclagem local. Não o deite fora no seu caixote do lixo.

Contents

Contents	3
To Ensure Safe Use	6
Pour utiliser en toute sécurité	13
Important Notes on Handling and Use	20
Main Unit	20
Tool and Collet	20
Chapter 1 Introduction	21
1-1 Introduction	22
Features	22
Organization of the Documentation	22
1-2 Part Names and Functions	24
Front View	24
Side View (Right)	26
Side View (Left)	26
VPanel	27
Handy Panel	28
Chapter 2 Emplacement and Installation	29
2-1 Included Items	30
Checking the Included Items	30
2-2 Installation	31
Emplacement and Installation Operations	31
Installation Environment	31
Installation Space	32
Unpacking	32
2-3 Cable Connections	34
Connecting the Handy Panel	34
Connecting the Power Cord	35
Connecting the USB Cable	36
2-4 Selecting the Language	37
Selecting the Language Used for Text on the Handy Panel	37
Chapter 3 Basic Operation	39
3-1 Emergency Stop to Ensure Safety	40
How to Perform an Emergency Stop	40
To Cancel an Emergency Stop	40
Spindle Cover	41
3-2 Starting and Quitting	42
How to Start the Machine	42
How to Shut down	44
3-3 Selecting the Command Mode	45
Verifying the Command Mode	45
How to Select the Command Mode	45
3-4 Moving the Tool	48
Manual Feed	48
About the Displayed Tool Position	50
3-5 Starting and Stopping Spindle Rotation	52
Starting or Stopping the Spindle	52
3-6 Pausing and Quitting Cutting	54
Pausing and Resuming Operation	54
Quitting Cutting	55

Chapter 4 Getting Ready for and Performing Cutting	57
4-1 Cutting Area	58
Workpiece Size and Location Where Secured in Place	58
Actual Size That Can Be Cut	59
4-2 Installing a Tool	60
Installing a Tool (ZS-540TY)	60
4-3 Starting Cutting (RML-1 Mode)	62
Determining the Reference Position for Cutting	62
Starting Cutting	65
4-4 Starting Cutting (NC-code Mode).....	67
Determining the Reference Position for Cutting	67
Starting Cutting	69
Deleting the Output File List	71
4-5 Using the Tool Sensor	73
What's a Tool Sensor?.....	73
Setting the Thickness of the Tool Sensor	73
Setting the Z-axis Origin Using the Tool Sensor	74
4-6 Overrides	76
What's an Override?.....	76
How to Make the Settings for Overrides	76
Chapter 5 Handy Panel	77
5-1 Using the Handy Panel	78
Using the Handy Panel	78
5-2 Moving the Tool	79
Hand-wheel Feed	79
Rapidly Moving to a Specific Location.....	80
Viewing the Tool Location	82
5-3 Starting and Stopping Spindle Rotation	83
Starting or Stopping the Spindle.....	83
5-4 Pausing and Quitting Cutting	84
Pausing and Resuming Operation	84
Quitting Cutting.....	85
5-5 Setting the Origins	86
How to Set the Origins	86
Setting the Z-axis Origin Using the Tool Sensor	87
5-6 Overrides	90
How to Make the Settings for Overrides.....	90
5-7 Clearing Errors	91
Clearing Errors	91
Chapter 6 Maintenance	93
6-1 Daily Care	94
Cleaning.....	94
Cleaning the X Axis	94
Cleaning the Y Axis	95
Cleaning the Z Axis	96
Care and Maintenance of the Collet and Spindle Nose.....	96
Cleaning the Ventilation-duct Filter	97
6-2 Inspection and Maintenance	98
Checking the Total Working Time.....	98
Lubricating the Ball Screws.....	99
When to Service the Spindle	100

Chapter 7 What to Do If...	101
7-1 What to Do If...	102
7-2 Responding to an Error Message	104
Chapter 8 Specifications	107
8-1 Locations of the Power Rating and Serial Number Labels	108
8-2 NC Code Specifications	109
8-3 Main Unit Specifications.....	111
External View.....	111
Dimensional Drawings of the Table Area	112
Collet Specifications (ZS-540TY).....	114
Main Specifications	115

About the Illustrations Used in This Manual



Depending on the optionally available items selected at the time of purchase, your actual machine may differ from what is depicted in the figures.

Company names and product names are trademarks or registered trademarks of their respective holders.




To Ensure Safe Use

Improper handling or operation of this machine may result in injury or damage to property. Points which must be observed to prevent such injury or damage are described as follows.

About ⚠ WARNING and ⚠ CAUTION Notices


 WARNING	Used for instructions intended to alert the user to the risk of death or severe injury should the unit be used improperly.
 CAUTION	Used for instructions intended to alert the user to the risk of injury or material damage should the unit be used improperly. Note: Material damage refers to damage or other adverse effects caused with respect to the home and all its furnishings, as well to domestic animals or pets.


About the Symbols


	The ⚠ symbol alerts the user to important instructions or warnings. The specific meaning of the symbol is determined by the design contained within the triangle. The symbol at left means "danger of electrocution."
	The ⊘ symbol alerts the user to items that must never be carried out (are forbidden). The specific thing that must not be done is indicated by the design contained within the circle. The symbol at left means the unit must never be disassembled.
	The ● symbol alerts the user to things that must be carried out. The specific thing that must be done is indicated by the design contained within the circle. The symbol at left means the powercord plug must be unplugged from the outlet.


 **Incorrect operation may cause injury**


 **WARNING**


 **Be sure to follow the operation procedures described in this documentation. Never allow anyone unfamiliar with the usage or handling of the machine to touch it.**
Incorrect usage or handling may lead to an accident.


 **Keep children away from the machine.**
The machine includes areas and components that pose a hazard to children and may result in injury, blindness, choking, or other serious accident.

 **Never operate the machine while tired or after ingesting alcohol or any medication.**
Operation requires unimpaired judgment. Impaired judgment may result in an accident.


 **Conduct operations in a clean, brightly lit location.**
Working in a location that is dark or cluttered may lead to an accident, such as becoming caught in the machine as the result of an inadvertent stumble.


 **Before switching on the power, check and ensure the safety of the surrounding area.**
Make sure that movement of the machine poses no danger, including making sure no person is inside the machine's area of operation.


 **Never use the machine for any purpose for which it is not intended, or use the machine in an undue manner that exceeds its capacity.**
Doing so may result in injury or fire.

 **Never use a cutting tool that has become dull. Perform frequent maintenance to keep and use the machine in good working order.**
Unreasonable usage may result in fire or injury.


 **WARNING**

 **For accessories (optional and consumable items, AC adapter, power cord, and the like), use only genuine articles compatible with this machine.**
Incompatible items may lead to an accident.

 **Before attempting cleaning, maintenance, or attachment or detachment of optional items, disconnect the power cord.**
Attempting such operations while the machine is connected to a power source may result in injury or electrical shock.


 **Never attempt to disassemble, repair, or modify the machine.**
Doing so may result in fire, electrical shock, or injury. Entrust repairs to a trained service technician.

 **CAUTION**


 **Never climb or lean on the machine.**
The machine is not made to support a person. Climbing or leaning on the machine may dislodge components and cause a slip or fall, resulting in injury.

 **This machine weighs 300 kg (650 lb.)**


 **WARNING**

 **Install the machine in a location that is level, stable, and able to bear the weight of the machine.**

The total weight including the stand and other optional items may reach 300 kg (650 lb.) or more. Installation in an unsuitable location may cause a major accident, including tipover, fall, or collapse.

 **Be sure to anchor the stand to the floor.**
If the machine should begin to topple, a major accident may result, including crushing of the appendages or the body.


 **WARNING**


 **Unloading and emplacement are operations that must be performed by 4 persons or more.**


Tasks that require undue effort when performed by a small number of persons may result in physical injury. Also, if dropped, such items may cause injury.

 **The cutting waste or workpiece may catch fire or pose a health hazard.**

 **WARNING**


 **Never attempt to cut magnesium or any other such flammable material.**
Fire may occur during cutting.

 **Keep open flame away from the work area.**
Cutting waste may ignite. Powdered material is extremely flammable, and even metal material may catch fire.

 **When using a vacuum cleaner to take up cutting waste, exercise caution to prevent fire or dust explosion.**

Taking up fine cuttings using an ordinary vacuum cleaner may cause danger of fire or explosion. Check with the manufacturer of the vacuum cleaner. When the safety of use cannot be determined, clean using a brush or the like, without using the vacuum cleaner.

 **CAUTION**

 **Wear dust goggles and a mask. Wash away any cutting waste remaining on the hands.**

Accidentally swallowing or inhaling cutting waste may be hazardous to the health.

 Danger of pinching, entanglement, and burns.

 WARNING



Never attempt operation while wearing a necktie, necklace, loose clothing, or gloves. Bind long hair securely.
Such items may become caught in the machine, resulting in injury.



Securely fasten the cutting tool and workpiece in place. After securing in place, make sure no wrenches or other articles have inadvertently been left behind.
Otherwise such articles may be thrown from the machine with force, posing a risk of injury.



Exercise caution to avoid being pinched or becoming caught.
Inadvertent contact with certain areas may cause the hand or fingers to be pinched or become caught. Use care when performing operations.

 WARNING




Caution: cutting tool.
The cutting tool is sharp. To avoid injury, exercise caution.





Caution: high temperatures.
The cutting tool and spindle motor become hot. Exercise caution to avoid fire or burns.


 **Danger of electrical short, shock, electrocution, or fire**


 **WARNING**


-  **Connect to an electrical outlet that complies with this machine's ratings (for voltage and frequency).**
Provide a power supply whose amperage is 7 A or higher (for 100 to 120 V) or 4 A or higher (for 220 to 240 V).

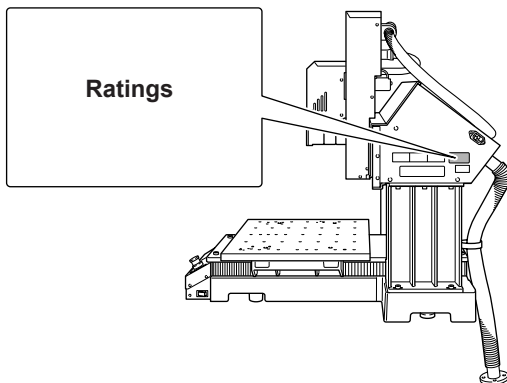


-  **Never use out of doors or in any location where exposure to water or high humidity may occur. Never touch with wet hands.**
Doing so may result in fire or electrical shock.


-  **Never allow any foreign object to get inside. Never expose to liquid spills.**
Inserting objects such as coins or matches or allowing beverages to be spilled into the ventilation ports may result in fire or electrical shock. If anything gets inside, immediately disconnect the power cord and contact your authorized Roland DG Corp. dealer.


-  **Never place any flammable object nearby. Never use a combustible aerosol spray nearby. Never use in any location where gases can accumulate.**
Combustion or explosion may be a danger.


-  **Handle the power cord, plug, and electrical outlet correctly and with care. Never use any article that is damaged.**
Using a damaged article may result in fire or electrical shock.


 **WARNING**


-  **When using an extension cord or power strip, use one that adequately satisfies the machine's ratings (for voltage, frequency, and current).**
Use of multiple electrical loads on a single electrical outlet or of a lengthy extension cord may cause fire.


-  **When the machine will be out of use for a prolonged period, disconnect the power cord.**
This can prevent accidents in the event of current leakage or unintended startup.

-  **Connect to ground.**
This can prevent fire or electrical shock due to current leakage in the event of malfunction.


-  **Position so that the power plug is within immediate reach at all times.**
This is to enable quick disconnection of the power plug in the event of an emergency. Install the machine next to an electrical outlet. Also, provide enough empty space to allow immediate access to the electrical outlet.

-  **Never use cutting oil.**
This machine is not designed for the flow of cutting oil. Oil may get inside the machine and cause fire or electrical shock.


-  **Never use a pneumatic blower.**
This machine is not compatible with a pneumatic blower. Cutting waste may get inside the machine and cause fire or electrical shock.

-  **If sparking, smoke, burning odor, unusual sound, or abnormal operation occurs, immediately unplug the power cord. Never use if any component is damaged.**
Continuing to use the machine may result in fire, electrical shock, or injury. Contact your authorized Roland DG Corp. dealer.


⚠ Important notes about the power cord, plug, and electrical outlet

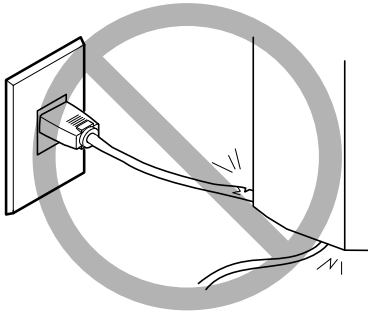


Never place any object on top or subject to damage.

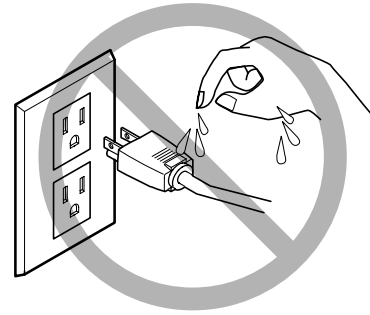


Never allow to get wet.

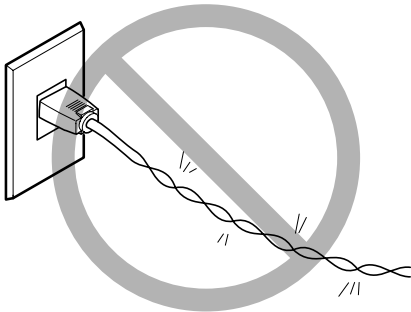


Never bend or twist with undue force.

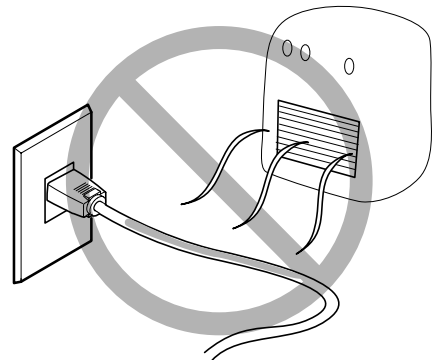


Never make hot.

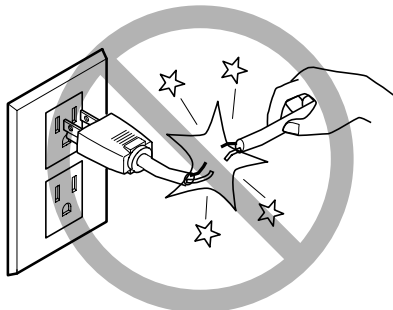

Never pull with undue force.

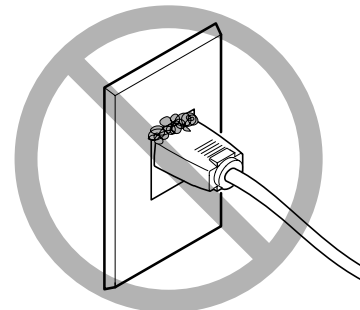


Dust may cause fire.

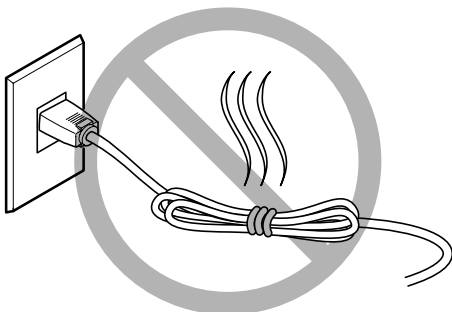



Never bundle, bind, or roll up.


Warning Labels

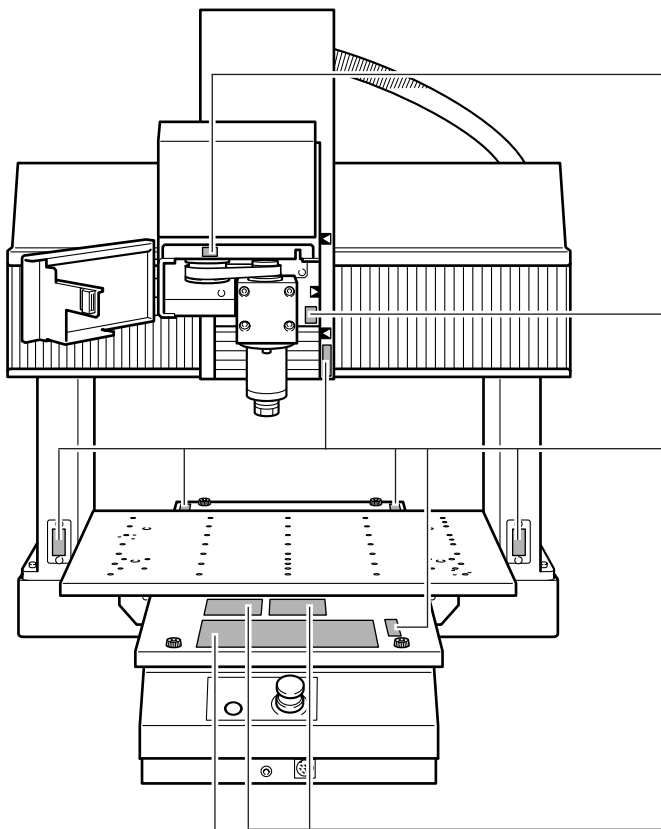Warning labels are affixed to make areas of danger immediately clear. The meanings of these labels are as follows. Be sure to heed their warnings. Also, never remove the labels or allow them to become obscured.



 **Caution: High Temperature**
Never touch immediately after cutting operation.

 **Caution: Sharp Tool**
Inadvertent contact may cause injury.

 **Caution: Pinching Hazard**
Contact during operation may cause the hand or fingers to become pinched, resulting in injury.



<p>WARNING For Your Own Safety Read Instruction Manual Before Operating Drill Press.</p> <p>A) Wear eye protection. B) Do not wear gloves, necktie, or loose clothing. C) Clamp workpiece or brace against column to prevent rotation. D) Do not Expose to rain or use in damp locations.</p>	<p>AVERTISSEMENT Pour votre sécurité, lire attentivement le manuel d'instructions avant d'utiliser la perceuse à colonne.</p> <p>A) Porter des lunettes de protection. B) Ne pas porter de gants, de cravate ou de vêtements lâches. C) Fixer ou arrimer la pièce à la colonne pour éviter toute entrée en rotation. D) Ne pas exposer à la pluie ou utiliser en milieu humide.</p>
--	--

<p>▲ CAUTION Please use a vacuum cleaner to remove cutting dust. Do not use any blower like airbrush. Otherwise, dust spread in the air may harm your health or damage this machine.</p> <p>▲ PRECAUCION Por favor, utilice un aspirador para limpiar la viruta y el polvo. No utilice aire a presión para la limpieza, podría averiar la máquina, y no sería conveniente para su salud respirar el polvo.</p> <p>▲ PRUDENCE Veuillez utiliser un aspirateur pour enlever la poussière. Ne jamais utiliser de projecteurs d'air. La poussière soufflée dans l'air peut causer des problèmes de respiration et endommager votre machine.</p>	<p>▲ VORSICHT Bitte entfernen Sie Staub mit einem Staubsauger. Niemals ein Gebläse verwenden. Der dadurch freigesetzte Staub ist gesundheitsschädlich und kann die Funktion Ihres Geräts beeinträchtigen.</p> <p>▲ CAUTELA Usare un aspiratore per rimuovere polvere o trucioli da lavorazione. Non usare compressori, altrimenti la polvere diffusa nell'aria potrebbe essere nociva alla salute o danneggiare la macchina.</p> <p>▲ 注意 切削粉は吸い込み型のクリーナーを使用して除去して下さい。吹き飛ばすエアガンは使用しないで下さい。切削粉が吸い取り装置の故障につながり、機器に侵入し故障の原因となります。</p>
--	--







Pour utiliser en toute sécurité

La manipulation ou l'utilisation inadéquates de cet appareil peuvent causer des blessures ou des dommages matériels. Les précautions à prendre pour prévenir les blessures ou les dommages sont décrites ci-dessous.

Avis sur les avertissements


 ATTENTION	Utilisé pour avertir l'utilisateur d'un risque de décès ou de blessure grave en cas de mauvaise utilisation de l'appareil.
 PRUDENCE	Utilisé pour avertir l'utilisateur d'un risque de blessure ou de dommage matériel en cas de mauvaise utilisation de l'appareil. * Par dommage matériel, il est entendu dommage ou tout autre effet indésirable sur la maison, tous les meubles et même les animaux domestiques.

À propos des symboles


	Le symbole  attire l'attention de l'utilisateur sur les instructions importantes ou les avertissements. Le sens précis du symbole est déterminé par le dessin à l'intérieur du triangle. Le symbole à gauche signifie "danger d'électrocution".
	Le symbole  avertit l'utilisateur de ce qu'il ne doit pas faire, ce qui est interdit. La chose spécifique à ne pas faire est indiquée par le dessin à l'intérieur du cercle. Le symbole à gauche signifie que l'appareil ne doit jamais être démonté.
	Le symbole  prévient l'utilisateur sur ce qu'il doit faire. La chose spécifique à faire est indiquée par le dessin à l'intérieur du cercle. Le symbole à gauche signifie que le fil électrique doit être débranché de la prise.

L'utilisation incorrecte peut causer des blessures

ATTENTION

 **S'assurer de suivre les procédures d'utilisation décrites dans la documentation. Ne jamais permettre à quiconque ne connaît pas le fonctionnement ou la maintenance de l'appareil de le toucher.**

L'utilisation ou la maintenance incorrectes peuvent causer un accident.

 **Garder les enfants loin de l'appareil.**
L'appareil comporte des zones et des composants qui présentent un danger pour les enfants et qui pourraient causer des blessures, la cécité, la suffocation ou d'autres accidents graves.

 **Ne jamais faire fonctionner l'appareil après avoir consommé de l'alcool ou des médicaments, ou dans un état de fatigue.**


L'utilisation de l'appareil exige un jugement sans faille. L'utilisation avec les facultés affaiblies pourrait entraîner un accident.

 **Utiliser l'appareil dans un endroit propre et bien éclairé.**

Travailler dans un endroit sombre ou encombré peut causer un accident; l'utilisateur risque, par exemple, de trébucher malencontreusement et d'être coincé par une partie de l'appareil.

 **Avant de mettre l'appareil sous tension, vérifier et s'assurer que les environs sont sécuritaires.**

S'assurer que les mouvements de l'appareil ne présentent aucun danger; s'assurer en particulier que personne ne se trouve dans la zone de fonctionnement de l'appareil.


 **Ne jamais utiliser l'appareil à des fins autres que celles pour lesquelles il est conçu. Ne jamais l'utiliser de manière abusive ou d'une manière qui dépasse sa capacité.**

Le non-respect de cette consigne peut causer des blessures ou un incendie.


 **Ne jamais utiliser un outil de coupe émoussé. Procéder fréquemment aux travaux d'entretien pour garder l'appareil en bon état de fonctionnement.**

L'usage abusif peut causer un incendie ou des blessures.

ATTENTION

 **Utiliser uniquement des accessoires d'origine (accessoires en option, articles consommables, adaptateur CA, câble d'alimentation et autres articles semblables), compatibles avec l'appareil.**

Les articles incompatibles risquent de causer des accidents.

 **Débrancher le câble d'alimentation avant de procéder au nettoyage ou à l'entretien de l'appareil, et avant d'y fixer ou d'en retirer des accessoires en option.**

Tenter ces opérations pendant que l'appareil est branché à une source d'alimentation peut causer des blessures ou un choc électrique.

 **Ne jamais tenter de démonter, de réparer ou de modifier l'appareil.**

Le non-respect de cette consigne risque de provoquer un incendie, un choc électrique ou des blessures. Confier les réparations à un technicien ayant la formation requise.

PRUDENCE

 **Ne jamais grimper ni s'appuyer sur la machine.**

La machine n'est pas conçue pour supporter le poids d'une personne. Grimper ou s'appuyer sur la machine peut déplacer des éléments et causer un faux pas ou une chute, ce qui causerait des blessures.

 **Le poids de cet appareil est de 300 kg (650 lb.)**

 **ATTENTION**



Installer l'appareil à un endroit stable et plat et capable de supporter son poids.

Le poids total de l'appareil, y compris le socle et les accessoires en option, peut être d'au moins 300 kg (650 lb.). Installer l'appareil à un endroit inapproprié peut provoquer un accident grave comme le renversement, la chute ou l'écrasement.



S'assurer d'ancrer la base de l'appareil au sol.

Si l'appareil devait commencer à basculer, il s'ensuivrait un accident grave, par exemple l'écrasement de membres ou du corps.

 **ATTENTION**



Le déchargement et la mise en place doivent être faits par au moins 4 personnes.

Les tâches qui exigent un effort trop grand si elles sont exécutées par un petit nombre de personnes peuvent être cause de blessures. La chute d'articles très lourds peut aussi causer des blessures.

 **Les débris de coupe peuvent s'enflammer ou présenter un risque pour la santé.**

 **ATTENTION**



Ne jamais tenter de couper du magnésium ni aucun autre matériau inflammable.

Un incendie pourrait se produire pendant la coupe.



Ne pas approcher une flamme nue de l'espace de travail.

Les rognures de coupe peuvent s'enflammer. Les matériaux pulvérisés sont extrêmement inflammables et même le métal peut s'enflammer.



Si un aspirateur est utilisé pour ramasser les rognures de coupe, faire preuve de prudence pour empêcher que la poussière s'enflamme ou explose.

Ramasser des rognures fines à l'aide d'un aspirateur ordinaire peut créer un risque d'incendie ou d'explosion. Vérifier auprès du fabricant de l'aspirateur. Dans les cas où il est impossible de déterminer si un aspirateur peut être utilisé sans danger, se servir d'une brosse ou d'un article semblable plutôt que d'un aspirateur.

 **PRUDENCE**




Porter des lunettes de protection et un masque. Rincer toutes les rognures de coupe qui pourraient rester collées aux mains.


Avaler ou respirer accidentellement des rognures de coupe peut être dangereux pour la santé.

 **Certains éléments peuvent présenter un risque de pincement, d'emmêlement, de brûlure ou d'autres dangers.**

 **ATTENTION**

 **Ne jamais faire fonctionner l'appareil si on porte une cravate, un collier, des vêtements amples ou des gants. Bien attacher les cheveux longs.**

Ces vêtements ou ces objets peuvent être coincés dans l'appareil, ce qui causerait des blessures.


 **Fixer solidement l'outil de coupe et la pièce à travailler. Une fois qu'ils sont fixés solidement, s'assurer qu'aucun outil ni aucun autre objet n'a été laissé en place.**


Si tel était le cas, ces objets pourraient être projetés avec force hors de l'appareil et causer des blessures.

 **Faire preuve de prudence pour éviter l'écrasement ou le coincement.**

La main ou les doigts peuvent être écrasés ou coincés s'ils entrent en contact avec certaines surfaces par inadvertance. Faire preuve de prudence pendant l'utilisation de l'appareil.

 **ATTENTION**

 **Attention : outil de coupe.**
L'outil de coupe est acéré. Faire preuve de prudence pour éviter les blessures.


 **Attention : températures élevées.**
L'outil de coupe et le moteur chauffent. Faire preuve de prudence pour éviter un incendie ou des brûlures.

⚠ **Risque de décharge ou de choc électrique, d'électrocution ou d'incendie**

⚠ **ATTENTION**

❗ **Brancher à une prise électrique conforme aux caractéristiques de cet appareil (tension et fréquence).**

Il faut prévoir une alimentation en courant dont l'intensité est de 7 A ou plus (pour 100 à 120 V) ou de 4 A ou plus (pour 220 à 240 V).

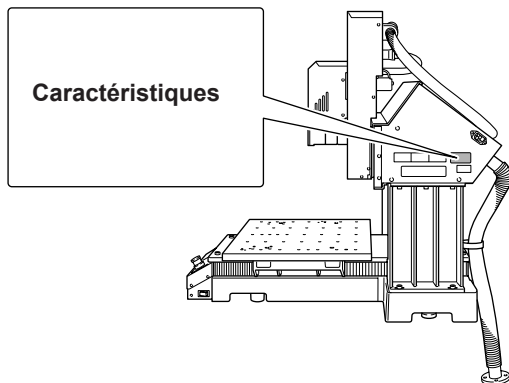

⊘ **Ne jamais utiliser à l'extérieur ni à un endroit où l'appareil risque d'être exposé à de l'eau ou à une humidité élevée. Ne jamais toucher l'appareil avec des mains mouillées.**

Le non-respect de cette consigne risque de provoquer un incendie ou un choc électrique.

⊘ **Ne jamais insérer d'objet étranger dans l'appareil. Ne jamais exposer l'appareil aux déversements de liquides.**

L'insertion d'objets comme des pièces de monnaie ou des allumettes, ou le déversement de liquides dans les orifices de ventilation peuvent causer un incendie ou un choc électrique. Si un objet ou du liquide s'infiltré dans l'appareil, débrancher immédiatement le câble d'alimentation et communiquer avec le représentant Roland DG Corp. autorisé.

⊘ **Ne jamais placer d'objet inflammable à proximité de l'appareil. Ne jamais utiliser de produit inflammable en aérosol à proximité de l'appareil. Ne jamais utiliser l'appareil dans un endroit où des gaz peuvent s'accumuler.**

Une combustion ou une explosion pourraient se produire.

⚠ **ATTENTION**

❗ **Manipuler le câble d'alimentation, la fiche et la prise électrique correctement et avec soin.**

Ne jamais utiliser un article endommagé, car cela pourrait causer un incendie ou un choc électrique.

❗ **Si une rallonge ou une bande d'alimentation électrique sont utilisées, s'assurer qu'elles correspondent aux caractéristiques de l'appareil (tension, fréquence et courant).**

L'utilisation de plusieurs charges électriques sur une prise unique ou une longue rallonge peut causer un incendie.

❗ **Si l'appareil doit rester inutilisé pendant une longue période, débrancher le câble d'alimentation.**

Cela peut prévenir les accidents en cas de fuite de courant ou de démarrage accidentel.

⚡ **Mise à la terre.**

La mise à la terre peut prévenir un incendie ou un choc électrique dus à une fuite de courant en cas de défaillance.

❗ **Placer l'appareil de façon à ce que la fiche soit facile d'accès en tout temps.**

Ainsi, l'appareil pourra être débranché rapidement en cas d'urgence. Installer l'appareil près d'une prise électrique. En outre, prévoir suffisamment d'espace pour que la prise électrique soit facile d'accès.

⊘ **Ne jamais utiliser d'huile de coupe.**

Cet appareil n'est pas conçu pour traiter l'huile de coupe. L'huile peut s'infiltrer à l'intérieur et causer un incendie ou un choc électrique.


⊘ **Ne jamais utiliser d'air sous pression.**

Cet appareil n'est pas conçu pour être nettoyé à l'aide d'un appareil soufflant. Des rognures de coupe peuvent s'infiltrer à l'intérieur et causer un incendie ou un choc électrique.


❗ **S'il se produit des étincelles, de la fumée, une odeur de brûlé, un bruit inhabituel ou un fonctionnement anormal, débrancher immédiatement le câble d'alimentation. Ne jamais utiliser si un composant est endommagé.**

Continuer à utiliser l'appareil peut causer un incendie, un choc électrique ou des blessures. Communiquer avec le représentant Roland DG Corp. Autorisé.


⚠ Important notes about the power cord, plug, and electrical outlet

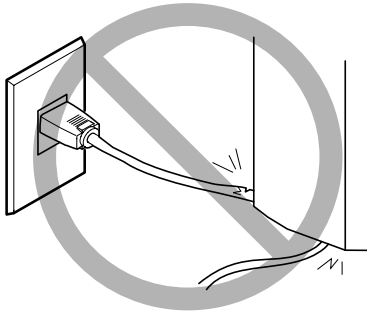


Ne jamais déposer aucun objet sur le câble, sur la fiche ou sur la prise car cela risque de les endommager.

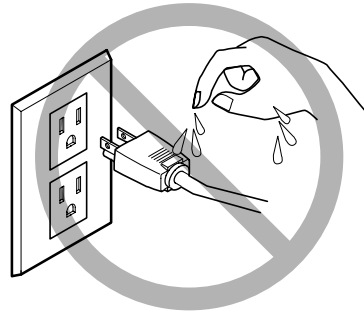


Ne jamais laisser l'eau toucher le câble, la fiche ou la prise.

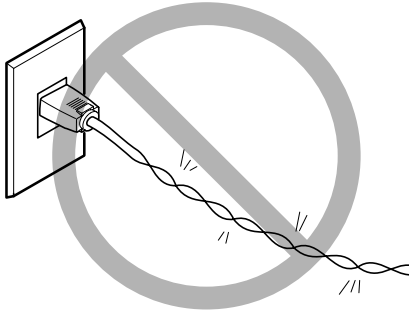


Ne jamais plier ni tordre le câble avec une force excessive.

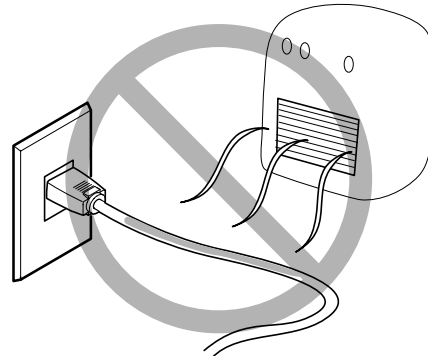


Ne jamais chauffer le câble, la fiche ou la prise.

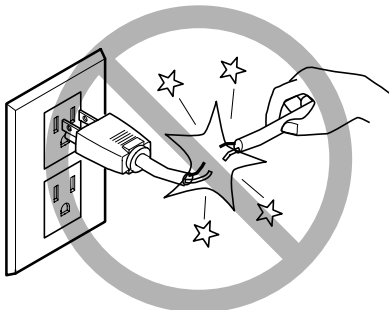

Ne jamais tirer sur le câble ou la fiche avec une force excessive.

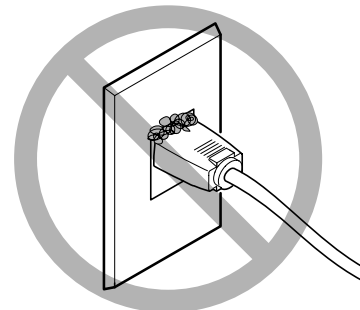


La poussière peut causer un incendie.

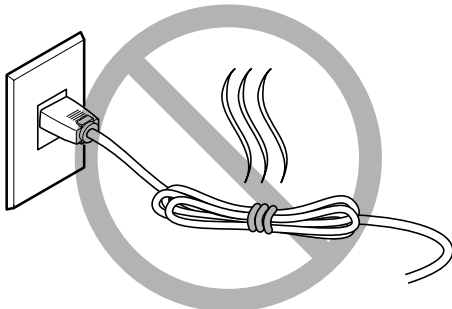

Ne jamais plier ni enrouler le câble.

⚠ Vignettes d'avertissement

Des vignettes d'avertissement sont apposées pour qu'il soit facile de repérer les zones dangereuses. La signification des vignettes est donnée ci-dessous. Respecter les avertissements. Ne jamais retirer les vignettes et ne pas les laisser s'encrasser.

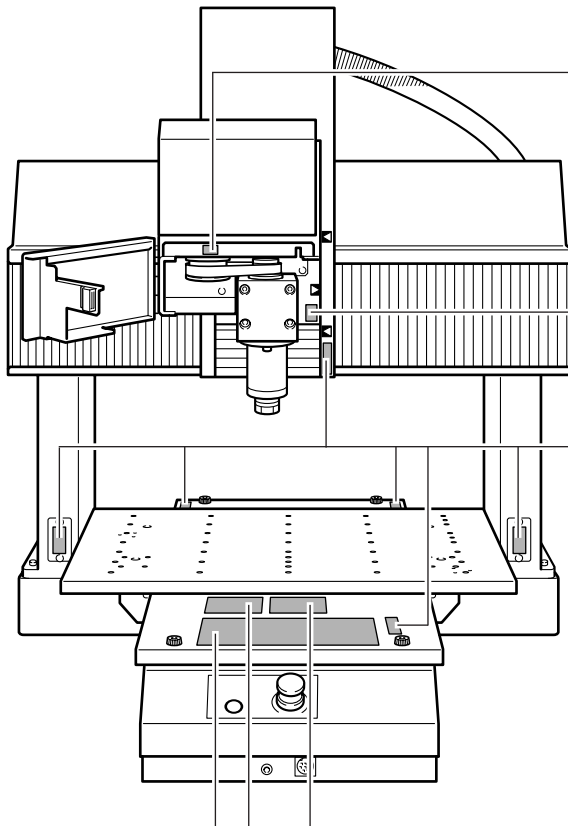

Attention : température élevée
Ne jamais toucher immédiatement après une opération de coupe.



Attention : outil coupant
Un contact imprudent risque d'entraîner une blessure.



Attention : risque de pincement
Un contact pendant le fonctionnement peut coincer la main ou les doigts ce qui risque de causer des blessures.

WARNING

For Your Own Safety Read Instruction Manual Before Operating Drill Press.

- A) Wear eye protection.
- B) Do not wear gloves, necktie, or loose clothing.
- C) Clamp workpiece or brace against column to prevent rotation.
- D) Do not Expose to rain or use in damp locations.

AVVERTISSEMENT

Pour votre sécurité, lire attentivement le manuel d'instructions avant d'utiliser la perceuse à colonne.

- A) Porter des lunettes de protection.
- B) Ne pas porter de gants, de cravate ou de vêtements lâches.
- C) Fixer ou arrimer la pièce à la colonne pour éviter toute entrée en rotation.
- D) Ne pas exposer à la pluie ou utiliser en milieu humide.

CAUTION

Please use a vacuum cleaner to remove cutting dust. Do not use any blower like airbrush. Otherwise, dust spread in the air may harm your health or damage this machine.

PRECAUCION

Por favor, utilice un aspirador para limpiar la viruta y el polvo. No utilice aire a presión para la limpieza, podría averiar la máquina, y no sería conveniente para su salud respirar el polvo.

PRUDENCE

Veuillez utiliser un aspirateur pour enlever la poussière. Ne jamais utiliser de projecteurs d'air. La poussière soufflée dans l'air peut causer des problèmes de respiration et endommager votre machine.

VORSICHT

Bitte entfernen Sie Staub mit einem Staubsauger. Niemals ein Gebläse verwenden. Der dadurch freigesetzte Staub ist gesundheitsschädlich und kann die Funktion Ihres Geräts beeinträchtigen.

CAUTELA

Usare un aspiratore per rimuovere polvere o trucioli da lavorazione. Non usare compressori, altrimenti la polvere diffusa nell'aria potrebbe essere nociva alla salute o danneggiare la macchina.

注意

切削粉は吸い込み型のクリーナーを使用して除去して下さい。吹き飛ばすエアガンは使用しないで下さい。切削粉が吸い込み装置の障害になったり、機器に侵入し故障の原因となります。

Important Notes on Handling and Use

This machine is a precision device. To ensure the full performance of this machine, be sure to observe the following important points. Failure to observe these may not only result in loss of performance, but may also cause malfunction or breakdown.

Main Unit

This machine is a precision device.

- Handle carefully, and never subject the machine to impact or excessive force.
- Use within the range of specifications.
- Diligently keep clean of cutting waste.
- Never attempt to move the table or spindle unit by hand with undue force.

Install in a suitable location.

- Install in a location that meets the specified conditions for temperature, relative humidity, and the like.
- Install in a quiet, stable location offering good operating conditions.
- Never use the machine in an environment where silicone substances (oil, grease, spray, etc.) are present. Doing so may cause poor switch contact.

This machine becomes hot.

- Never cover the ventilation holes with cloth, tape, or anything else.

Tool and Collet

The tool and the collet are precision components.

- Handle with care to prevent dropping.
- Clean frequently to prevent rust.
- Use a collet suitable for the machine.
- Use a tool suited to the workpiece and cutting method.

Chapter 1 Introduction



1-1 Introduction

Features

- This is a three-axis modeling machine. Despite its compact size, it offers a wide work area and plenty of power. You can get started cutting simply and easily, just by connecting it to your computer.
- A dedicated CAM program is included as a standard feature.
- AC servo motors are used for the X, Y, and Z axes. The software resolution (minimum unit of movement) is a high-resolution 1 μm (in the NC-code mode). Simultaneous three-axis control is possible.
- An ATC unit and rotary axis unit (A-axis) can be installed, enabling you to cut complex shapes in a single procedure. When the rotary axis unit is installed, simultaneous four-axis control is possible.
- The LEGO-FIX (R) ER16-compliant spindle nose lets you make use of a wide variety of tooling systems.
- The controller supports both RML-1 and NC codes, allowing you to use a wide range of software.
- Often-used features are grouped together on the handy panel for easy operation. Also, detailed settings are made on the computer. The display is large and designed for easy understanding.

Organization of the Documentation

The documentation for this machine is organized as described below. Read through the documents you need to ensure that you get full use of the machine.

- : Be sure to read this.
- : Read as required.



**MDX-540S/540
User's Manual (this document)**

When installing the machine
When you want to learn about basic use



**Roland Software Package
Software Guide**

When connecting the machine to a computer
When you want to learn about the included program and other software in detail



**VPanel
Online Help**



When making advanced settings for the machine
When you want to learn about the full range of features of the machine



**NC Code
Reference Manual**


When performing NC-code programming



**SRP Player
Installation and Setup Guide**

When installing and setting up the included CAM program
When you want to learn how to use the included CAM program




 indicates online help that you view on your computer. For information on how to view it, see the following section. The included program also comes with additional online help.

User's Manual for the ATC-equipped Models

The "ZAT-540 User's Manual" is included with the MDX-540SA and MDX-540A. That manual contains information on how to set up and operate the ATC unit. Be sure to read it together with this manual.

How to View the Online Help


- 1 Follow the instructions in the Roland Software Package Software Guide to install and set up VPanel.
- 2 From the [Start] menu, click [All Programs] - [Roland VPanel for MDX Pro II] - [VPanel for MDX Pro II Help].

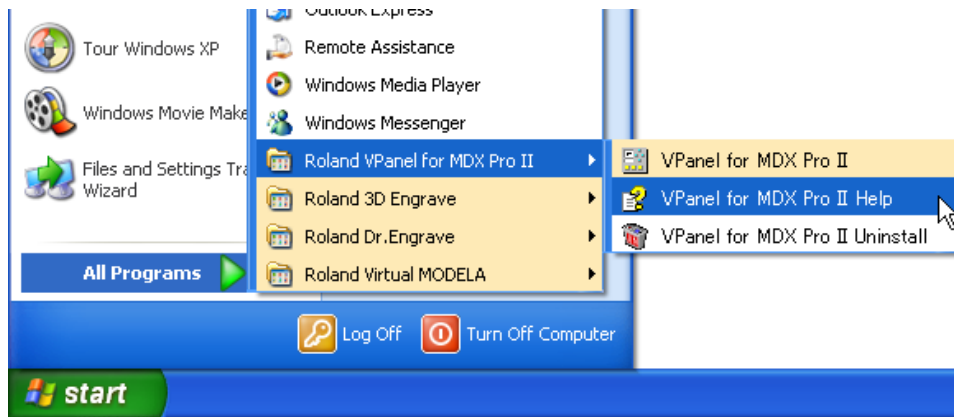


Installing and setting up a program also installs the program's online help at the same time. Use the same procedure to view other online help as well.

1-2 Part Names and Functions


Front View

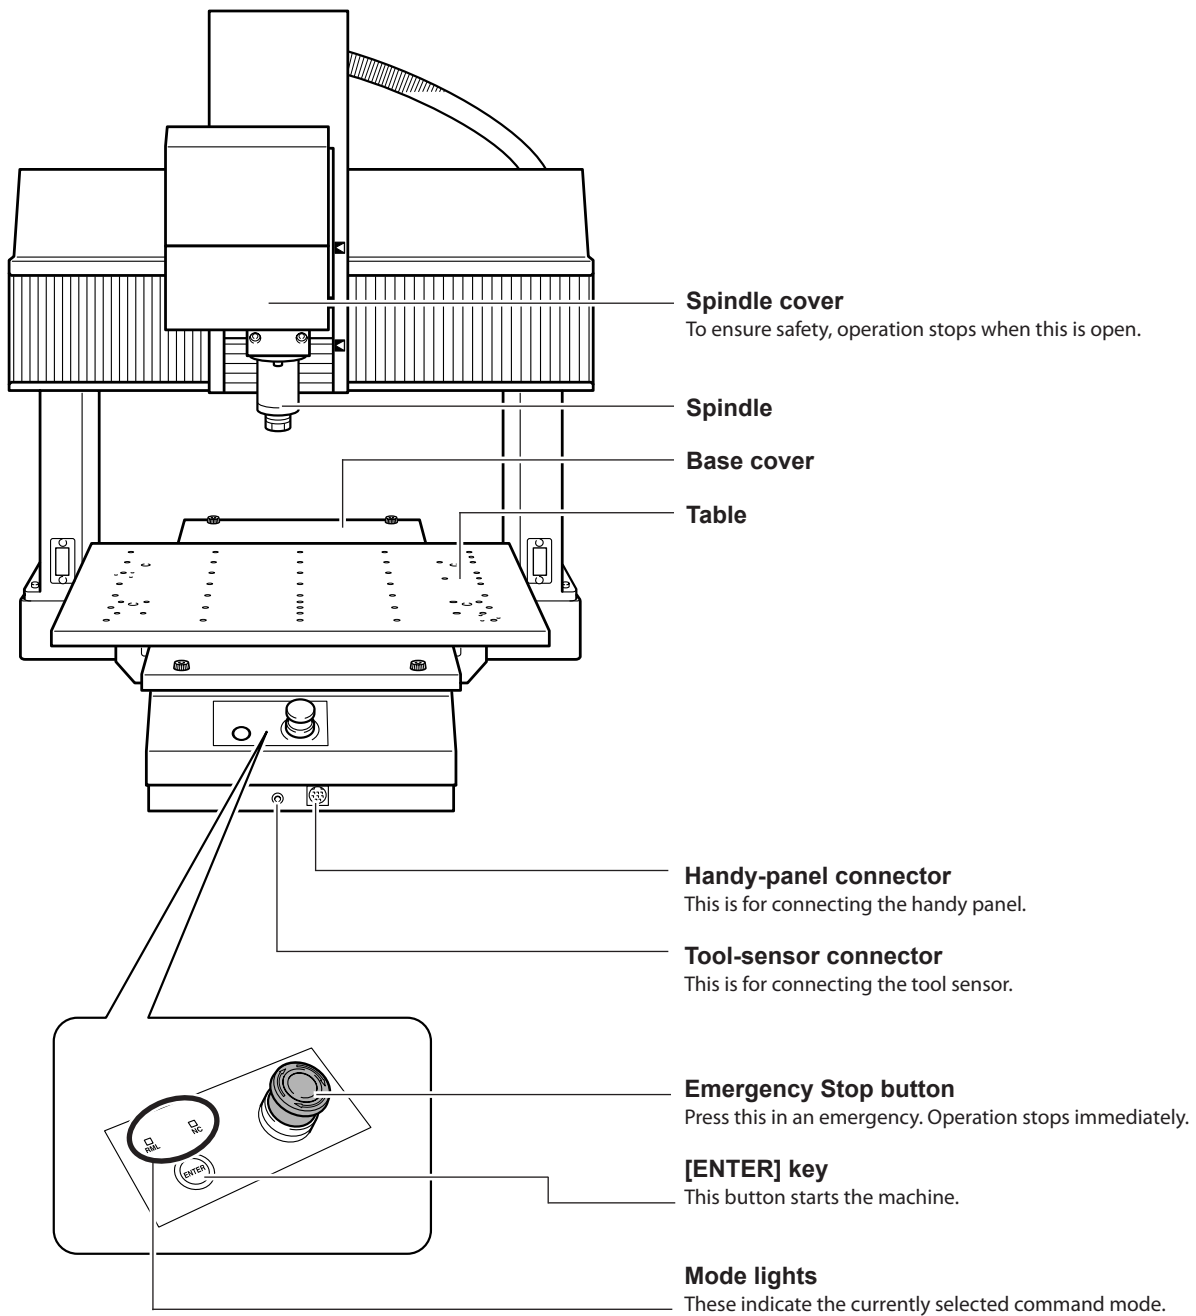


Spindle

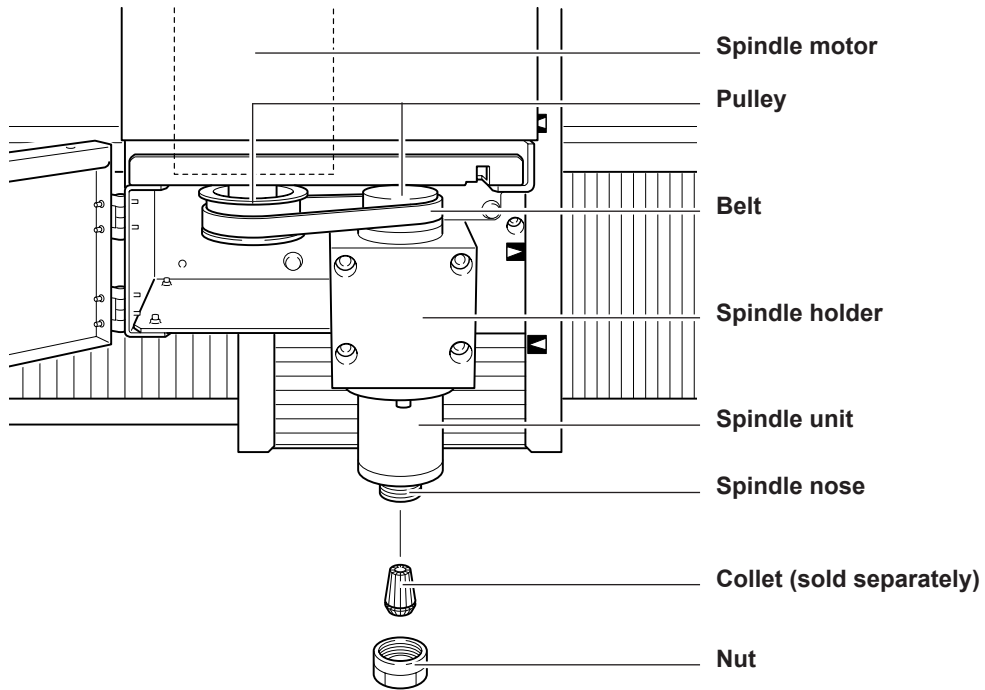

Side View (Right)

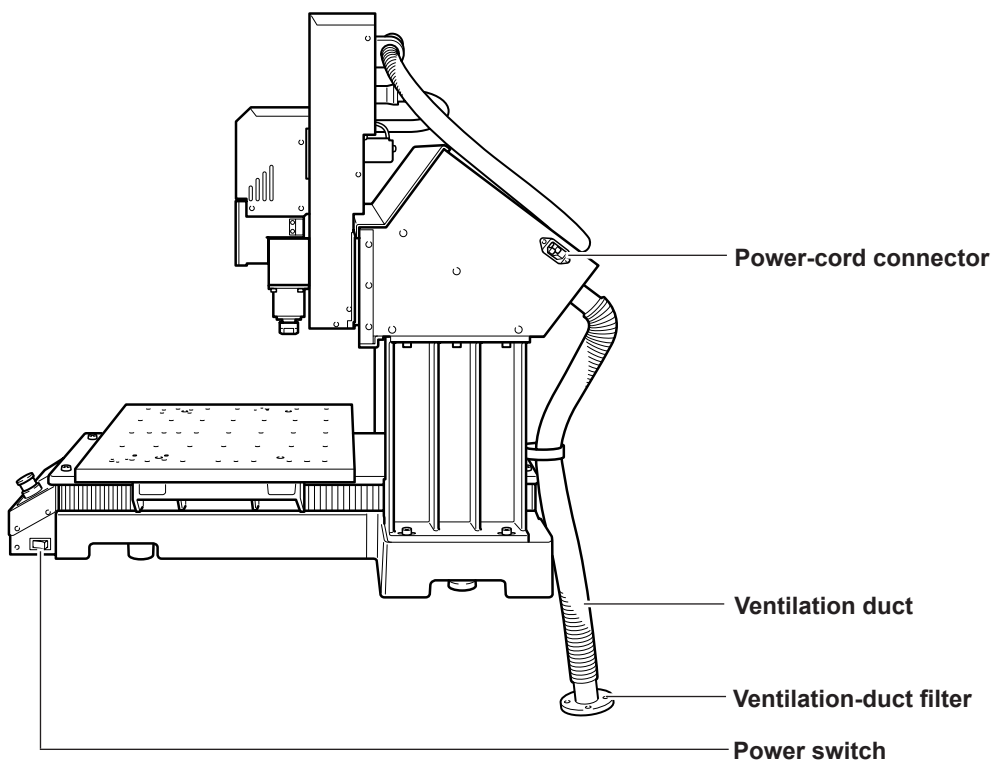

Side View (Left)

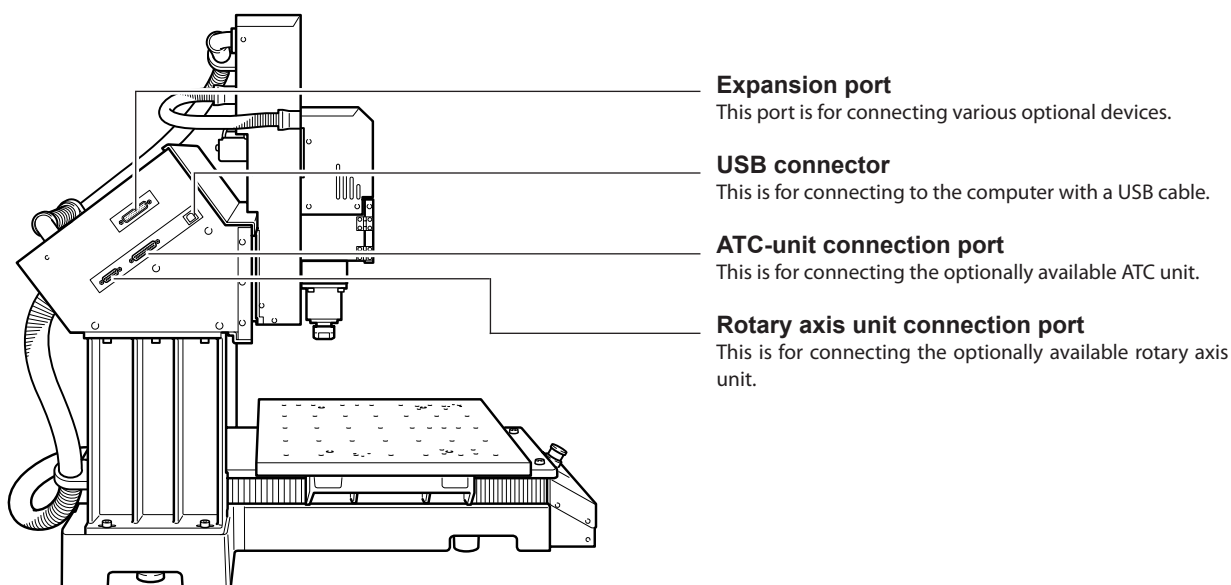

VPanel

Operation of the machine is controlled from the screen of your computer. VPanel is a dedicated program for controlling the machine.

The screenshot shows the VPanel software interface for an MDX-540 machine. The interface includes a menu bar (File, Set, Options, Help), a toolbar with icons for Cut, Base Point, Move Tool, Setup, Preferences, Magazine, Len. Offset, Dia. Offset, Register Tool, and Attach/Detach. The main display area shows the User Coordinate System with X, Y, Z, and A axes, all at 0.000 mm or deg. A 'Distance to Destination' box shows X, Y, Z, and A distances. The status area shows 'Standby' and buttons for Clear Error, Start Spindle, Move to VIEW, Pause, and Quit Cutting. The bottom left shows a timer for cutting time (0 h 0 min) and override settings for Cutting Speed and Spindle Rotating Speed, both at 100%. A spindle load indicator shows 0%.

This displays the installation status of optional equipment and the like.

This displays the present tool location.

Menu icons
You choose which item you want to control by clicking one of these icons.

This displays the cutting time. It is reset when the next cutting operation starts.

This displays the present rotating speed of the spindle. Changing the speed is also possible.

This displays the present feed rate.

This displays the present spindle load.

This displays the status of the machine. When an error occurs, a description of the error is displayed.

Note: The information displayed may vary depending on what optional devices are installed.

Handy Panel

You can also use the handy panel to control the machine. The handy panel brings together a number of frequently used features in one compact group.


Display Screen

This displays the presently selected coordinate system. This affects the displayed tool location and the origin settings.

This symbol indicates the item now controlled by the hand wheel.

This displays the present tool location.

This displays the fineness of scale for hand-wheel feed.

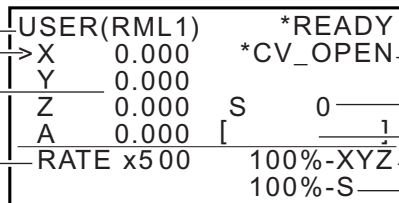

This displays the state of the spindle cover (open or closed).

This displays the present rotating speed of the spindle.

This displays the present spindle load.

This displays the feed-rate override value.

This displays the spindle override value.

Control Keys

Tool-sensor key

You use this when setting the Z-axis origin using the tool sensor.

Spindle key

This starts and stops the spindle.

Coordinate-system selection key


Each press of this key changes the coordinate system. This affects the displayed tool location and the origin settings.

Axis selection keys

These select the axis for hand-wheel feed and setting the origin. The [A] key is used when the optional rotary axis unit is installed.

Rate key

This selects the fineness of scale for hand-wheel feed. Lower scaling factors produce correspondingly slower movement, enabling you to accomplish precise positioning.

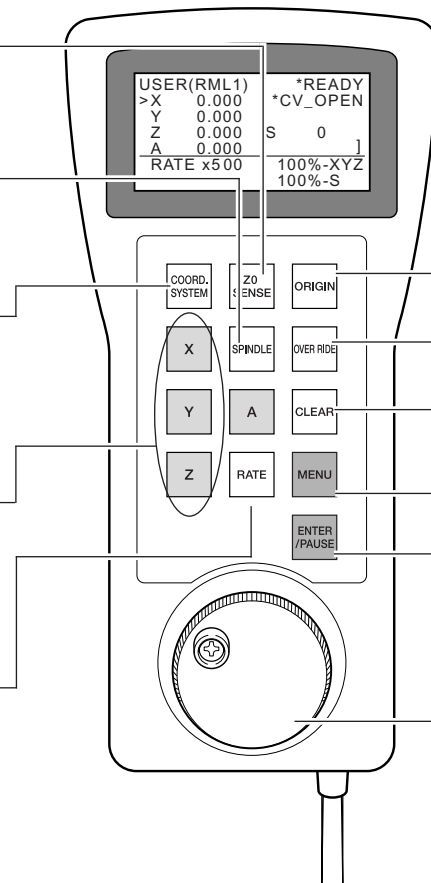

Origin setting key

This sets the origin at the present tool location.

Override key

This specifies feed-rate override or spindle override.

Clear key

You use this for such operations as deleting data received from the computer and recovering from errors.

Menu key

Pressing this key displays submenus.

Enter/Pause key

You use this to perform such operations as pausing cutting and manipulating menu items.

Hand wheel





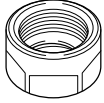
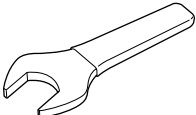
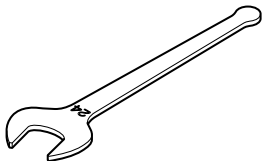
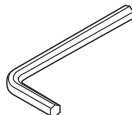






This performs such operations as hand-wheel feed for the axes and raising or lowering setting values.

Chapter 2 Emplacement and Installation

2-1 Included Items

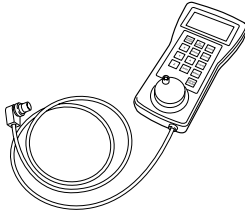Checking the Included Items

The following items are included with the machine. Make sure they are all present and accounted for.

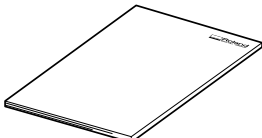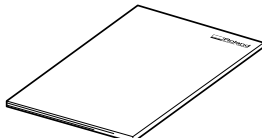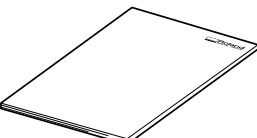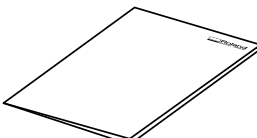			
Handy panel	Power cord	Tool sensor	Sensor cable
			
Nut (*)	Nut wrench (*)	Wrench (24 mm) (*)	Hexagonal wrench (4 mm)
			
Roland Software Package CD-RM	SRP Player CD-ROM	User's Manual (this manual)	Roland Software Package Software Guide
			
SRP Player Installation and Setup Guide	NC Code Reference Manual		

* These are not included with the MDX-540SA and MDX-540A (ATC-equipped models). For information on other items included with the MDX-540SA and MDX-540A, refer to the "ZAT-540 User's Manual."

2-2 Installation

Emplacement and Installation Operations

⚠️WARNING **Unloading and emplacement are operations that must be performed by 4 persons or more.**

Tasks that require undue effort when performed by a small number of persons may result in physical injury. Also, if dropped, such items may cause injury.

The weight of the machine alone is 102 kg (225 lb.). Perform unloading and emplacement with care. Using a lifter or other load-handling equipment is recommended.

Installation Environment

Install in a quiet, stable location offering good operating conditions. An unsuitable location can cause accident, fire, faulty operation, or breakdown.

⚠️WARNING **Install the machine in a location that is level, stable, and able to bear the weight of the machine.**

The total weight including the stand and other optional items may reach 300 kg (650 lb.) or more. Installation in an unsuitable location may cause a major accident, including tipover, fall, or collapse.

⚠️WARNING **Never install in a location exposed to open flame.**

Cutting waste may ignite. Powdered material is extremely flammable, and even metal material may catch fire.

⚠️WARNING **Never install close to any flammable object or in a gas-filled location.**

Combustion or explosion may be a danger.

⚠️WARNING **Never install out of doors or in any location where exposure to water or high humidity may occur.**

Doing so may result in fire or electrical shock.


⚠️WARNING **Position so that the power plug is within immediate reach at all times.**

This is to enable quick disconnection of the power plug in the event of an emergency. Install the machine next to an electrical outlet. Also, provide enough empty space to allow immediate access to the electrical outlet.

- Never location in a location subject to wide fluctuations in temperature or humidity.
- Never install in a location subject to shaking or vibration.
- Never install in a locations where the floor is tilted, not level, or unstable.
- Never install in a dusty or dirty location.
- Never install in a location exposed to direct sunlight or near air-conditioning or heating equipment.
- Never install in a location exposed to considerable electrical or magnetic noise, or other forms of electromagnetic energy.
- Never install in an environment where silicone substances (oil, grease, spray, etc.) are present.

Installation Space

Ensure that at least the following amount of space is available.

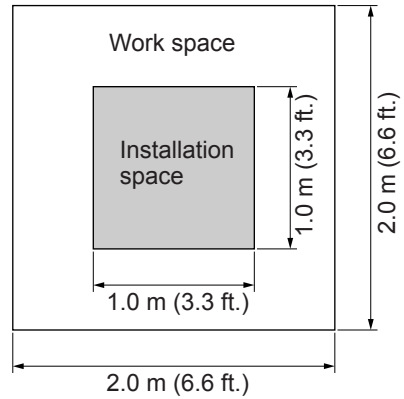


Unpacking

Packing materials are attached to protect the machine from vibration during shipment. Remove these after emplacement. Also, pull out the ventilation duct.

- Remove all packing materials. Any that remain may cause faulty operation or breakdown when the power is switched on.
- The packing materials are required when moving the machine to a different location. Store them carefully so that they do not get misplaced.


⚠WARNING Carry out these operations before you connect the power cord. Inadvertent powerup may result in pinched hands or other injury.

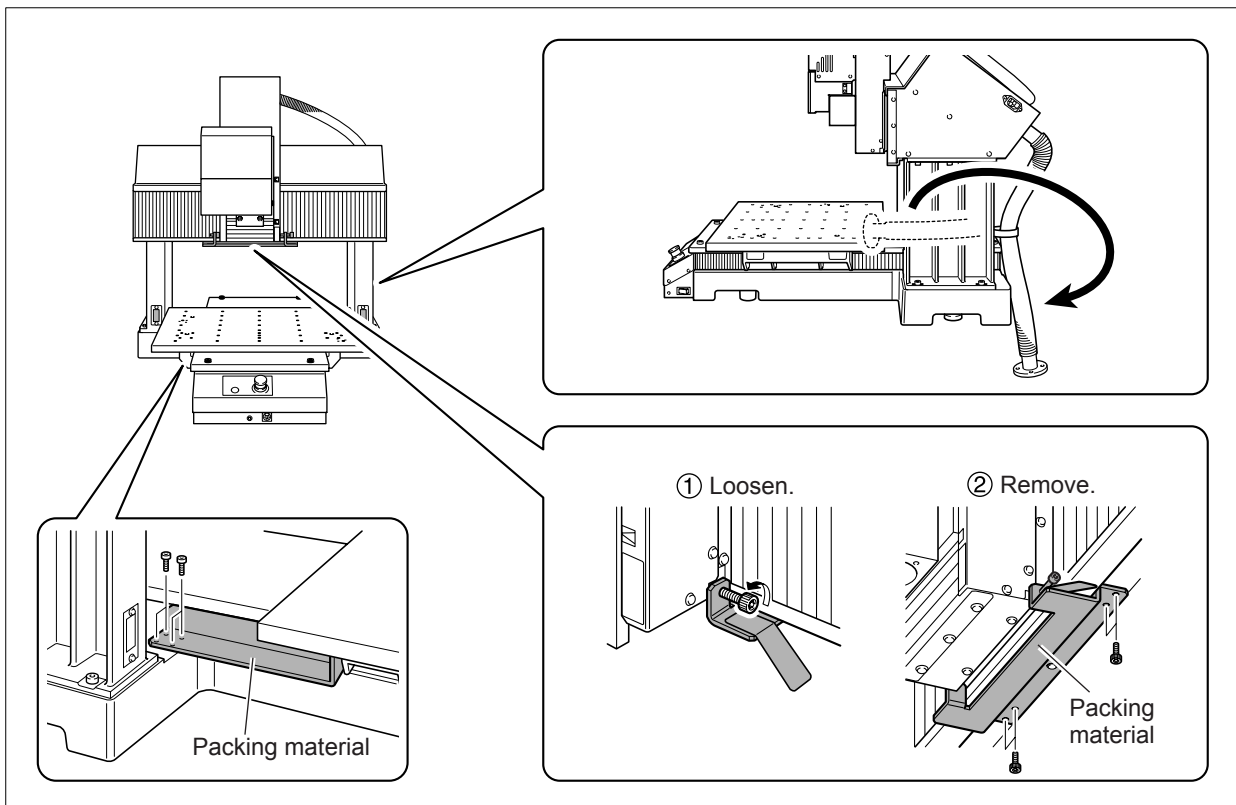

For the MDX-540SA and MDX-540A (ATC-equipped Models)

Remove the retaining screw and rubber bushing for the magazine cover.


- ① Remove the screw.
- ② Gently open the magazine cover and remove the rubber bushing.
- ③ Gently close the magazine cover.

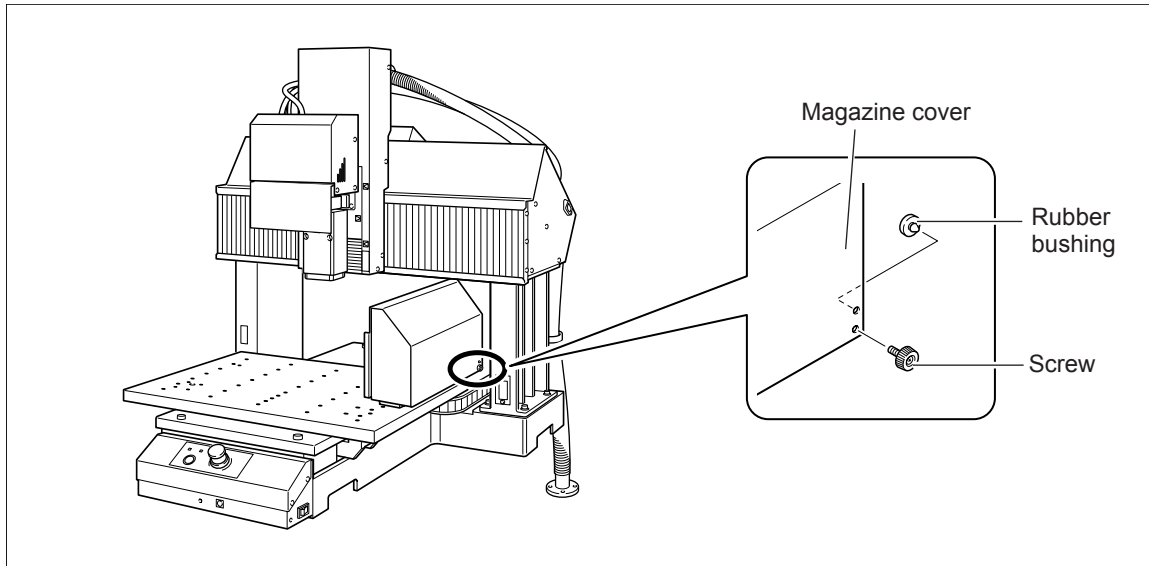

2-3 Cable Connections

Connecting the Handy Panel



Make sure the power to the machine is switched off before attempting to connect or disconnect cables.

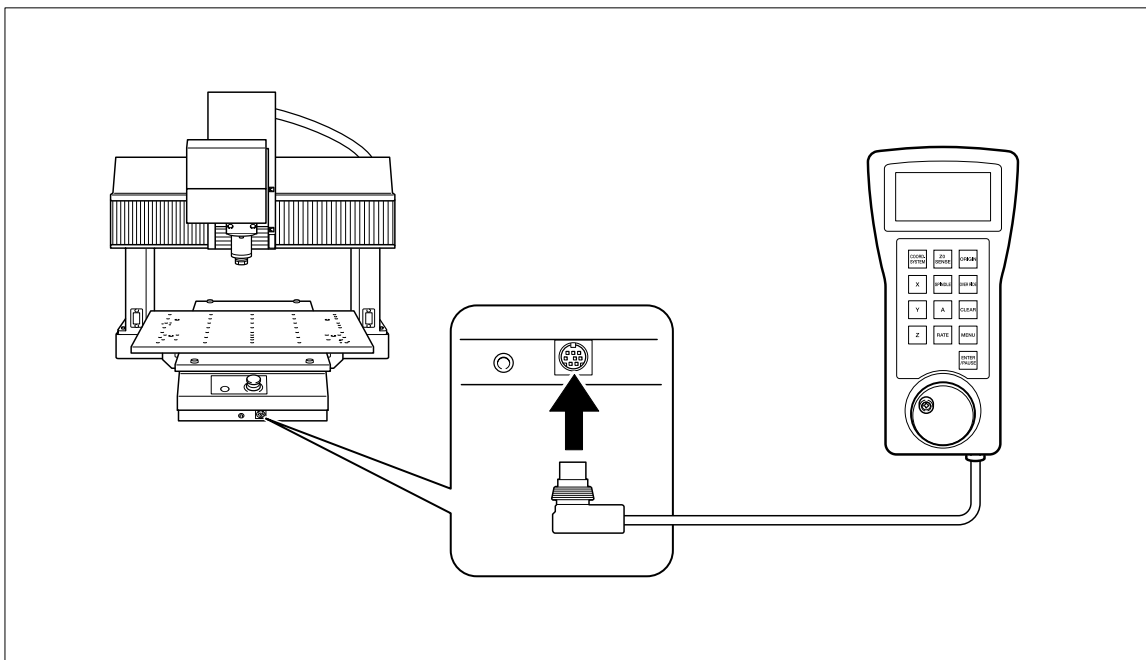

Note: Connecting the handy panel is not required to operate the machine.

Connecting the Power Cord

- ⚠️WARNING** Connect to an electrical outlet that complies with this machine's ratings (for voltage and frequency).
Provide a power supply whose amperage is 7 A or higher (for 100 to 120 V) or 4 A or higher (for 220 to 240 V).
- ⚠️WARNING** Handle the power cord, plug, and electrical outlet correctly and with care. Never use any article that is damaged.
Using a damaged article may result in fire or electrical shock.
- ⚠️WARNING** When using an extension cord or power strip, use one that adequately satisfies the machine's ratings (for voltage, frequency, and current).
Use of multiple electrical loads on a single electrical outlet or of a lengthy extension cord may cause fire.
- ⚠️WARNING** Connect to ground.
This can prevent fire or electrical shock due to current leakage in the event of malfunction.

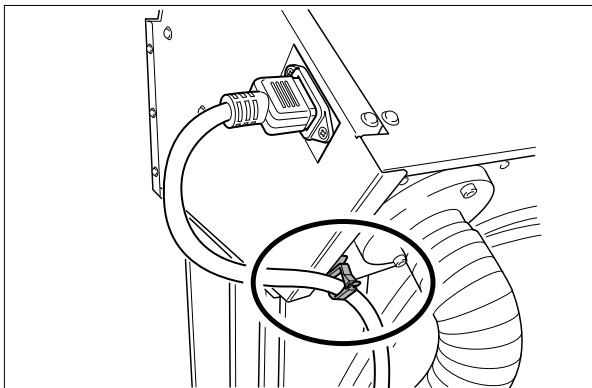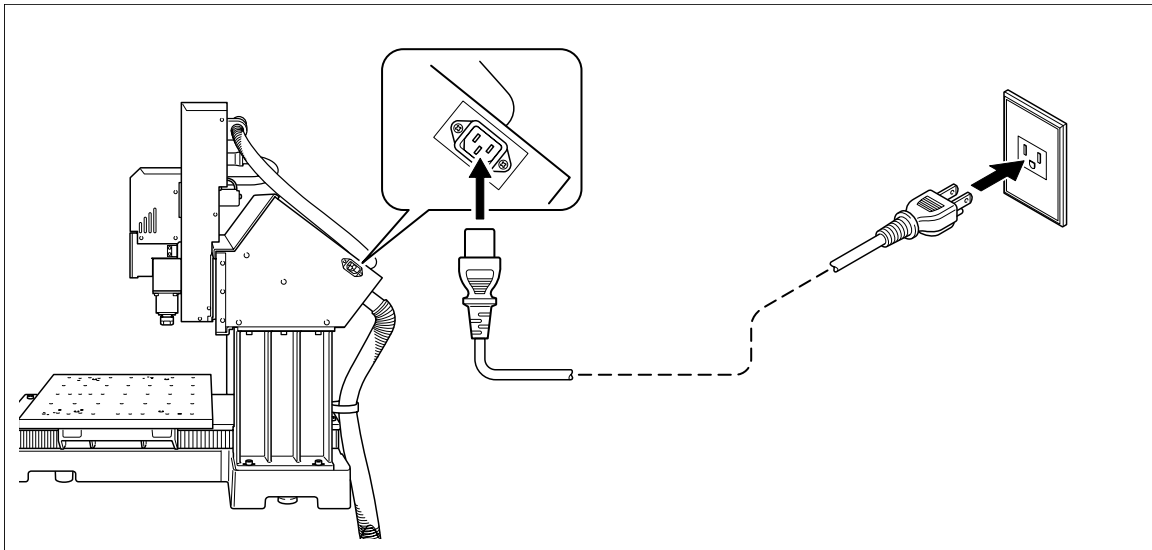


Connecting the USB Cable

At this time, keep the cable unconnected until you carry out this operation.

Follow the instructions in the separate Roland Software Package Software Guide to make the connection.

☞ P. 22 "Organization of the Documentation"

- Be sure to read through the Roland Software Package Software Guide. Making the connection without doing so may cause driver installation to fail and make use impossible.
- Never connect two or more machines to one computer.
- Use a shielded USB cable having a length of 3 m (10 ft.) or less.
- Never use a USB hub.

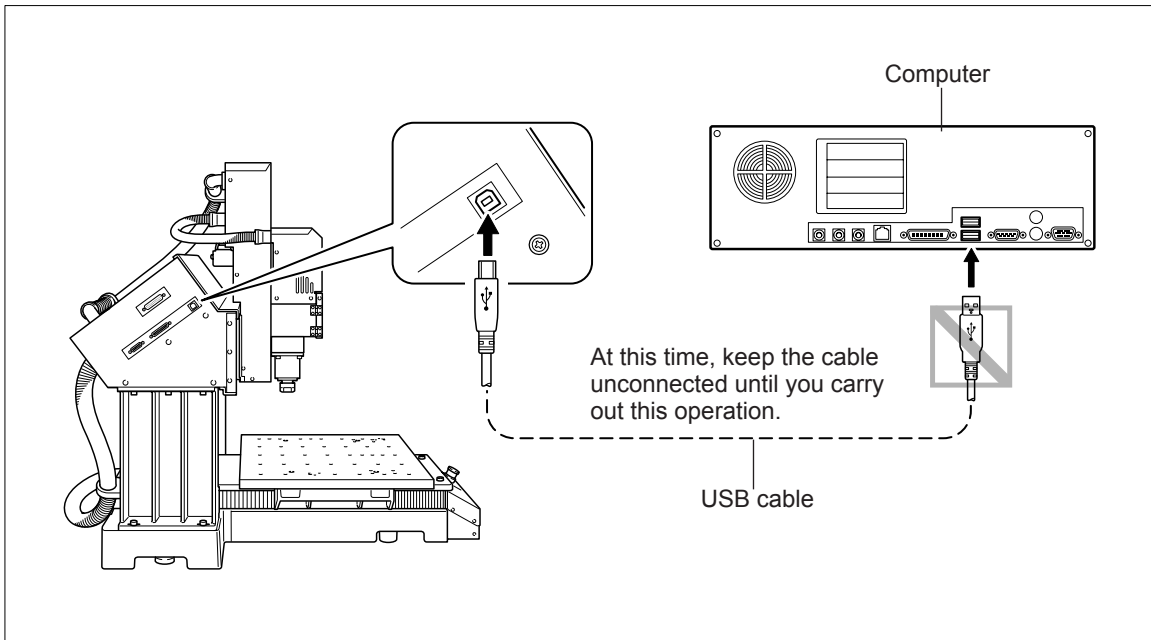


Connecting Multiple Machines

VPanel cannot control more than one machine at the same time. When two or more machines are connected to a single computer, you can control only one. When you're connecting more than one machine, it is necessary to set the machine ID numbers in advance.

For more information about machine IDs, refer to the VPanel Online Help.

☞ P. 23 "How to View the Online Help"

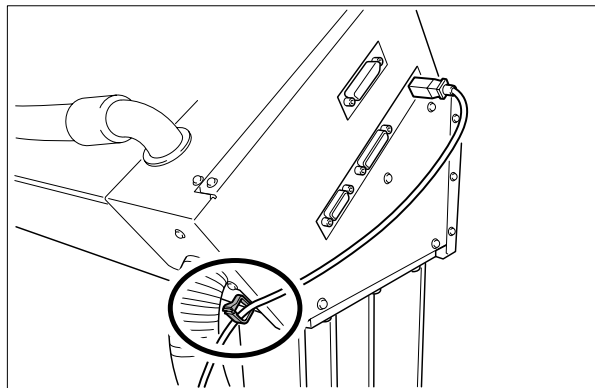


2-4 Selecting the Language

Selecting the Language Used for Text on the Handy Panel

Select the language to use for text displayed on the handy panel.


Procedure

1

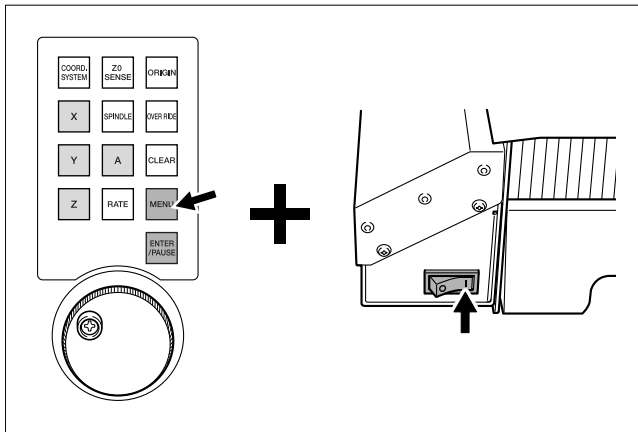


While holding down the [MENU] key, turn on the power switch.

2

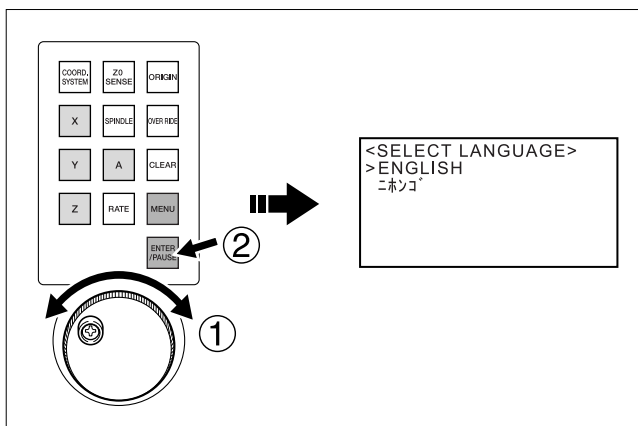

① Turn the hand wheel to select the language.
② Press the [ENTER] key.

3

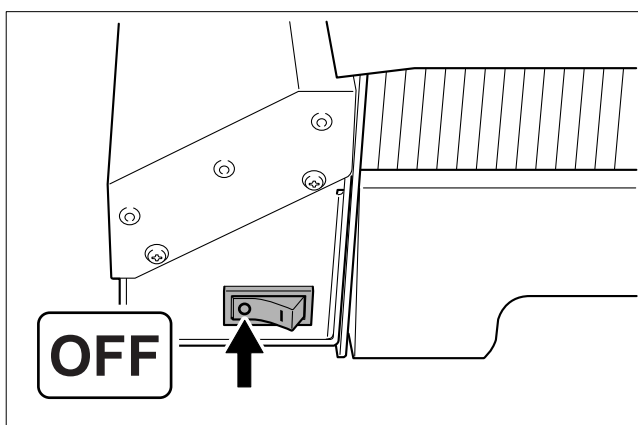

Switch off the power switch.

⚠WARNING


Be sure to turn off the power switch here.

Pressing the [ENTER] key a second time starts (initializes) the machine. Be sure to switch off the power until you are familiar with the operation of the machine.

Chapter 3 Basic Operation

3-1 Emergency Stop to Ensure Safety


How to Perform an Emergency Stop

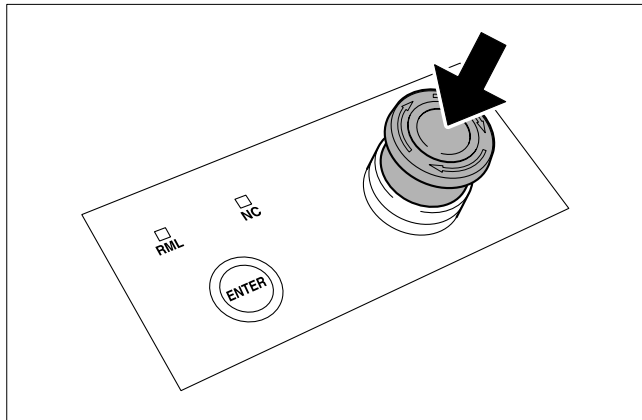


Press the Emergency Stop button.
Operation stops immediately.

To Cancel an Emergency Stop

Procedure

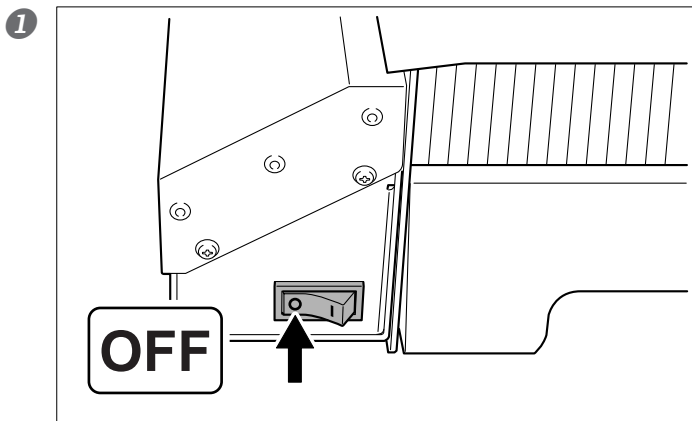


Switch off the power switch.

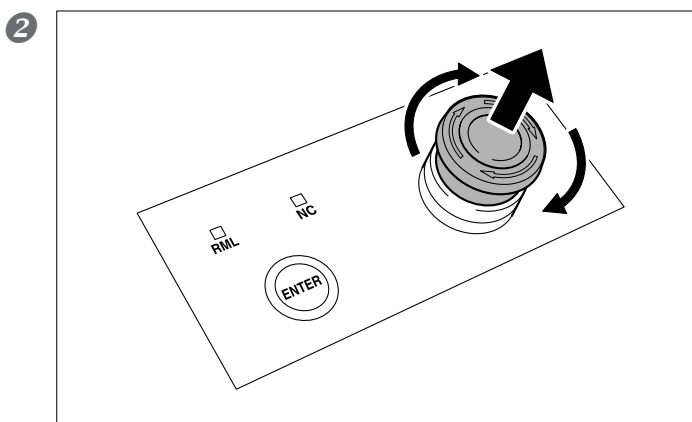

Turn the button in the direction of the arrows.

3

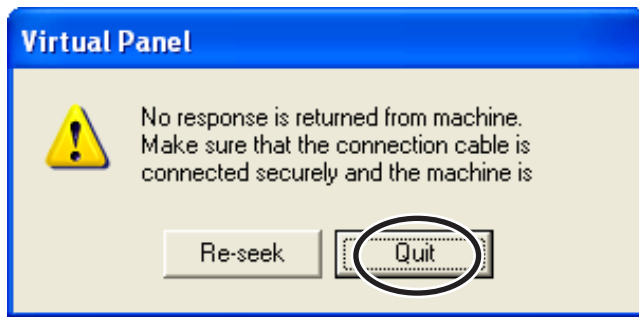

If this window appears on the computer, click [Quit].

Spindle Cover

If the spindle cover is opened while cutting is in progress, operation is stopped to ensure safety. To recover from this, shut down the machine, then close the spindle cover.

When the spindle cover is open, operations such as cutting and manual feed cannot be performed.


3-2 Starting and Quitting

How to Start the Machine

Follow the procedure below to start the machine. When startup is complete, the machine is ready for use.


Procedure

1

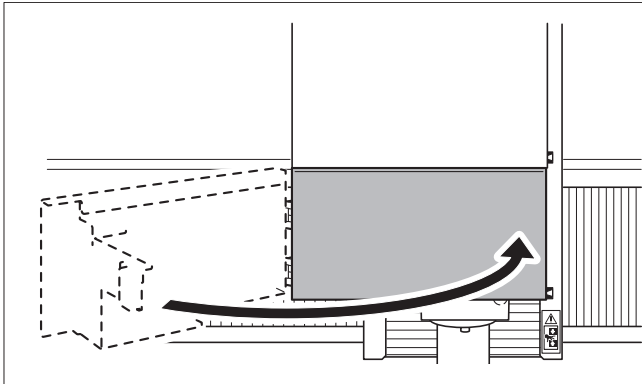


Close the spindle cover.

2

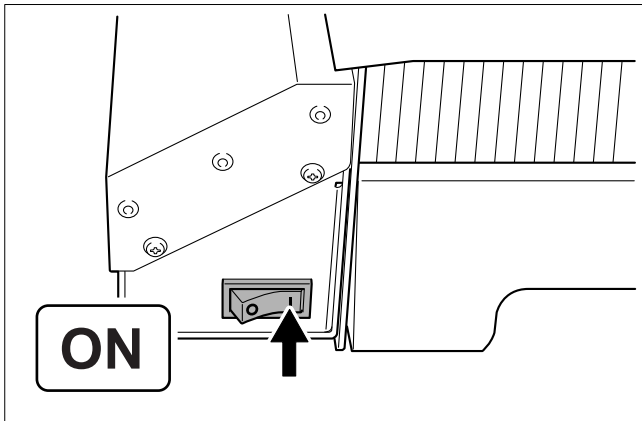

Switch on the power switch.

3

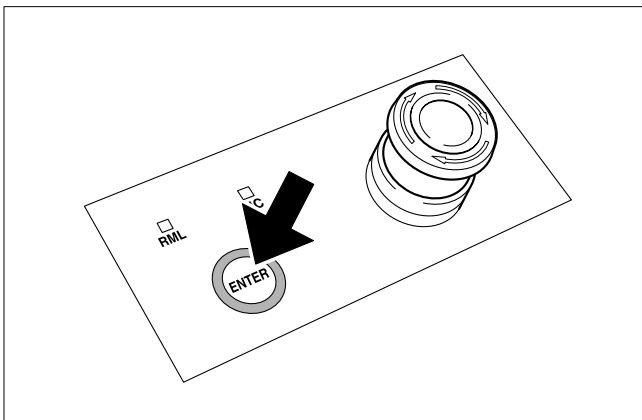


⚠WARNING: This procedure makes the machine operate. Before you perform this procedure, check to make sure that operation of the machine will not create any hazard or danger.


Press the [ENTER] key on the machine.

Alternatively, press the [ENTER] key on the handy panel.


This procedure is "initialization."

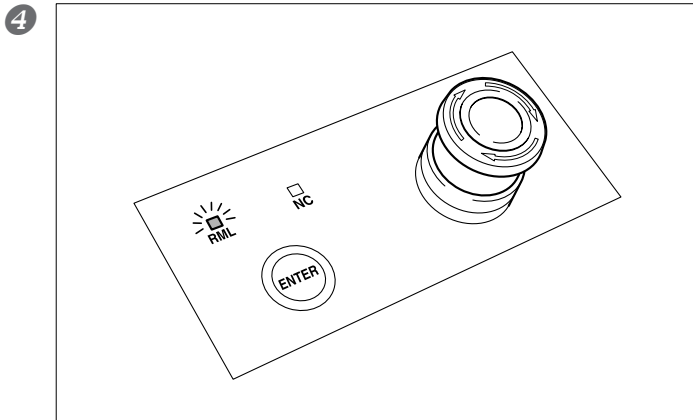


Wait until operation stops, then check to make sure the Mode light is on.

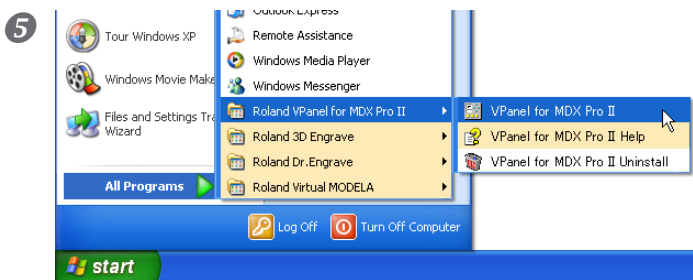

On the computer, start VPanel. From the [Start] menu, click [All Programs] - [Roland VPanel for MDX Pro II] - [VPanel for MDX Pro II].

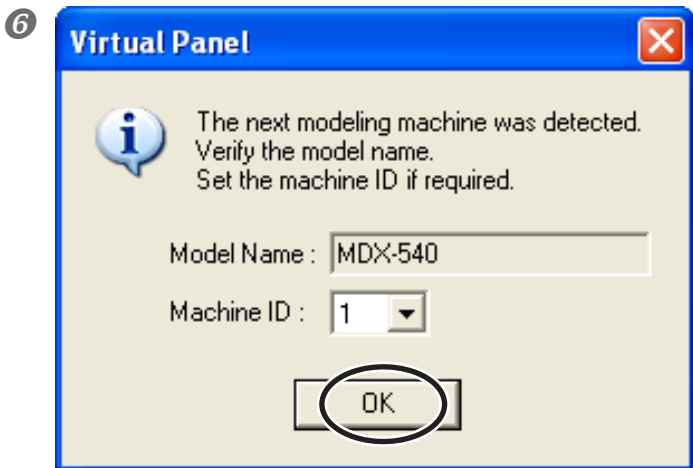

Click [OK].

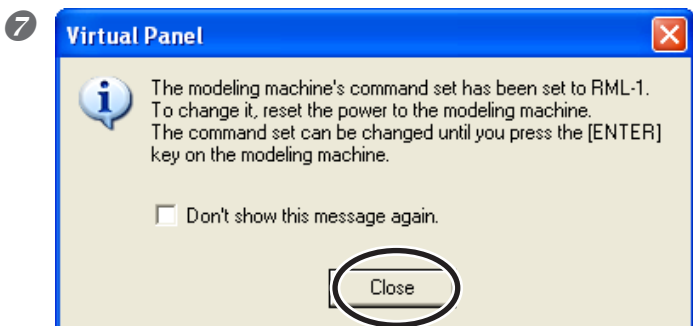

Click [Close].

This completes startup of the machine.


Selecting the Command Mode

The default command mode is "RML-1." If you want to choose "NC code," then select the command mode.


☞ P. 45 "3-3 Selecting the Command Mode"

How to Shut down

Procedure

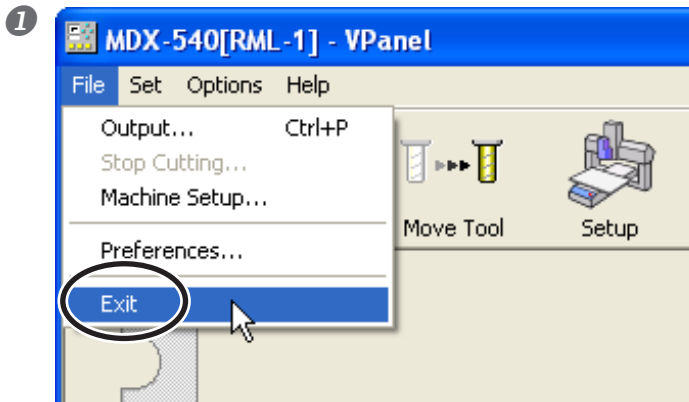


On the computer, quit VPanel.
Go to the [File] menu and click [Exit].

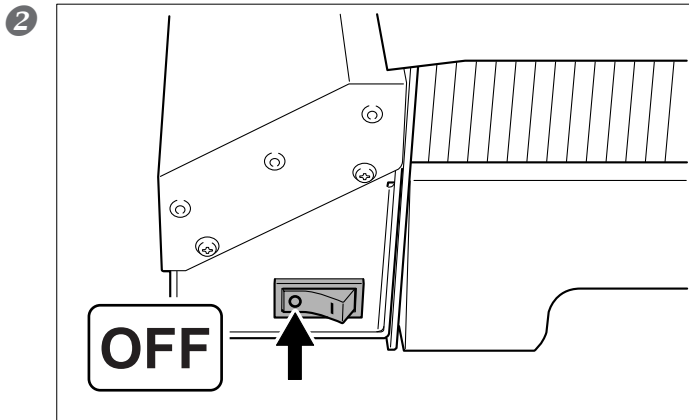

Switch off the power switch.

3-3 Selecting the Command Mode

Verifying the Command Mode

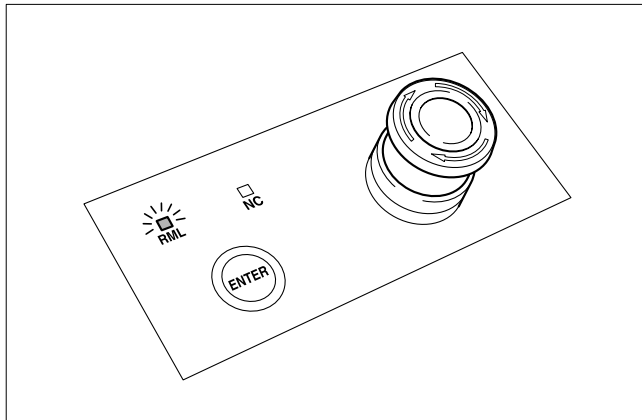


Select the appropriate command mode for the program you're using. The default for the command mode is "RML-1."

To check the command mode, examine the Mode lights on the machine.

How to Select the Command Mode


Procedure

1

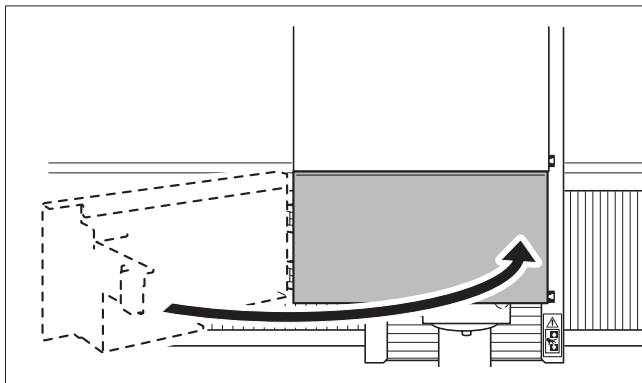


Close the spindle cover.

2

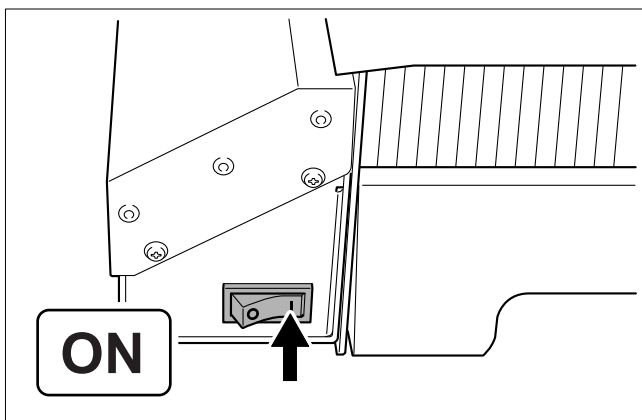


Switch on the power switch.


3-3 Selecting the Command Mode

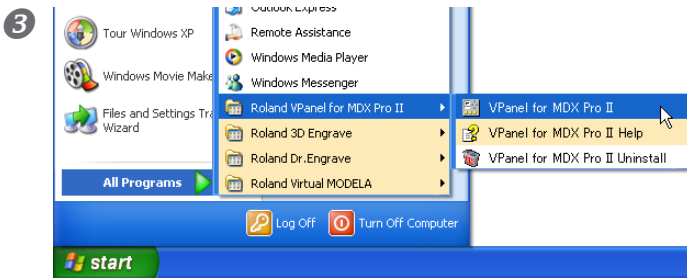


On the computer, start VPanel. From the [Start] menu, click [All Programs] - [Roland VPanel for MDX Pro II] - [VPanel for MDX Pro II].

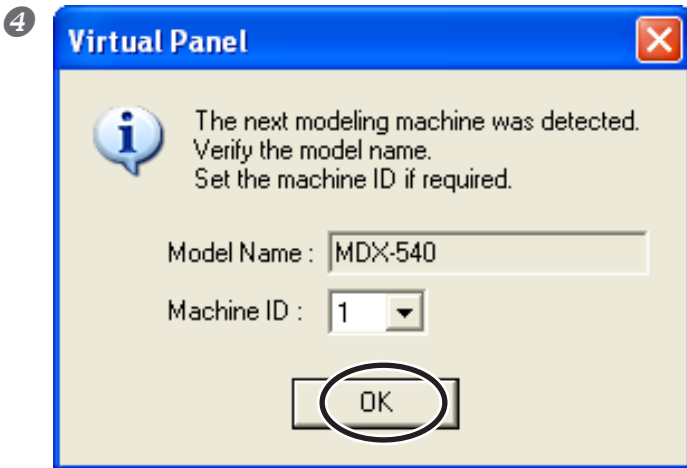

Click [OK].

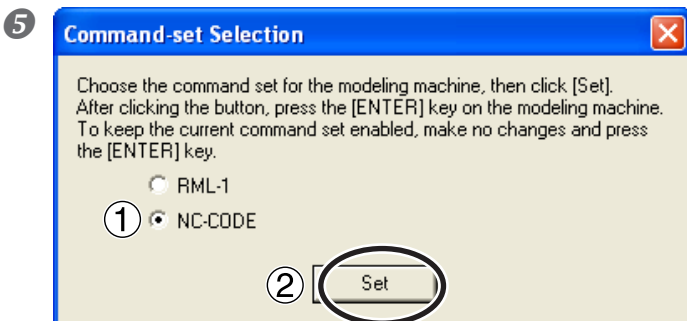

- ① Select the command mode.
- ② Click [Set].

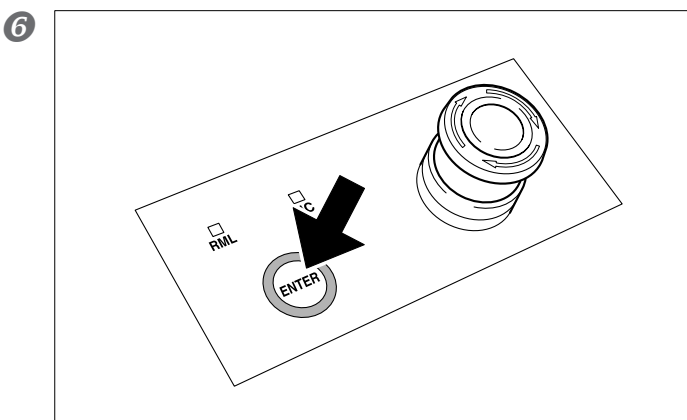


⚠WARNING: This procedure makes the machine operate. Before you perform this procedure, check to make sure that operation of the machine will not create any hazard or danger.

Press the [ENTER] key on the machine.


Alternatively, press the [ENTER] key on the handy panel.

7

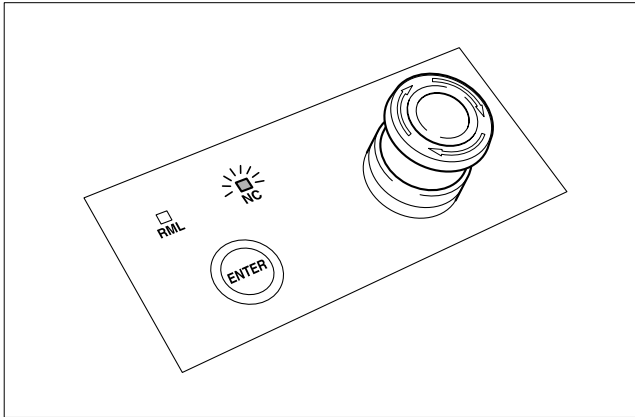

Wait until operation stops, then check to make sure the Mode light is on.

8

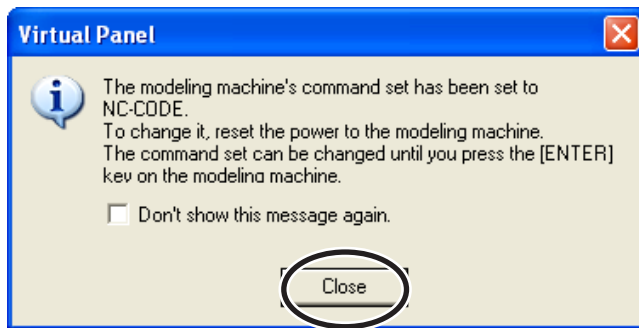

Click [Close].

This completes startup in the new command mode.


3-4 Moving the Tool

Manual Feed

Moving the tool manually is called "manual feed." This operation cannot be performed when the spindle cover is open, during cutting operations, or while paused.


Procedure

1

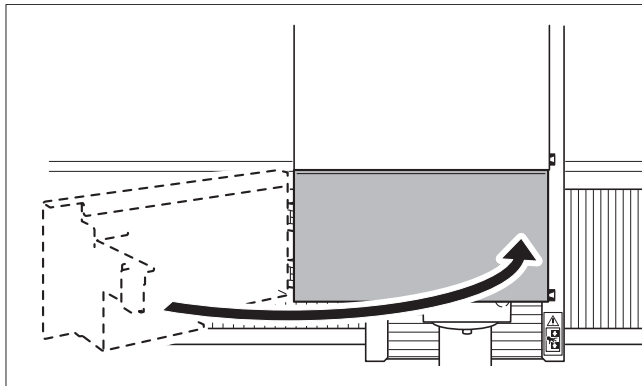

Close the spindle cover.

2

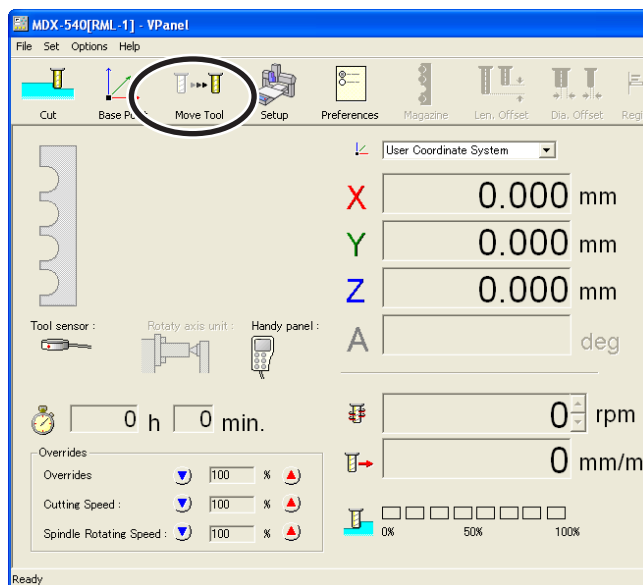


In VPanel, click the [Move Tool] icon. Alternatively, click the [Base Point] icon.

- 3 **⚠️ WARNING:** This procedure makes the machine operate. Before you perform this procedure, check to make sure that operation of the machine will not create any hazard or danger. Click a feed button.

Feed buttons
These move the tool.

Clicking this button performs rapid movement to the back-left area of the table (the VIEW position). This is useful when you want to examine the state of the workpiece (the material to cut).

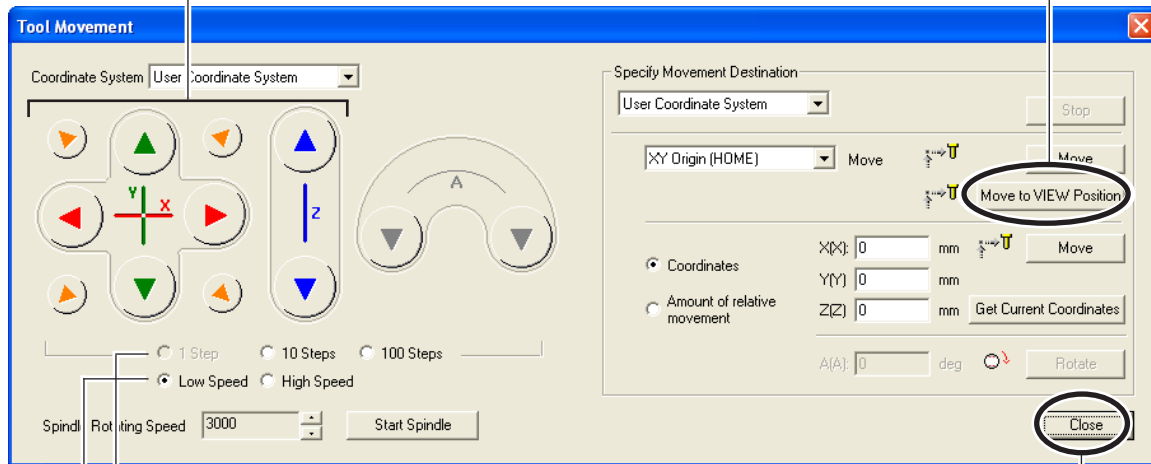

Selecting one of these enables "step feed." Each click of a feed button moves the specified number of steps. One step is 0.001 millimeters. Note that when you're in the RML-1 mode, [x1] cannot be selected.

Selecting one of these enables "jog feed." Holding down a feed button performs continuous movement at the selected speed.

When you're finished with the operation, use this button to close the window.

Operation Using the Handy Panel

You can also perform this operation using the handy panel.


☞ P. 77 "Chapter 5 Handy Panel"

About the Displayed Tool Position


Coordinate View

The main window in VPanel displays the present location of the tool as numerical values. Using these lets you perform manual feed accurately, which can be very convenient in tasks such as aligning the workpiece.

The numerical values that indicate the location of the tool are called "coordinates," and the starting point for the coordinates is called the "origin." The following figure shows a location that is shifted from the origin by 50 millimeters along the X axis, 30 millimeters along the Y axis, and 20 millimeters along the Z axis. This X-axis distance is called the "X-axis coordinate" (or sometimes just the "X coordinate"), and the Y- and Z-axis distances are similarly called the "Y-axis coordinate" and the "Z-axis coordinate." The distances from the origin for the respective axes to the tool are therefore the corresponding coordinate values.

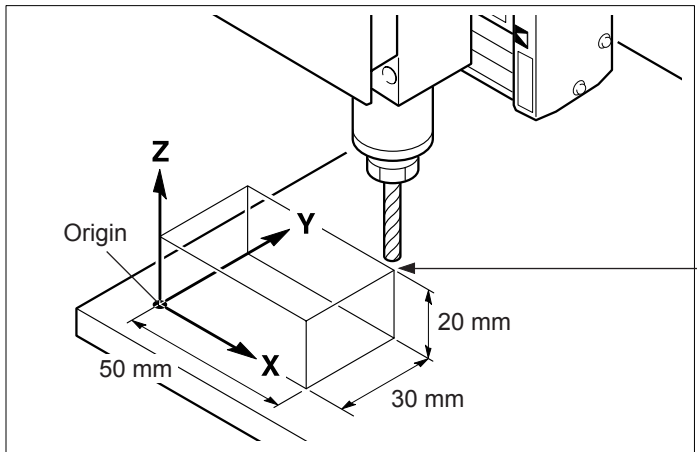

This position is expressed as "X = 50 mm, Y = 30 mm, Z = 20 mm."

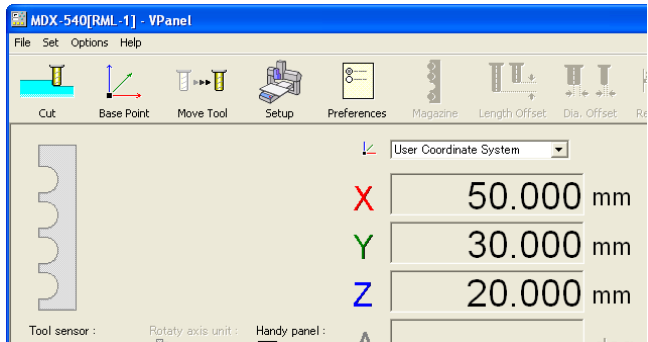


X-axis coordinate
Y-axis coordinate
Z-axis coordinate

Selection of the Coordinate System

You can freely change the location of the origin. When the origin is changed, the positioning also changes, even though the coordinate values themselves stay the same. Selecting a coordinate system should be thought of as switching to different coordinates that have a different origin. When the command mode is set to RML-1, it may be a good idea to keep "User Coordinate System" selected at all times.

Note, however, that the selection of the coordinate system that you make here affects only the displayed tool position. The location of cutting does not change.

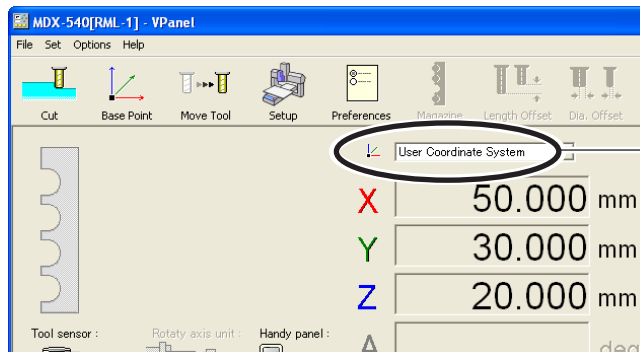

Selected coordinate system


This switches only the coordinate view. Cutting operations are not affected.

For information on how to change the location of the origin, refer to the following.

- ☞ P. 62 "Determining the Reference Position for Cutting" (RML-1 Mode)
- ☞ P. 67 "Determining the Reference Position for Cutting" (NC-code Mode)

Changing the Unit of Measurement for Display

You can switch the unit of measurement used for displaying coordinates between millimeters and inches. Click the [Preferences] icon, then select [Inches].

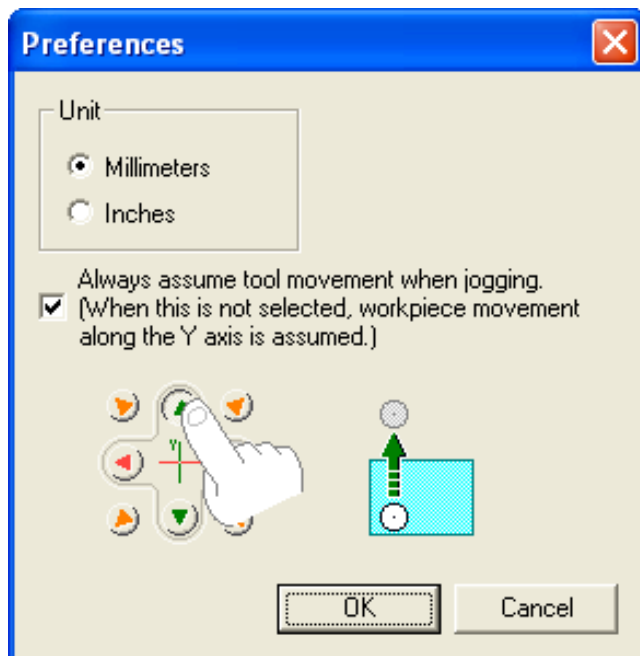


3-5 Starting and Stopping Spindle Rotation

Starting or Stopping the Spindle

You can manually start and stop rotation of the spindle. This operation cannot be performed when the spindle cover is open, during cutting operations, or while paused. (Stopping the spindle while operation is paused is possible.)


Procedure

1

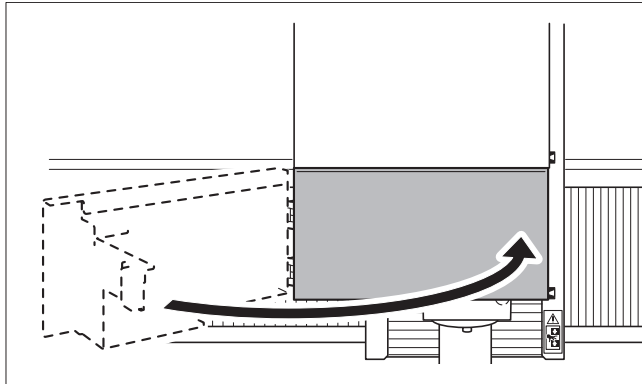


Close the spindle cover.

2

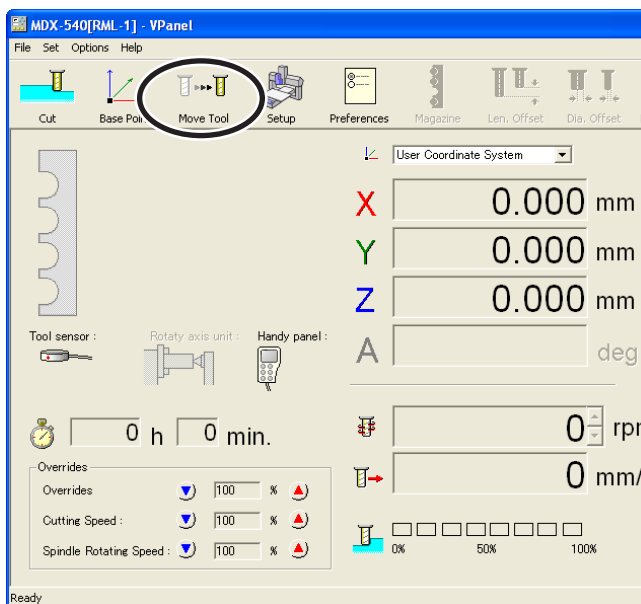

In VPanel, click the [Move Tool] icon. Alternatively, click the [Base Point] icon.

- 3 **⚠WARNING:** This procedure makes the machine operate. Before you perform this procedure, check to make sure that operation of the machine will not create any hazard or danger.
Click [Start Spindle] button.

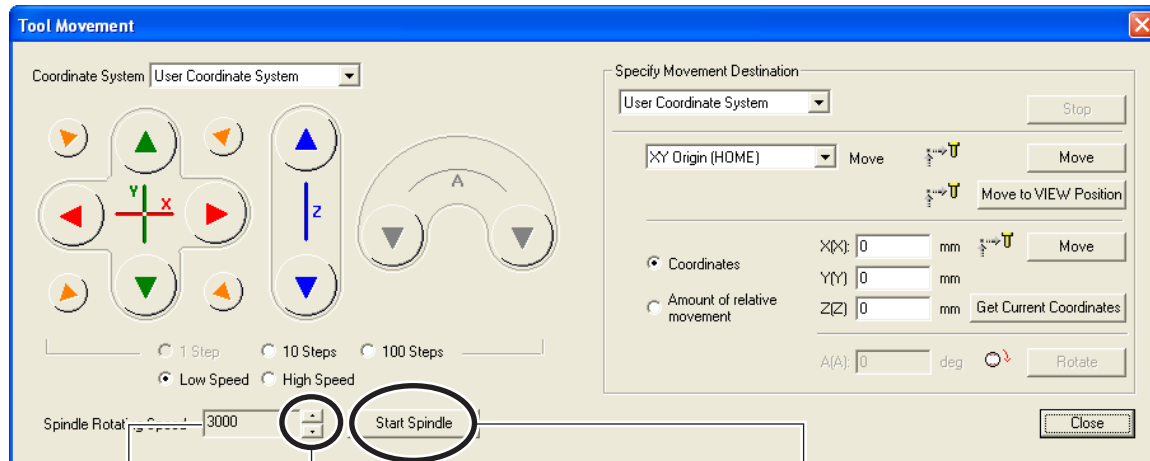

This adjusts the speed of spindle rotation.

This displays the present rotating speed of the spindle.

Clicking this starts the spindle. Click it a second time to stop.

Important Note on the Spindle Speed During Cutting

The setting for the spindle speed made here normally does not affect cutting operations. The rotating speed during cutting operations is controlled by commands in the cutting data sent from the computer, and so this setting is ignored. To adjust the rotating X-axis during cutting operations, use an override.

☞ P. 76 "4-6 Overrides"

Operation Using the Handy Panel


You can also perform this operation using the handy panel.

☞ P. 77 "Chapter 5 Handy Panel"

3-6 Pausing and Quitting Cutting

Pausing and Resuming Operation

This operation pauses cutting operation. Resuming from the location where paused is possible.

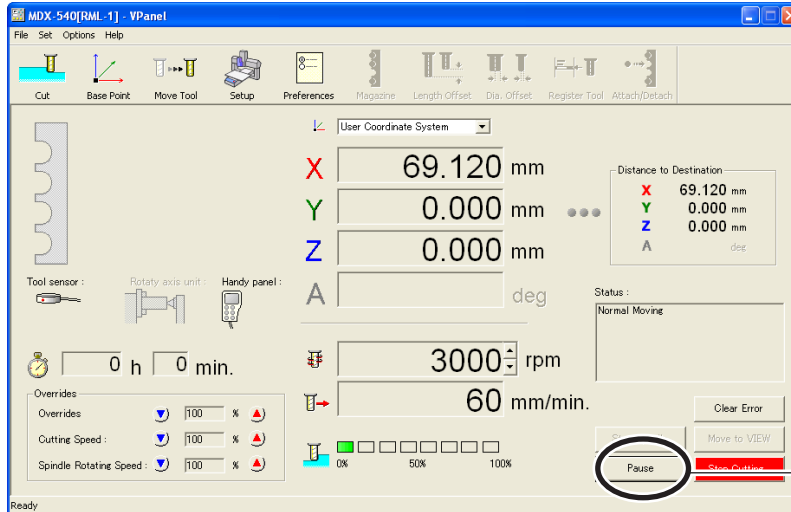

Clicking this pauses operation. Click it a second time to resume.

When the machine is paused, you can perform the following operations.

VPanel

- Moving to the VIEW position
- Stopping the spindle (Starting the spindle is not possible.)
- Changing the spindle speed
- Setting overrides
- Quitting cutting

Handy Panel

- Hand-wheel feed
- Starting or stopping the spindle
- Setting overrides
- Quitting cutting

Operation Using the Handy Panel


You can also perform this operation using the handy panel.

☞ P. 77 "Chapter 5 Handy Panel"


Quitting Cutting

This operation completely stops cutting. Unlike a pause, the operation cannot be resumed.

Procedure

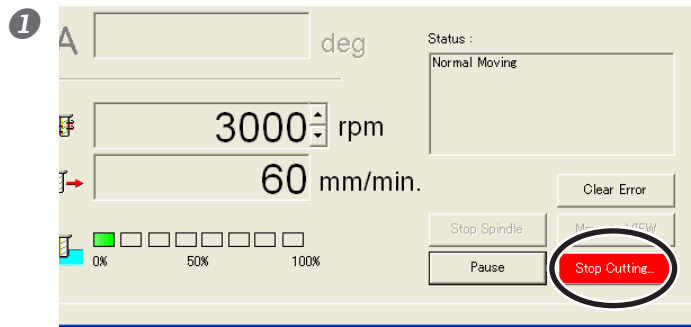

In VPanel, click [Stop Cutting].

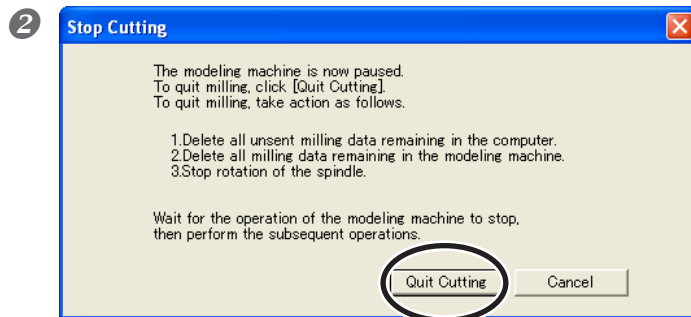

Click [Quit Cutting].

Operation Using the Handy Panel

You can also perform this operation using the handy panel.

☞ P. 77 "Chapter 5 Handy Panel"

Chapter 4 Getting Ready for and Performing Cutting


4-1 Cutting Area

Workpiece Size and Location Where Secured in Place



Arrange the workpiece (the material cut), frames, and the like so that they fit within the determined range. Anything extending beyond may strike moving parts. Be sure to observe this requirement, as failure to do so may result in damage to the workpiece or frame or malfunction of the machine.

⚠️WARNING: Failure to comply may lead to danger of injury by a broken tool thrown out with force.

Standard Table

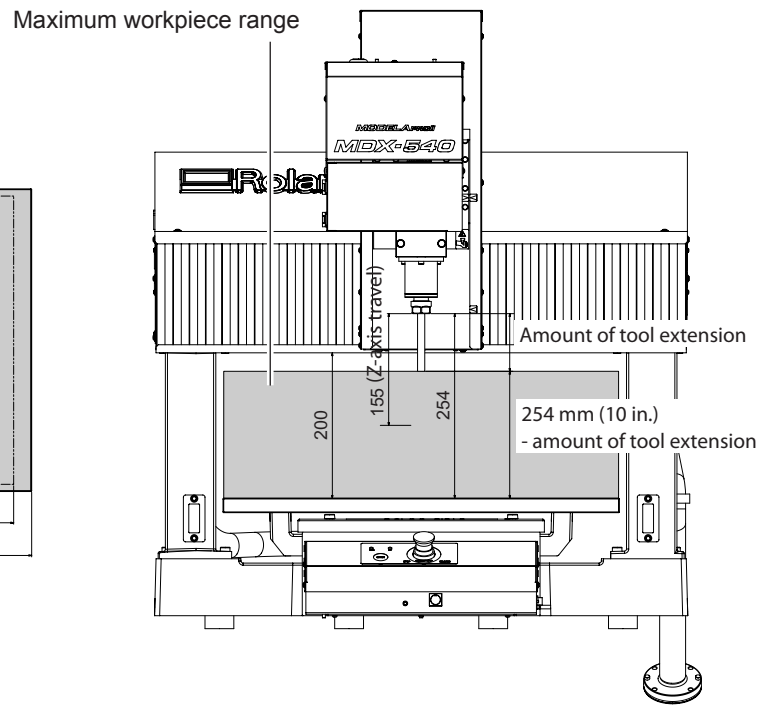

T-slot Table (Optional)

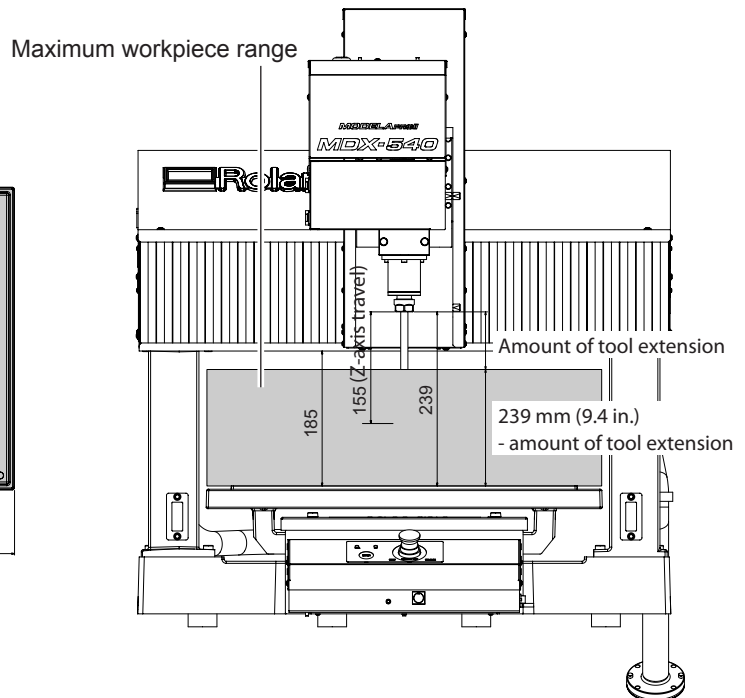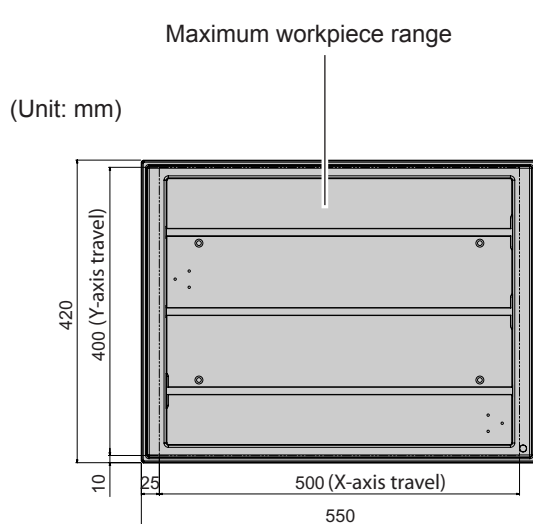

Actual Size That Can Be Cut

Creating an object of the size of the full axis travel is not necessarily possible. Because a certain amount of clearance in the X-, Y-, and Z-axis directions is required for no-load feed of the tool, the allowable size of the workpiece is reduced by a corresponding amount. Also, the possible cutting-in depth is generally determined by the length of the tool. Using a lengthy tool to achieve deep cutting reduces the clearance in the Z-axis direction, which further reduces the allowable size of the workpiece.

The size of what you can cut varies according to the shape of the object you want to create and the tool you use. Give careful thought to this ahead of time, before you start work.


4-2 Installing a Tool

Installing a Tool (ZS-540TY)


- ⚠️WARNING** Be sure to open the spindle cover before you perform this task. If it remains closed, unintended operation of the machine may lead to danger of entanglement.
- ⚠️WARNING** Never inadvertently touch the computer or handy panel while performing this task. Unintended operation of the machine may result in injury.
- ⚠️WARNING** Securely fasten the cutting tool and workpiece in place. After securing in place, make sure no wrenches or other articles have inadvertently been left behind. Otherwise such articles may be thrown from the machine with force, posing a risk of injury.
- ⚠️CAUTION** **Caution: cutting tool.** The cutting tool is sharp. To avoid injury, exercise caution.

This explanation is for installation on the standard spindle (the ZS-540TY).


Procedure

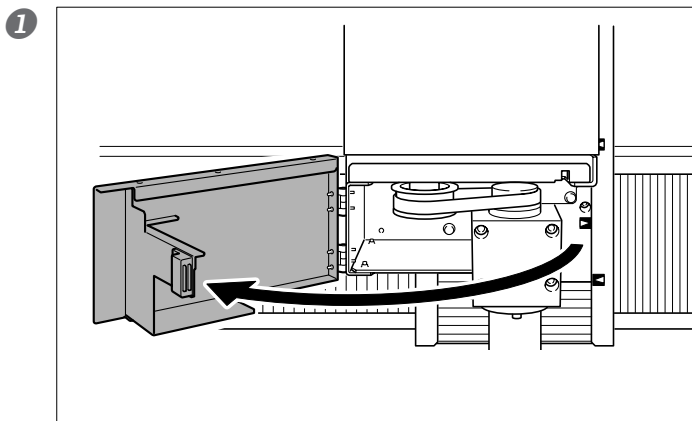


Open the spindle cover.
⚠️WARNING: Be sure to open the spindle cover.

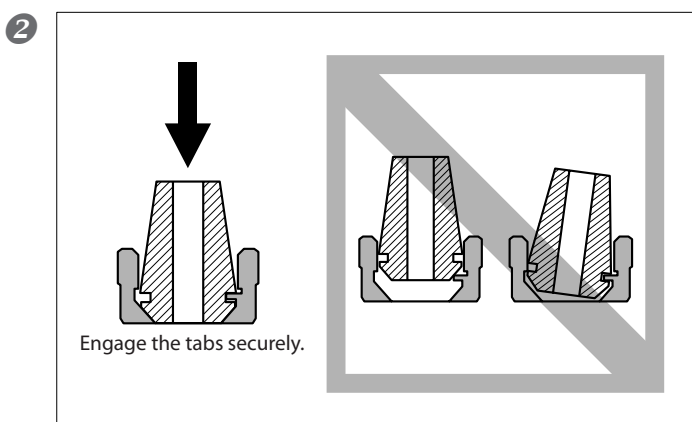

Fit the collet into the nut.

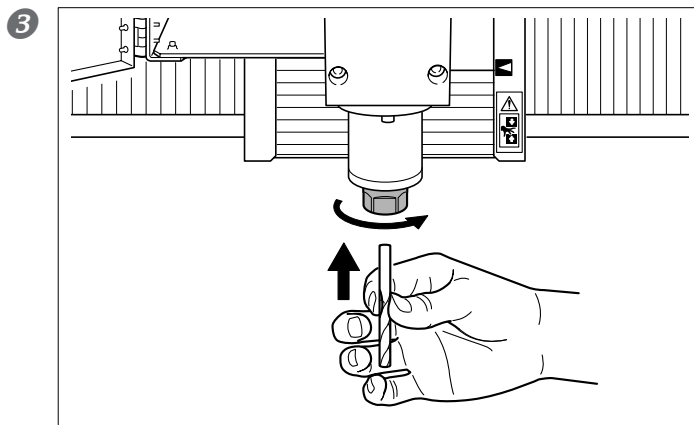

Lightly tighten the nut and insert the tool.

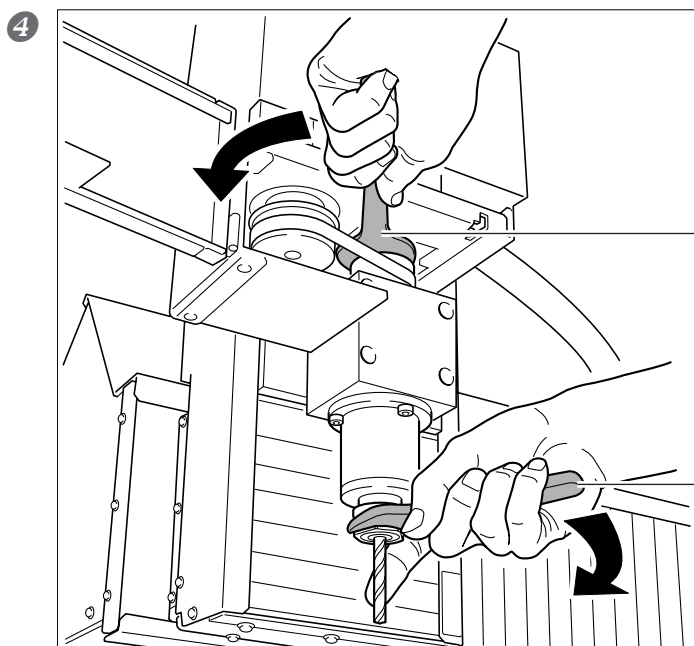


Support the tool with your fingers to keep it from falling as you tighten the nut.

Wrench (24 mm)

Nut wrench

Removing the Collet

Flipping the collet over to one side makes it come loose, but it can be flipped over only in certain directions. If it does not come loose easily, try flipping it over in a different direction.

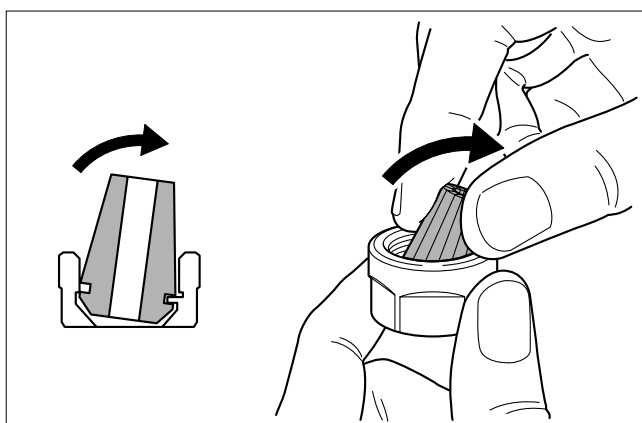

4-3 Starting Cutting (RML-1 Mode)

Determining the Reference Position for Cutting


What Is the Reference Position for Cutting?

Coordinates and Origins

The origin, sometimes called just the "origin," is the starting point for coordinates. It is the location where the X-, Y-, and Z-axis coordinates are all 0 (zero). The origin plays a major role in performing positioning for cutting. This is because the origin serves as the reference position for cutting (in other words, it's the starting position for cutting).

You can freely change the location of the origin. This is an extremely useful feature when you're making the preparations for performing cutting. Adjusting the location where the workpiece (the material being cut) is secured in place is a troublesome task. Securing the workpiece in place wherever you like and aligning the origin with that location is much easier.

☞ P. 50 "About the Displayed Tool Position"

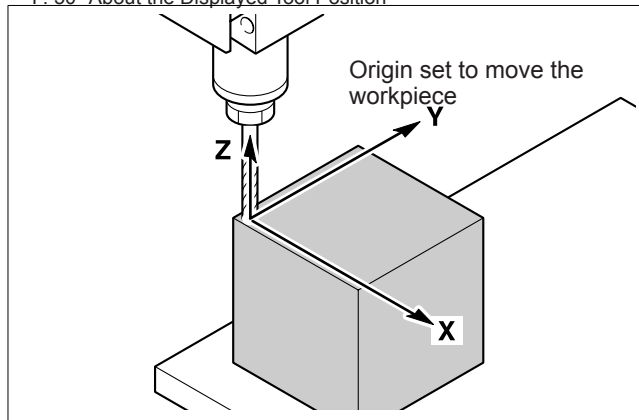


Changing the location of the origin to align it with the location of the workpiece in this way is called "setting the origin."

The User Coordinate System and the Machine Coordinate System

The coordinate system in which the location of the origin can freely be changed is called the "user coordinate system." Meanwhile, there also exists a coordinate system in which the location of the origin is fixed, and cannot be changed. This is called the "machine coordinate system."

In actual operations, the user coordinate system is used exclusively. You use the machine coordinate system when you want to know the absolute position of the tool. On this machine, you can display coordinate values using either the user coordinate system or the machine coordinate system.

The origin for the machine coordinate system on this machine is at the left-side, frontward, and upward limits of the axis travel.

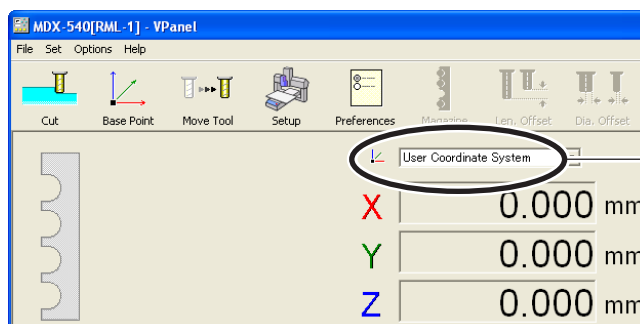


Selected coordinate system


This switches only the coordinate view. Cutting operations are not affected.

How to Set the Origin

Procedure

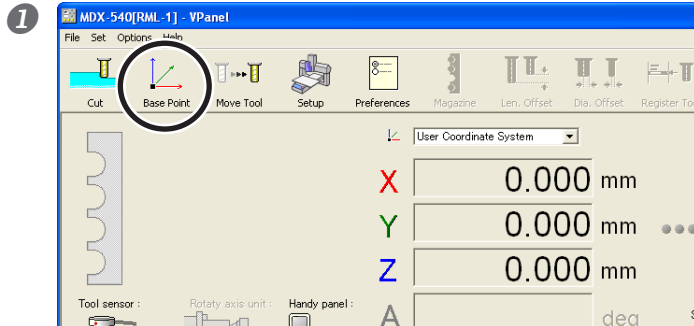


In VPanel, click the [Base Point] icon.

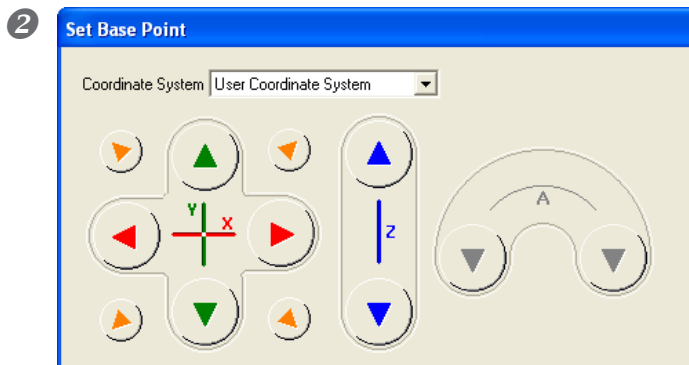

Move the tool to the location you want to make the origin.

⇐ P. 48 "3-4 Moving the Tool"

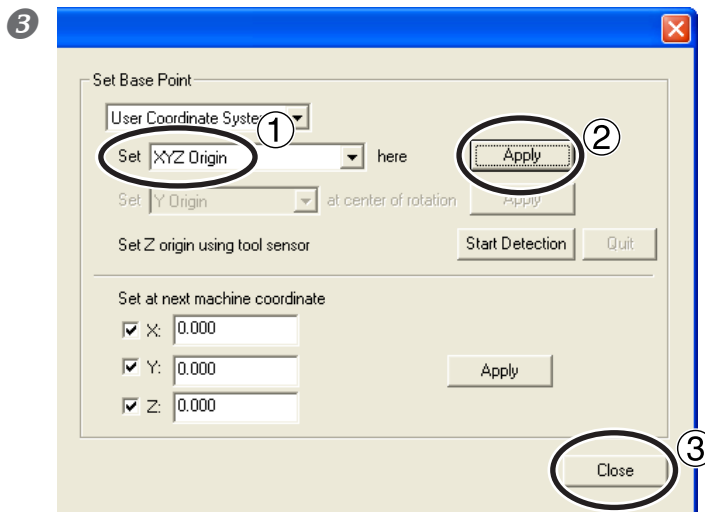

- ① Select [XYZ Origin].
- ② Click [Apply].
- ③ Click [Close].

Using Axis Specification

The axis or axes you selected in step ③ - ① are the target of this setting. [XYZ Origin] makes the settings for all axes (X, Y, and Z) simultaneously, but [Z Origin] makes the setting for the X axis only, leaving the Y and Z axes unchanged.

Using this lets you make the settings for the respective axes separately. For instance, you can set the X- and Y-axis origins aligned with a side surface of the workpiece, and set the Z-axis origin at the workpiece's top surface.

Deciding Where to Set the Origin

The locations to be made the origins vary according to the program, but most commonly the X- and Y-axis origin is set at the front-left corner of the workpiece and the Z-axis origin is set so as to line up the tip of the blade where it just touches the top surface of the workpiece.

Operation Using the Handy Panel

You can also perform this operation using the handy panel.

☞ P. 77 "Chapter 5 Handy Panel"

Starting Cutting

⚠️WARNING Be sure to check carefully to ensure that the data sent from the computer and the selected command mode are correct, the locations of the origins are without error, and the cutting parameters match the workpiece.

Errors or mistakes may cause the tool to break and be thrown off forcefully, leading to danger of injury.


⚠️WARNING Never output NC codes using this procedure.

This procedure is exclusively for the RML-1 mode. An error or mistake here may result in unintended operation and is extremely dangerous. Select it with care.

When the machine receives the cutting data from the computer, the spindle begins to rotate and cutting starts. The feed rate and the speed of spindle rotation are determined by the cutting data received.

Procedure


1

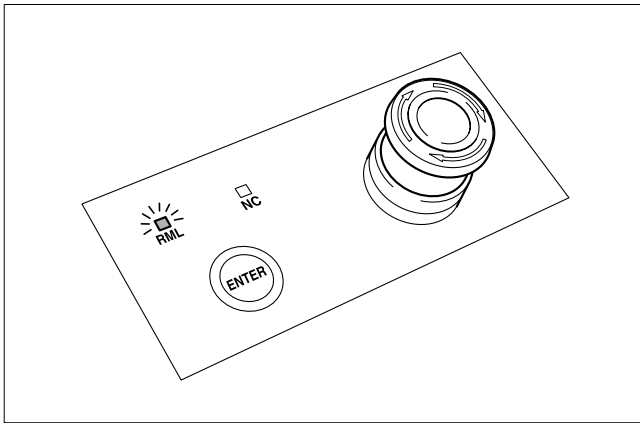


Make sure the machine is in the RML-1 mode.

☞ P. 45 "3-3 Selecting the Command Mode"

2

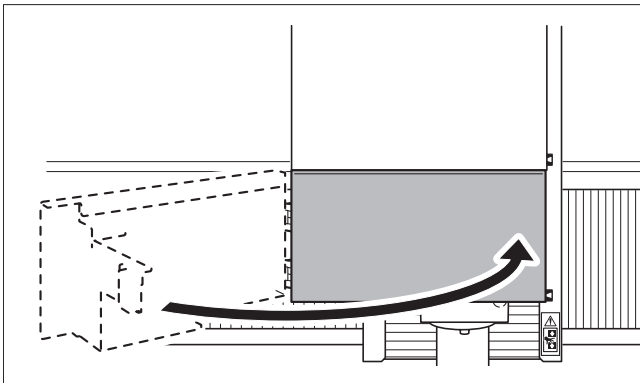

Close the spindle cover.

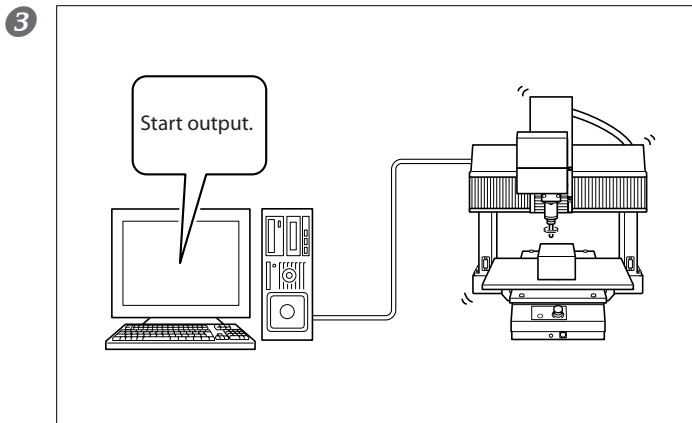

⚠ WARNING: This procedure makes the machine operate. Before you perform this procedure, check to make sure that operation of the machine will not create any hazard or danger. Use the program to output the cutting data.

⚠ Important Safety Caution

When cutting start, check the state of operation, and if you sense danger, immediately press the Emergency Stop button.

☞ P. 40 "3-1 Emergency Stop to Ensure Safety"

An error or mistake may lead to danger of injury or fire. To ensure safety, be sure to observe the cautions.

☞ P. 6 "To Ensure Safe Use"

Cautions When Using the Machine with the Spindle in the Low-speed Range

Be sure to perform cutting at a spindle speed of 3,000 rpm or higher. Speeds of 400 to 3,000 rpm are for positioning and centering. It is important to note that they are not suitable for cutting.

Using the Output File List

In the RML-1 mode, in addition to sending cutting data directly from the program, you can take cutting data that has been made into a text file and import the file into VPanel. For more information, refer to the VPanel Online Help.

☞ P. 23 "How to View the Online Help"

4-4 Starting Cutting (NC-code Mode)

Determining the Reference Position for Cutting

Coordinate Systems and Origins

Workpiece Coordinate Systems

With NC codes, the coordinate system that lets you freely set the origin wherever you want is called the "workpiece coordinate system." The setting for the workpiece coordinate origin, gives you added freedom over RML-1.

NC codes have six workpiece coordinate systems, G54 through G59. You can select which one of these you want to use. The six workpiece coordinate systems are independent of one another, which means that, in effect, you can preset six different origins.

☞ For detailed information, refer to the "NC Code Reference Manual."


Selection of the Location of the Origin and the Workpiece Coordinate System

The location on the workpiece to make the origin varies according to the NC program. Set the origin at the location expected by the NC program.

The selection of which of the six workpiece coordinate systems to use depends on the NC program. Check the NC program.

Coordinate View

On this machine, you can any one of the six workpiece coordinate systems or the machine coordinate system.

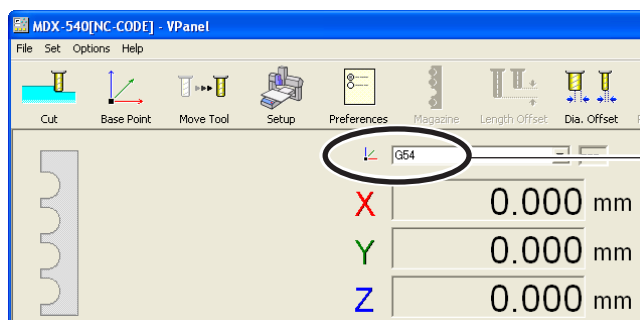


Selected coordinate system

This switches only the coordinate view. Cutting operations are not affected.

How to Set the Origin


Several methods exist for setting the origin in the NC-code mode, but this section explains an example of making the setting in which the NC program uses G54.

Procedure

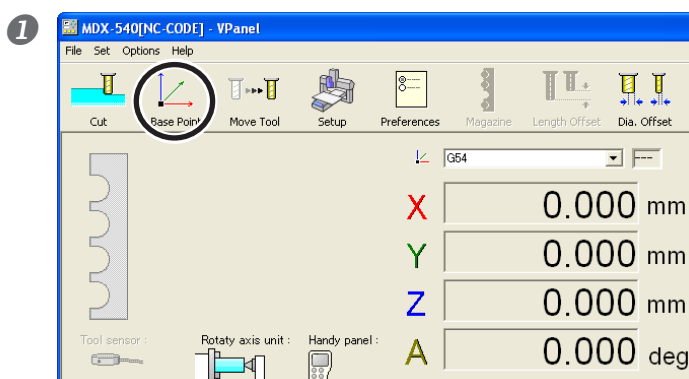


In VPanel, click the [Base Point] icon.

4-4 Starting Cutting (NC-code Mode)

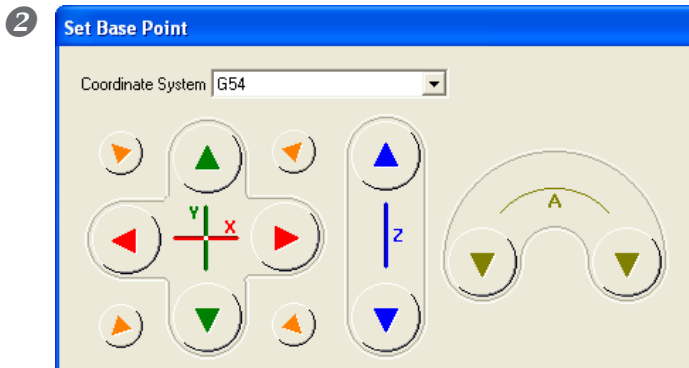

Move the tool to the location you want to make the origin.

⇨ P. 48 "3-4 Moving the Tool"

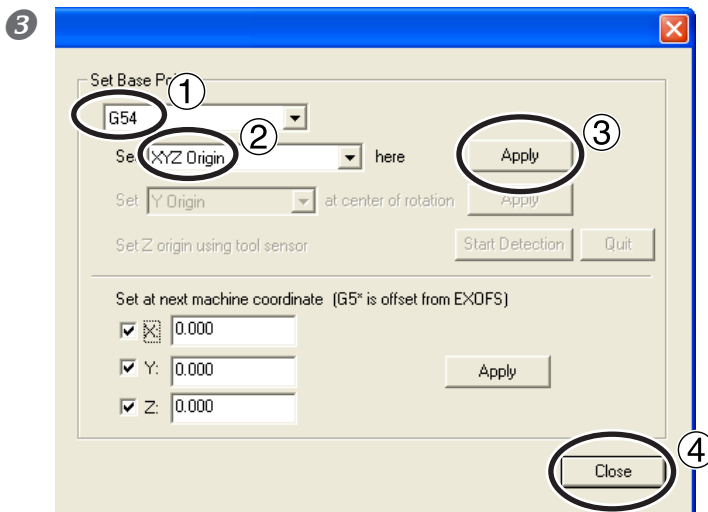

- ① Select [G54].
- ② Select [XYZ Origin].
- ③ Click [Apply].
- ④ Click [Close].

Important Note on EXOFS

After setting the origin, never make any setting for EXOFS. One of the effects of EXOFS is to shift the origin. It is important to note that making this setting without considering the consequences make cause the origin to move to an unintended location. We recommend leaving EXOFS at the machine coordinates (X0, Y0, Z0) unless you have a particular reason for changing it.

⇨ For more information about EXOFS, refer to the "NC Code Reference Manual."

Using Axis Specification

The axis or axes you selected in step ③-② are the target of this setting. [XYZ Origin] makes the settings for all axes (X, Y, and Z) simultaneously, but [Z Origin] makes the setting for the X axis only, leaving the Y and Z axes unchanged.

Using this lets you make the settings for the respective axes separately. For instance, you can set the X- and Y-axis origins aligned with a side surface of the workpiece, and set the Z-axis origin at the workpiece's top surface.

Operation Using the Handy Panel

You can also perform this operation using the handy panel.

⇨ P. 77 "Chapter 5 Handy Panel"

Starting Cutting

Overview of Operations

⚠ WARNING In the NC-code mode, be sure to follow this procedure to perform output. Direct output from a program, as in the RML-1 mode, is not possible. An error or mistake here may result in unintended operation and is extremely dangerous. Select it with care.

Step 1: Save the output file.

First, convert the NC program to a text file, then save it on the computer. This file is called the "output file." Saving the cutting data as an output file is necessary even when you're using software such as a CAM program.



Step 2: Register and execute the output file.


Add the saved output file to VPanel's output file list, then specify execution. You can register (add) multiple output files and execute them sequentially, one after another.

Starting Cutting

⚠ WARNING Be sure to check carefully to ensure that the output file or files and the selected command mode are correct, the locations of the origins are without error, and the cutting parameters match the workpiece. Errors or mistakes may cause the tool to break and be thrown off forcefully, leading to danger of injury.

Procedure


1

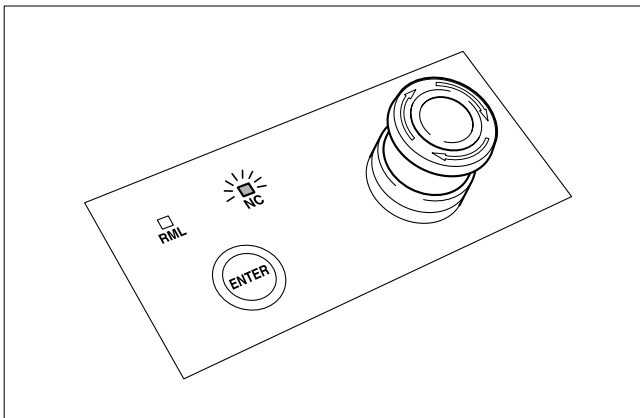


Make sure the machine is in the NC-code mode.

☞ P. 45 "3-3 Selecting the Command Mode"

4-4 Starting Cutting (NC-code Mode)

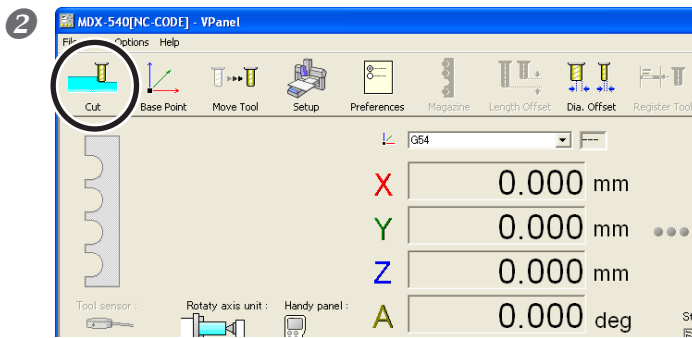

In VPanel, click the [Cut] icon.

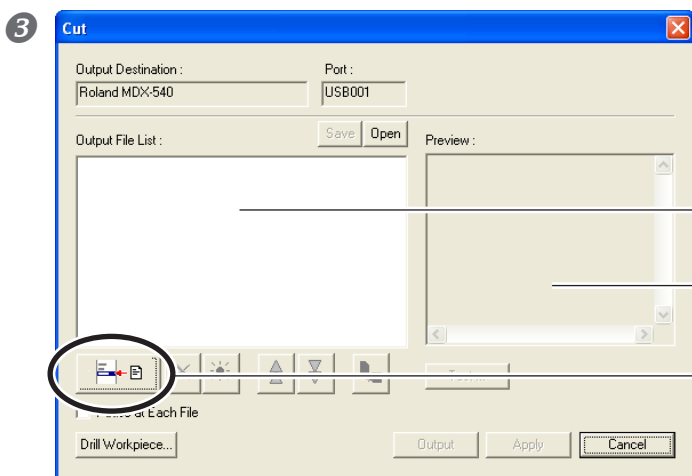

Click the [New File] button and open the output file. Alternatively, drag the output file to [Output File List].

Output File List


This displays a list of registered output files. When two or more output files are present, they are executed sequentially, one after another.

Preview


This displays the contents of the output file.

[New File] button

Clicking this displays a window for selecting the output file.

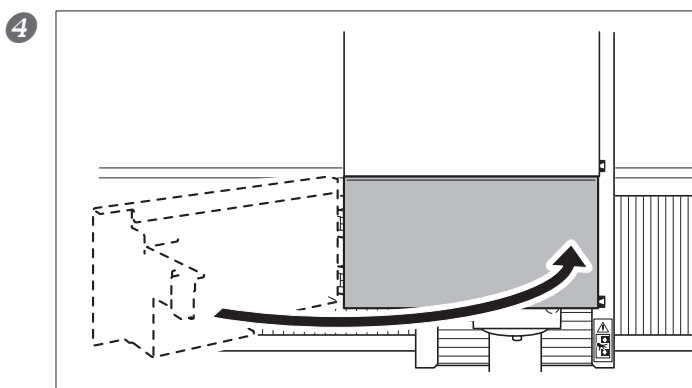

Close the spindle cover.

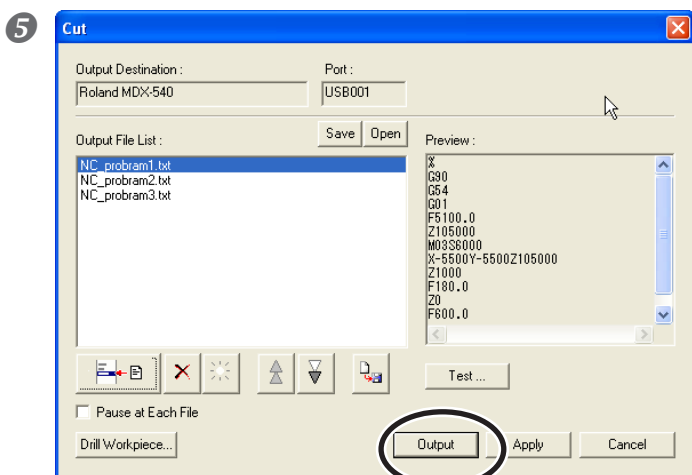

⚠ WARNING: This procedure makes the machine operate. Before you perform this procedure, check to make sure that operation of the machine will not create any hazard or danger.

Click [Output].

⚠ Important Safety Caution

When cutting start, check the state of operation, and if you sense danger, immediately press the Emergency Stop button.

⇨ P. 40 "3-1 Emergency Stop to Ensure Safety"

An error or mistake may lead to danger of injury or fire. To ensure safety, be sure to observe the cautions.

⇨ P. 6 "To Ensure Safe Use"

Cautions When Using the Machine with the Spindle in the Low-speed Range

Be sure to perform cutting at a spindle speed of 3,000 rpm or higher. Speeds of 400 to 3,000 rpm are for positioning and centering. It is important to note that they are not suitable for cutting.

Important Notes on Sending Cutting Data

- In the NC-code mode, be sure to use VPanel's output file list to output cutting data. Cutting data cannot be sent directly from a program. Performing this incorrectly may result in unintended operation and is extremely dangerous.
- If you've connected the machine to a data-storage device instead of a computer, then convert the NC code to native code and save the native-code file on the storage device. Conversion to native code is performed using VPanel's export feature. For more information, refer to the VPanel Online Help.


⇨ P. 23 "How to View the Online Help"

Deleting the Output File List


Deleting Items from the Output File List

To remove unneeded items from the output file list, carry out the following procedure. This merely removes the items from the list -- it does not delete the output file from the computer.

Procedure

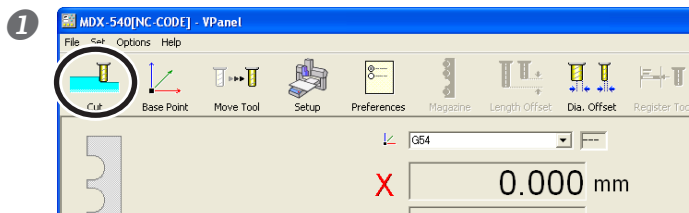

In VPanel, click the [Cut] icon.

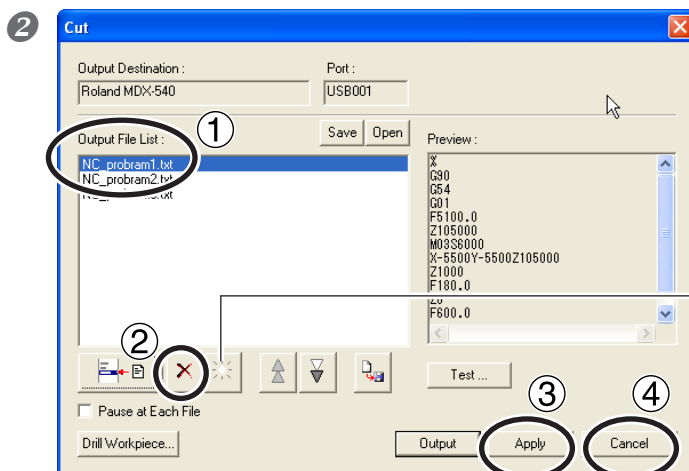

- ① Click the file you want to remove.
- ② Click the button.
- ③ Click [Apply].
- ④ Click [Cancel] to close the window.

Remove All

Clicking this button in step ② - ② removes all output files from the list.

Completely Deleting an Output File

After you have removed a file from the output file list, then delete the file.

Important Note on Deleting Files

Never delete, overwrite, or change the name of any file registered on the output file list. Before you perform such an action, first remove the file from the output file list.

4-5 Using the Tool Sensor

What's a Tool Sensor?

The tool sensor is useful for such tasks as setting the Z-axis origin.


Important !

When using the machine, check that no cutting waste and the like is present on the tool sensor, the terminal part of the sensor cable, and tool. Otherwise, correct measurement may be impossible and the intended cutting results cannot be obtained.


Setting the Thickness of the Tool Sensor

Before you use the tool sensor, make the setting for its thickness. This setting directly affects the accuracy of the tool sensor, so be sure to set the value accurately.

Procedure

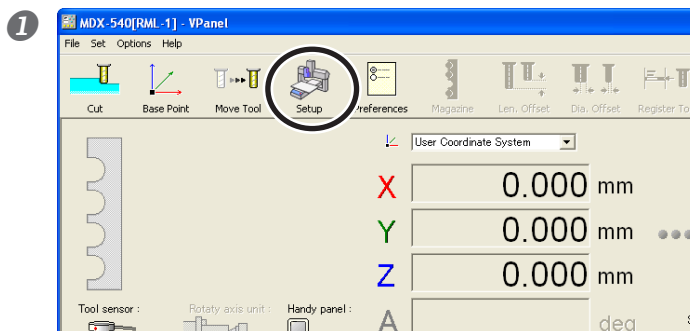

In VPanel, click the [Setup] icon.

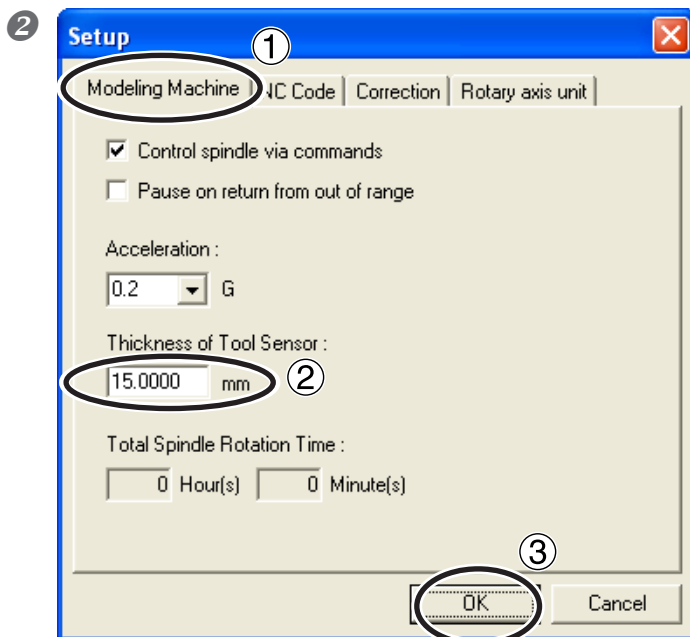


① Click the [Modeling Machine] tab.
② For [Thickness of Tool Sensor], enter the thickness.
③ Click [OK].


Setting the Z-axis Origin Using the Tool Sensor

This feature is convenient when you want to set the Z-axis origin at the top surface of the workpiece.


Procedure

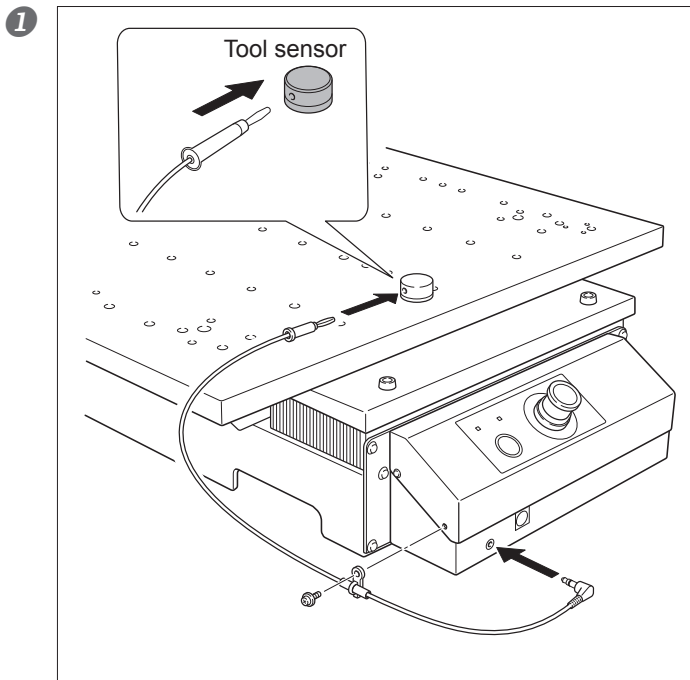


- ① Connect the tool sensor.
- ② Remove the screw.
- ③ Secure the cable in place using the screw.

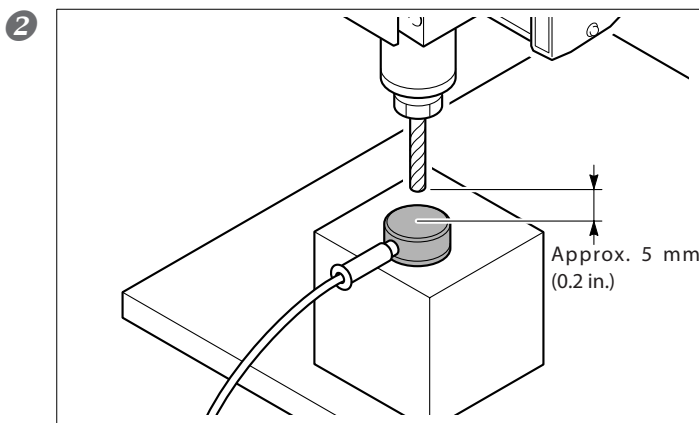


- ① If the ATC is installed, then grasp the desired tool.
- ② Place the tool sensor on the top surface of the workpiece where you want to set the Z-axis origin.
- ③ Move the tool to the area above the tool sensor.

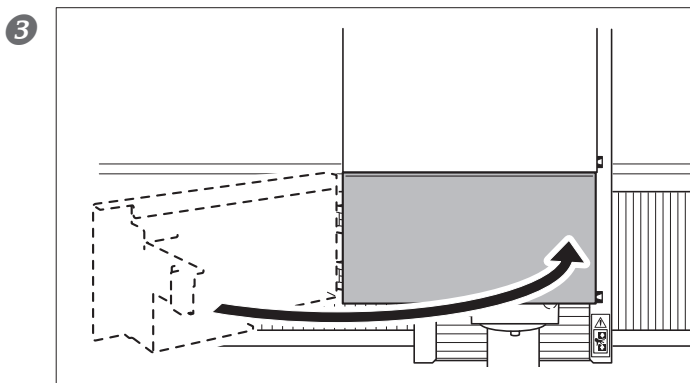

Close the spindle cover.

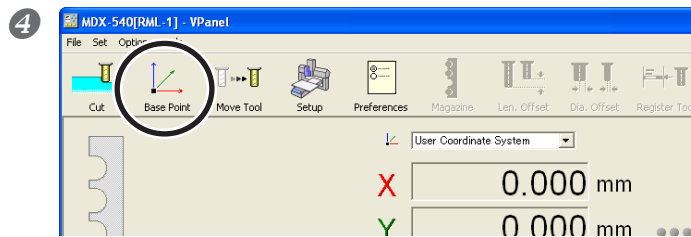


In VPanel, click the [Base Point] icon.

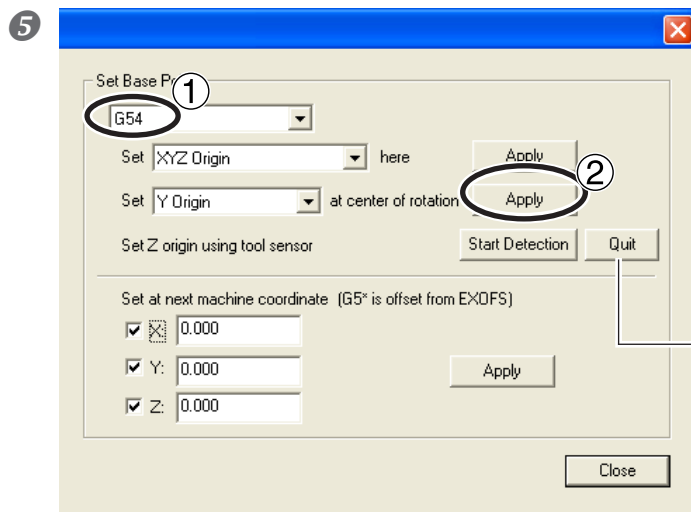

① If the machine is in the NC-code mode, then select the desired coordinate system.

② Click [Start Detection].

Click this when you want to stop the descent of the tool before it reaches the target.

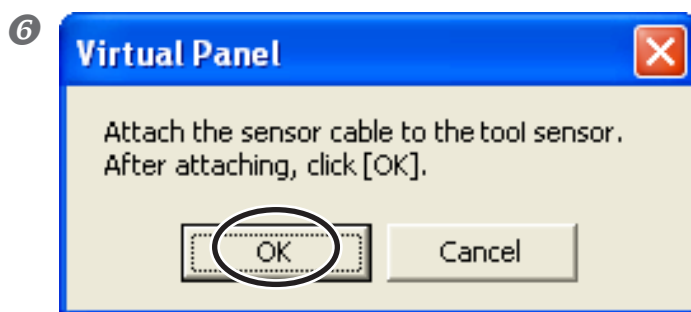

⚠WARNING: This procedure makes the machine operate. Before you perform this procedure, check to make sure that operation of the machine will not create any hazard or danger. Click [OK].

Clicking [OK] makes the tool slowly descend until it contacts the sensor. When the tool rises and stops, the setting operation is complete.

To Make the Tool Descend Rapidly

When it takes a long time for the tool to make contact with the sensor, turn the hand wheel on the handy panel counterclockwise. Be careful not to make the tool collide with the sensor. A collision makes accurate detection impossible. If a collision occurs, redo the operation from the beginning.

Operation Using the Handy Panel

You can also perform this operation using the handy panel.

⇨ P. 77 "Chapter 5 Handy Panel"

Point

If the tool sensor is not detected, check the following points:

- Each cable is connected firmly.
- The front and back sides of the tool sensor are not reversed. (See the figure in the step.)
- No cutting waste and the like is present on the tool sensor, the terminal part of the sensor cable, and tool.

4-6 Overrides

What's an Override?

Using Overrides

An override is a feature for adjusting the feed rate or spindle speed while cutting is in progress. This is useful when you want to change the feed rate or speed as you monitor the status of cutting.

An override value is specified as a percentage. For example, when the command in the cutting data sent from the computer is for a speed of 5,000 rpm, specifying an override of 150% produces an actual speed of 7,500 rpm.

Types of Overrides

There are three types of overrides, and you can make the settings for each one separately.

Feed-rate Override

This is the speed at which the tool moves when cutting the workpiece. The speed specified by the command in the cutting data is taken to be 100%.


Rapid-feed Override

This is the speed at which the tool moves during no-load feed. The maximum speed of the machine is taken to be 100%.

Spindle Override

This is the speed of spindle rotation. The speed specified by the command in the cutting data is taken to be 100%. This is also effective when rotating the spindle during manual operations.

How to Make the Settings for Overrides

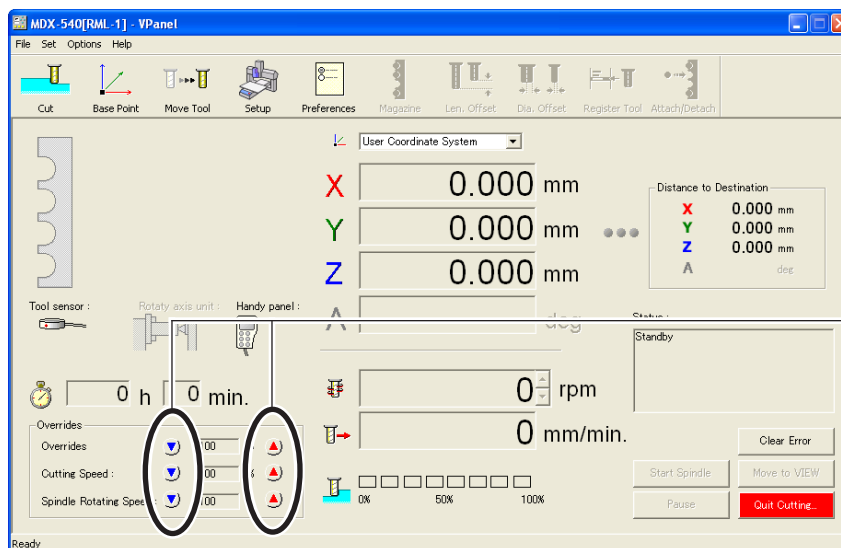

Clicking these buttons adjusts the values.

Important Notes on Overrides

- Setting an override does not let you perform operation beyond the machine's maximum or minimum speeds.
- Depending on the program, the rapid-feed override may have no effect, or the feed-rate override may alter the speed of the rapid-feed override.

Operation Using the Handy Panel

You can also perform this operation using the handy panel.

⇨ P. 77 "Chapter 5 Handy Panel"

Chapter 5 Handy Panel

5-1 Using the Handy Panel

Using the Handy Panel

Features of the Handy Panel

The handy panel brings together a number of frequently used features in one compact group. This puts rapid control at your fingertips, enabling you to accomplish tasks quickly and reliably.

Features of the Handy Panel

- Displaying tool movement and the tool location
- Starting and stopping spindle rotation
- Pausing and quitting cutting
- Setting the origins
- Setting the Z-axis origin using the tool sensor
- Setting overrides
- Clearing errors

Note: For operations other than these, use VPanel. All operations of the machine can be accomplished using VPanel.

Operating the Handy Panel and VPanel at the Same Time

Never operate the handy panel and VPanel simultaneously. Operation using VPanel becomes impossible while the handy panel is being used.

5-2 Moving the Tool


Hand-wheel Feed

You can move the tool by turning the hand wheel. You select the axis to move and move each axis one at a time. You can also select the fineness of scale for movement.

This operation cannot be performed while the spindle cover is open or cutting is in progress.

For related items, see P. 48 "3-4 Moving the Tool"

⚠ WARNING This procedure makes the machine operate. Before you perform this procedure, check to make sure that operation of the machine will not create any hazard or danger.

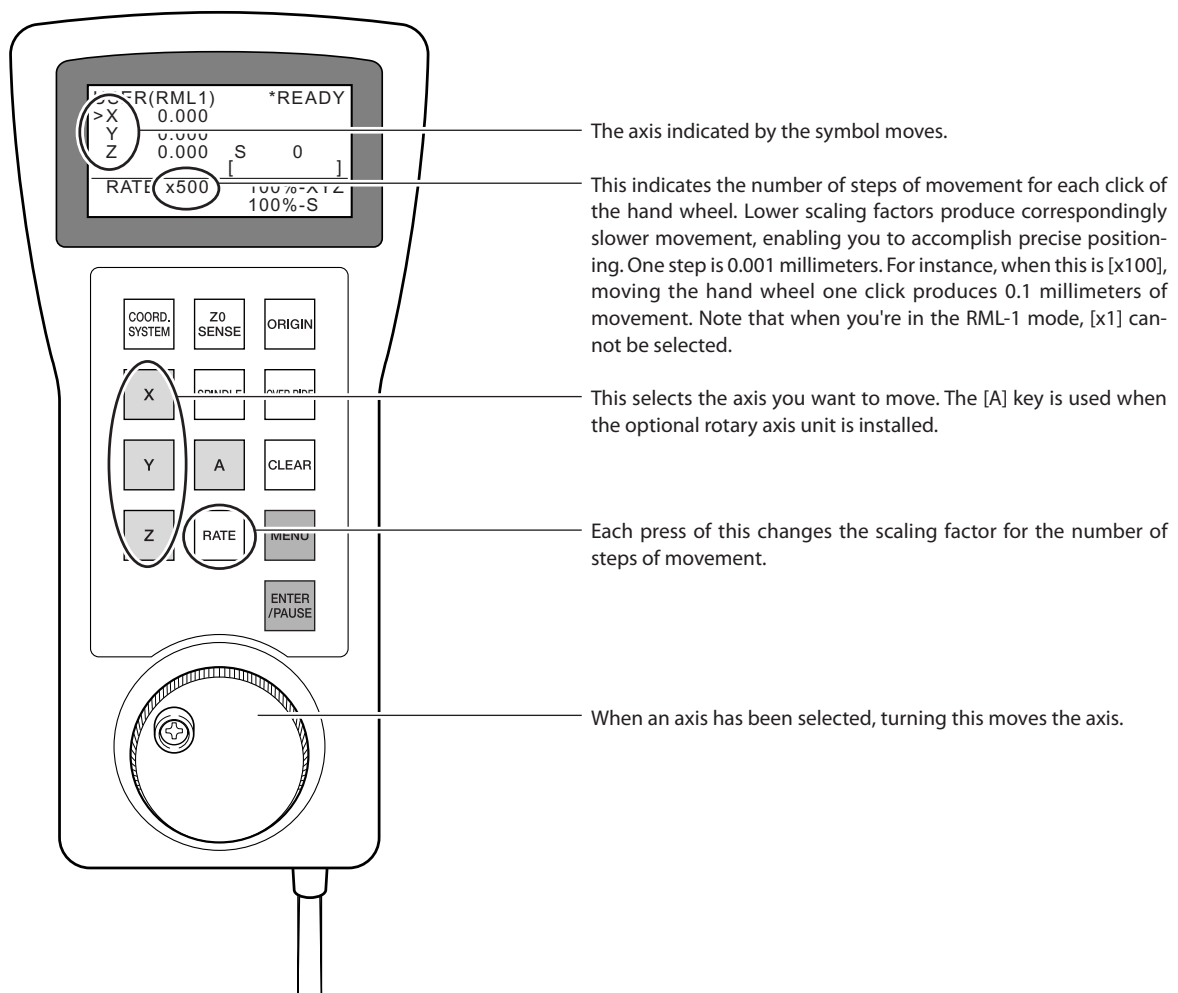


Rapidly Moving to a Specific Location


You can move rapidly to the VIEW position or origin. For the Z axis, movement is always to the highest location; movement to the specified location is performed only for the X and Y axes. This operation cannot be performed when the spindle cover is open, during cutting operations, or while paused.

For related items, see P. 48 "3-4 Moving the Tool"


Procedure

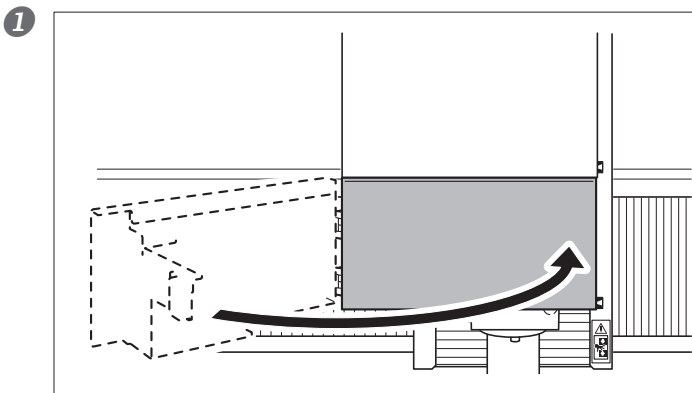


Close the spindle cover.

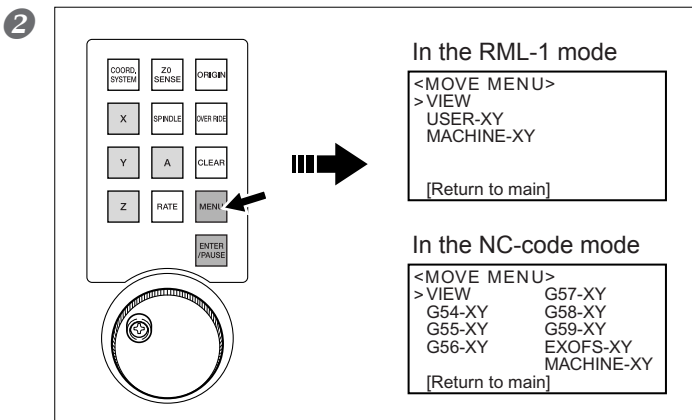

Press the [MENU] key several times to display [MOVE MENU].

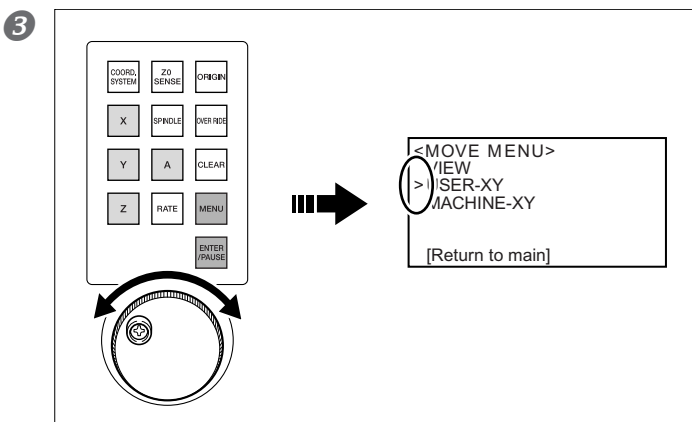

Use the hand wheel to select the movement destination.

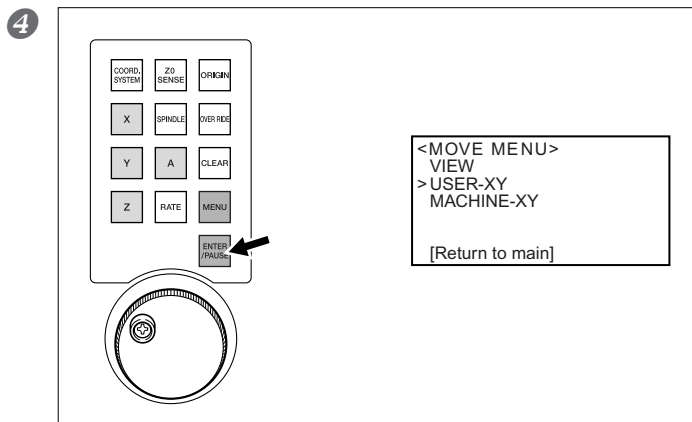

⚠ WARNING: This procedure makes the machine operate. Before you perform this procedure, check to make sure that operation of the machine will not create any hazard or danger. Press the [ENTER] key.

To go back to the original screen, use the hand wheel to select [Return to main], then press the [ENTER] key.

Movement Destinations in the RML-1 Mode

- VIEW: VIEW position
- USER-XY: User coordinate origin
- MACHINE-XY: Machine coordinate origin

Movement Destinations in the NC-code Mode


- VIEW: VIEW position
- G54-XY: Workpiece coordinate origin No. 1 (G54)
 - G55-XY: Workpiece coordinate origin No. 2 (G55)
 - G56-XY: Workpiece coordinate origin No. 3 (G56)
 - G57-XY: Workpiece coordinate origin No. 4 (G57)
 - G58-XY: Workpiece coordinate origin No. 5 (G58)
 - G59-XY: Workpiece coordinate origin No. 6 (G59)
 - EXOFS-XY: Location specified by EXOFS
 - MACHINE-XY: Machine coordinate origin

Viewing the Tool Location

The present tool location is displayed on the screen. Millimeters are used as the unit of measurement, and this cannot be changed.

Selecting the coordinate system is also possible. Note, however, that this affects only the displayed tool location. The location of cutting does not change.

For related items, see P. 50 "About the Displayed Tool Position"

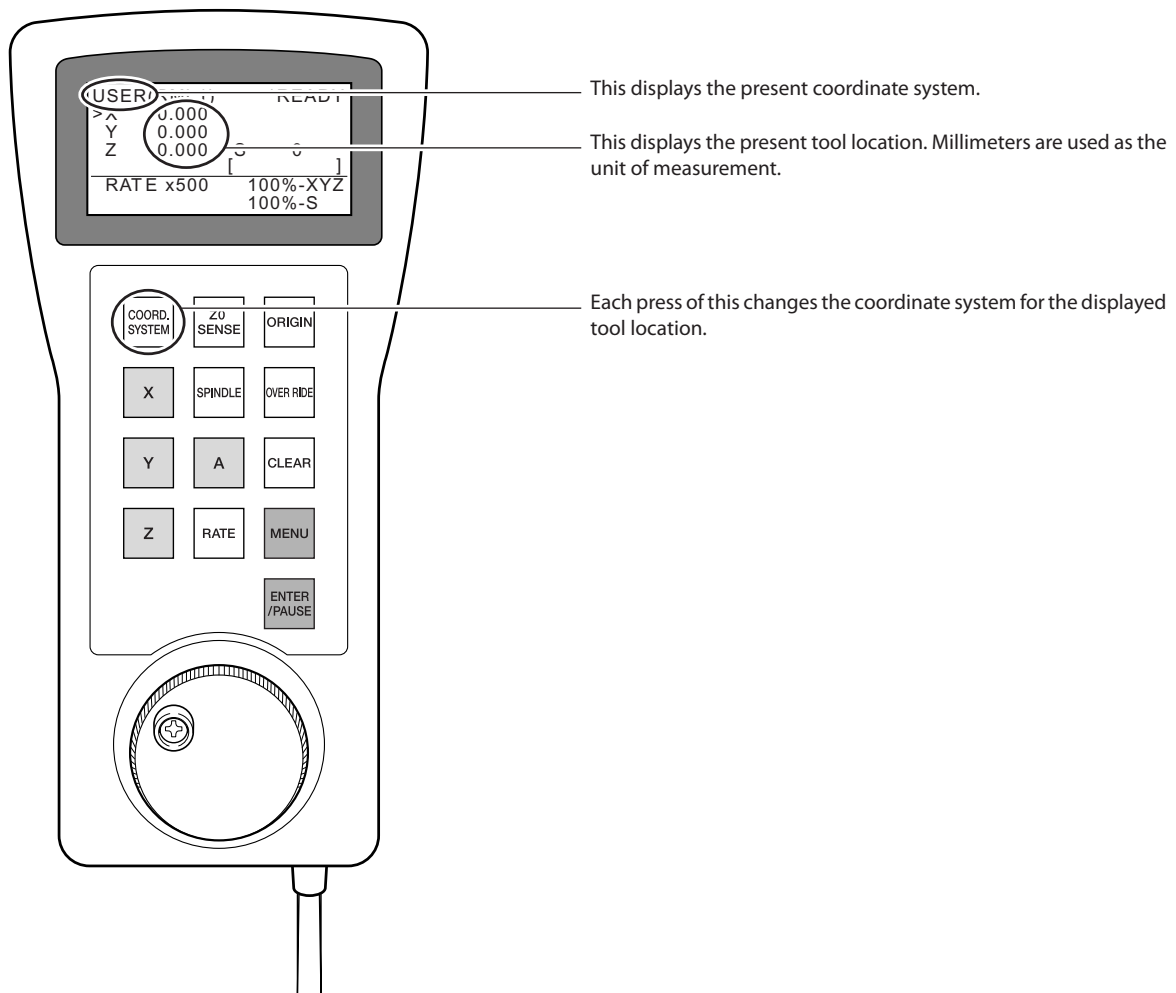

Coordinate Systems in the RML-1 Mode

- USER: User coordinate system
- MACHINE: Machine coordinate system

Coordinate Systems in the NC-code Mode

- G54: Workpiece coordinate system 1 (G54)
- G55: Workpiece coordinate system 2 (G55)
- G56: Workpiece coordinate system 3 (G56)
- G57: Workpiece coordinate system 4 (G57)
- G58: Workpiece coordinate system 5 (G58)
- G59: Workpiece coordinate system 6 (G59)
- MACHINE: Machine coordinate system


5-3 Starting and Stopping Spindle Rotation

Starting or Stopping the Spindle

You can start and stop rotation of the spindle, and specify the speed of rotation. This operation cannot be performed while the spindle cover is open or cutting is in progress.

For related items, see P. 52 "3-5 Starting and Stopping Spindle Rotation"

⚠ WARNING This procedure makes the machine operate. Before you perform this procedure, check to make sure that operation of the machine will not create any hazard or danger.

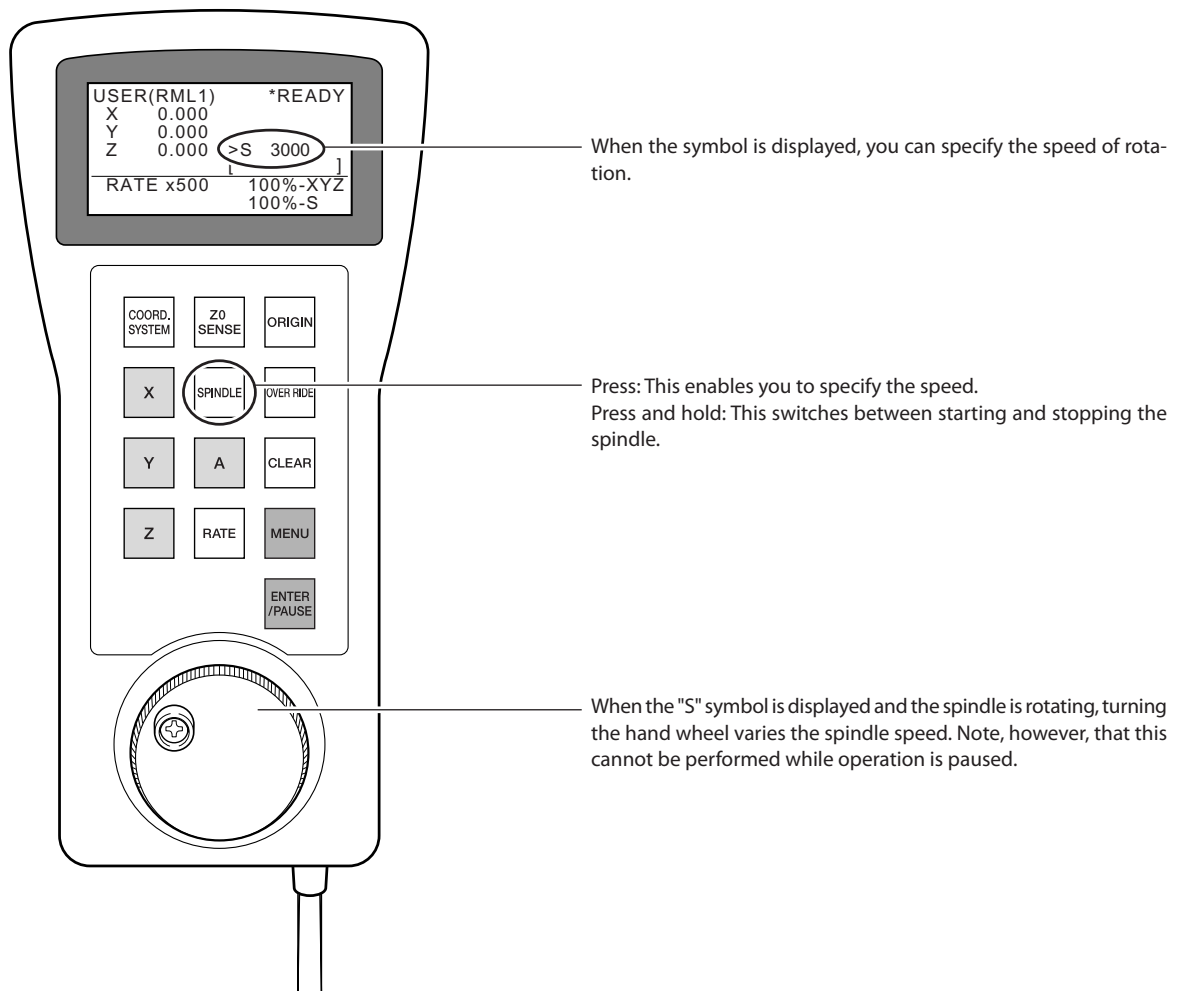


5-4 Pausing and Quitting Cutting

Pausing and Resuming Operation

This operation pauses cutting operation. Resuming from the location where paused is possible.

For related items, see P. 54 "3-6 Pausing and Quitting Cutting"

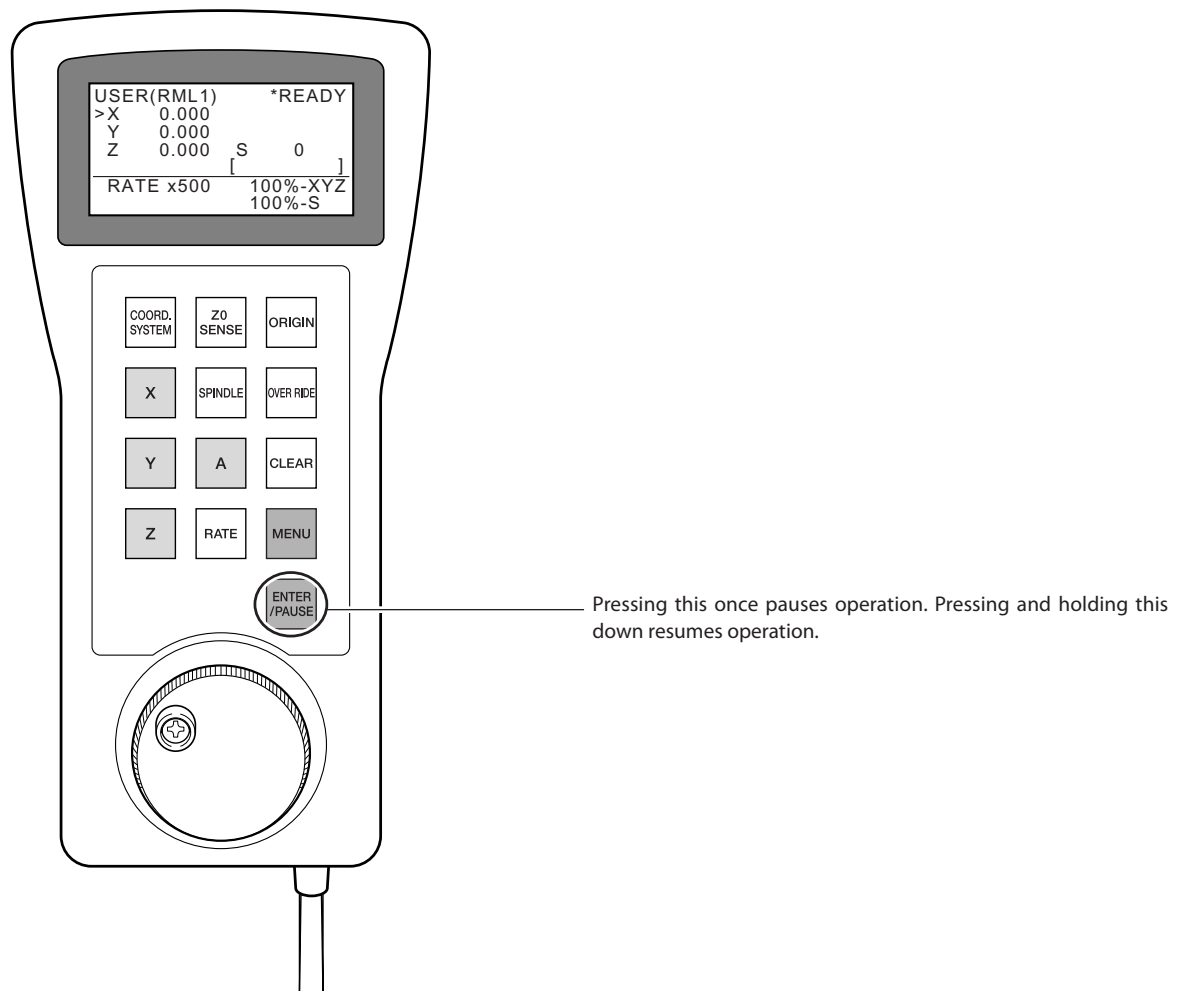


The operations you can perform while the machine is paused are as follows.

- Hand-wheel feed
- Starting or stopping the spindle
- Setting overrides
- Quitting cutting

Quitting Cutting

This operation completely stops cutting. Unlike a pause, the operation cannot be resumed. You can also quit cutting while operation is paused.

For related items, see P. 54 "3-6 Pausing and Quitting Cutting"

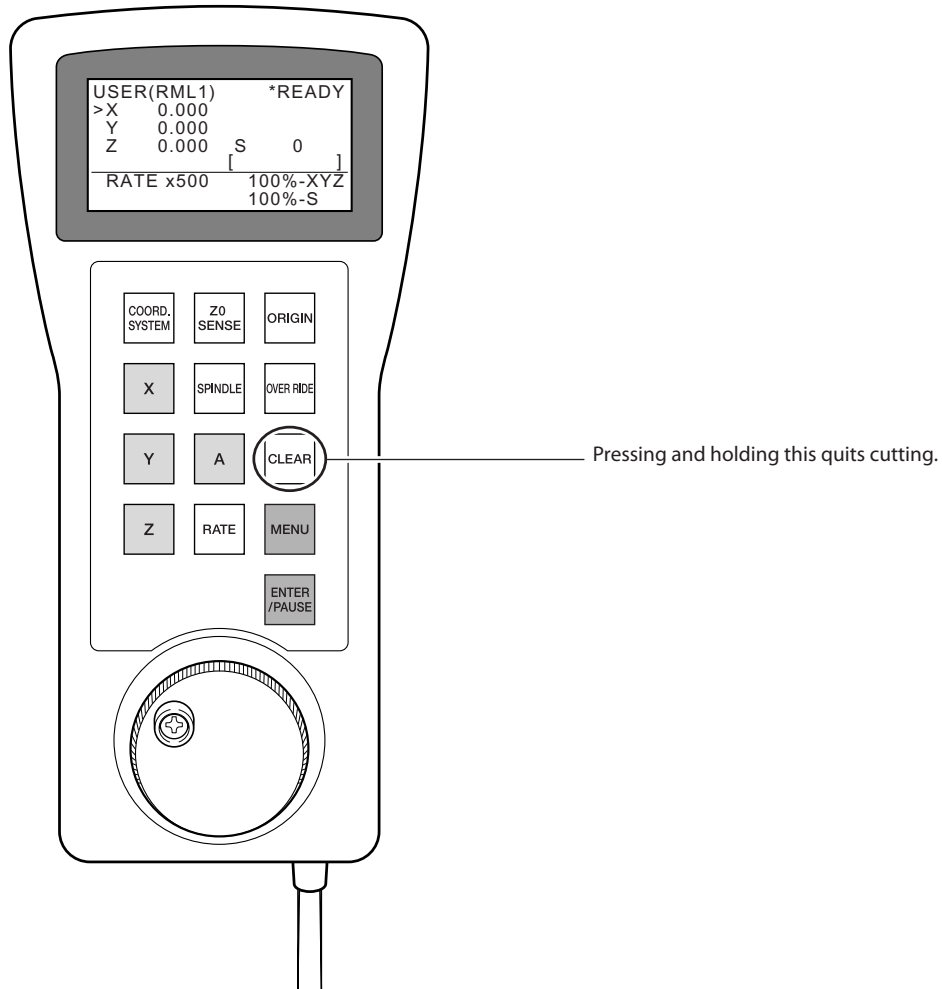

5-5 Setting the Origins

How to Set the Origins

This sets the origins at the present tool location. You make the settings separately for the X, Y, and Z axes. This operation cannot be performed during a cutting operation or while operation is paused.

For related items, see P. 62 "4-3 Starting Cutting (RML-1 Mode)" + P. 67 "4-4 Starting Cutting (NC-code Mode)"

Procedure

1

COORD. SYSTEM	ZO SENSE	ORIGIN
X	SPINDLE	OVER RIDE
Y	A	CLEAR
Z	RATE	MENU
		ENTER / PAUSE

USER(RML1)	*READY
X 100.000	
Y 50.000	
Z -30.000	S 0
RATE x500 [100%-XYZ]	
100%-S	

- ① Move the tool to the location you want to make the origin.
- ② Press the [COORD. SYSTEM] key several times to select the coordinate system.

2

COORD. SYSTEM	ZO SENSE	ORIGIN
X	SPINDLE	OVER RIDE
Y	A	CLEAR
Z	RATE	MENU
		ENTER / PAUSE

USER(RML1)	*READY
>X 100.000	
Y 50.000	
Z -30.000	S 0
RATE x500 [100%-XYZ]	
100%-S	

Use the axis-selection keys to select the axis for setting the origin.

3

COORD. SYSTEM	ZO SENSE	ORIGIN
X	SPINDLE	OVER RIDE
Y	A	CLEAR
Z	RATE	MENU
		ENTER / PAUSE

USER(RML1)	*READY
>X 0.000	
Y 50.000	
Z -30.000	S 0
RATE x500 [100%-XYZ]	
100%-S	

Hold down the [ORIGIN] key until an audible beep is sounded.

Important Notes on Selecting the Coordinate System

When [MACHINE] is selected in step , no origins can be set.

Coordinate System in the RML-1 Mode

- USER: User coordinate system


Coordinate Systems in the NC-code Mode

- G54: Workpiece coordinate system 1 (G54)
- G55: Workpiece coordinate system 2 (G55)
- G56: Workpiece coordinate system 3 (G56)
- G57: Workpiece coordinate system 4 (G57)
- G58: Workpiece coordinate system 5 (G58)
- G59: Workpiece coordinate system 6 (G59)

Setting the Z-axis Origin Using the Tool Sensor


This feature is convenient when you want to set the Z-axis origin at the top surface of the workpiece.

For related items, see P. 73 "4-5 Using the Tool Sensor"

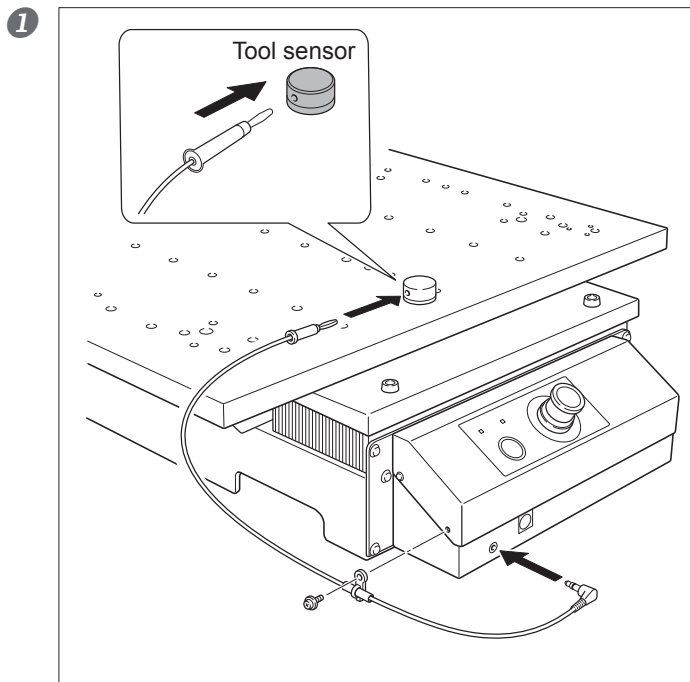
Procedure

- ① Connect the tool sensor.
- ② Remove the screw.
- ③ Secure the cable in place using the screw.


5-5 Setting the Origins

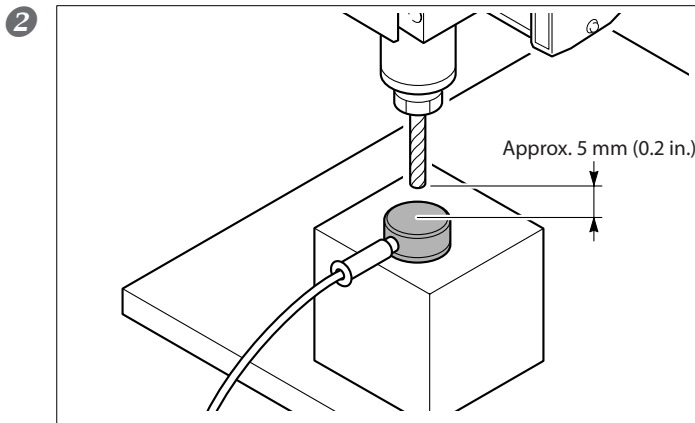

- ① If the ATC is installed, then grasp the desired tool.
- ② Place the tool sensor on the top surface of the workpiece where you want to set the Z-axis origin.
- ③ Move the tool to the area above the tool sensor.

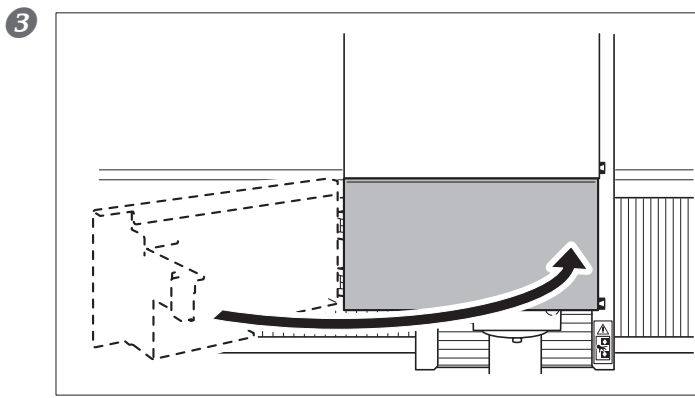


Close the spindle cover.

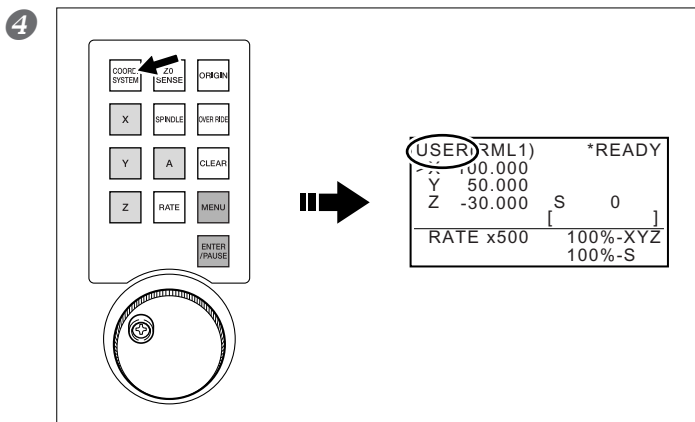

Press the [COORD. SYSTEM] key several times to select the coordinate system.

5

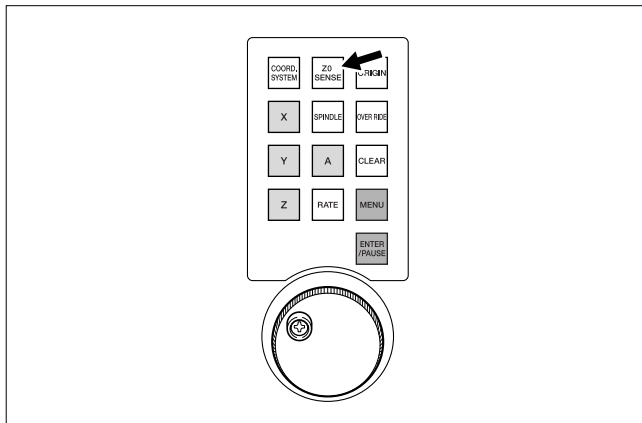

Hold down the [Z0 SENSE] key until an audible beep is sounded.

The tool slowly descends until it contacts the sensor. When the tool rises and stops, the setting operation is complete.

Point

If the tool sensor is not detected, check the following points:

- Each cable is connected firmly.
- The front and back sides of the tool sensor are not reversed. (See the figure in the step .)
- No cutting waste and the like is present on the tool sensor, the terminal part of the sensor cable, and tool.

Quitting Detection

When you want to stop the descending tool, press the [Z0 SENSE] key.

Important Notes on Selecting the Coordinate System

When [MACHINE] is selected in step 0, no origins can be set.

Coordinate Systems in the RML-1 Mode

- USER: User coordinate system

Coordinate Systems in the NC-code Mode

- G54: Workpiece coordinate system 1 (G54)
- G55: Workpiece coordinate system 2 (G55)
- G56: Workpiece coordinate system 3 (G56)
- G57: Workpiece coordinate system 4 (G57)
- G58: Workpiece coordinate system 5 (G58)
- G59: Workpiece coordinate system 6 (G59)

To Make the Tool Descend Rapidly


When it takes a long time for the tool to make contact with the sensor, turn the hand wheel on the handy panel counterclockwise. Be careful not to make the tool collide with the sensor. A collision makes accurate detection impossible. If a collision occurs, redo the operation from the beginning.

5-6 Overrides

How to Make the Settings for Overrides

This makes the settings for the feed-rate override and the spindle override. The setting for the rapid-feed override cannot be made using the handy panel. Use VPanel to make the setting.

For related items, see P. 76 "4-6 Overrides"

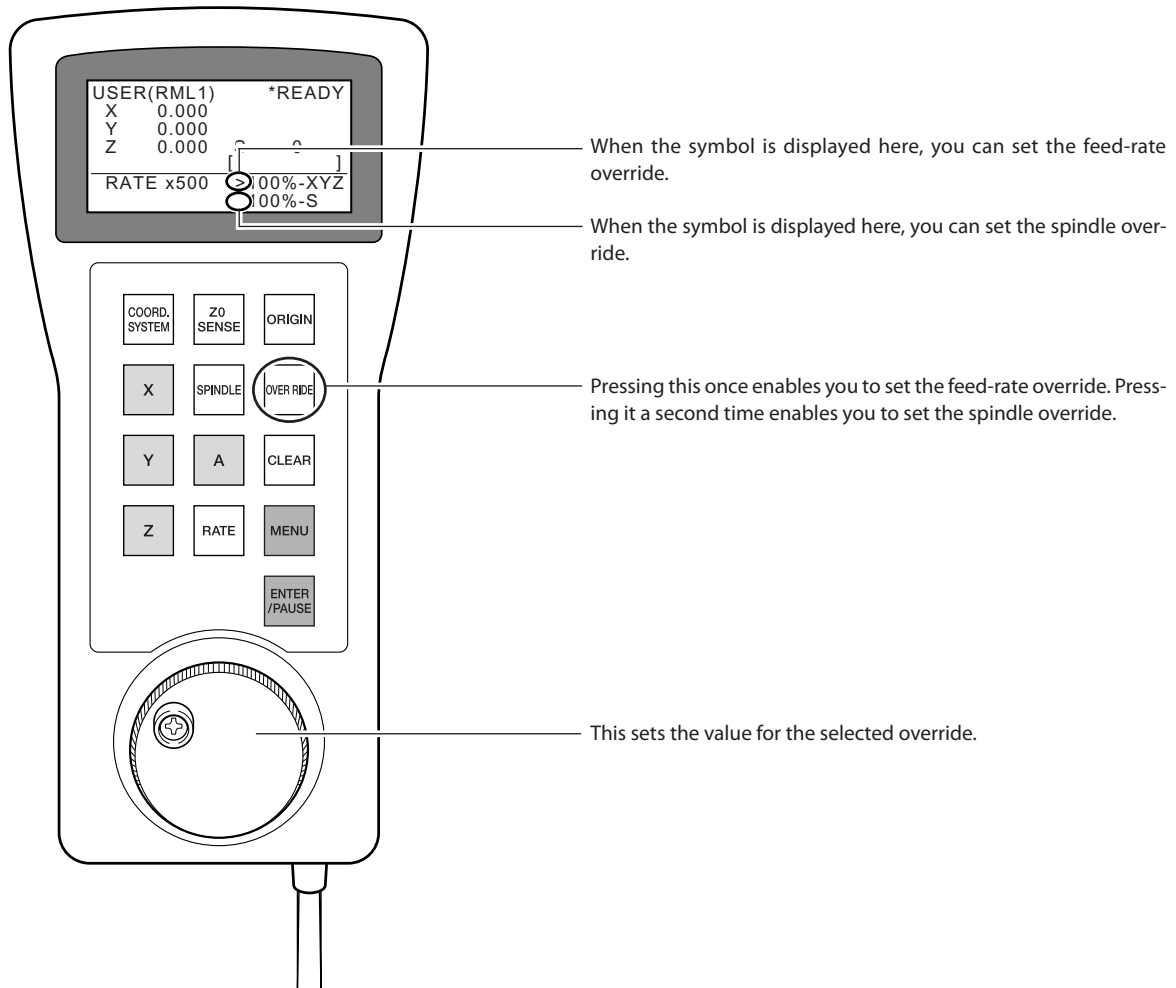


5-7 Clearing Errors

Clearing Errors

This recovers from an error. It performs the same function as the [Clear Error] button in VPanel.

For related items, see P. 102 "7-1 What to Do If..."

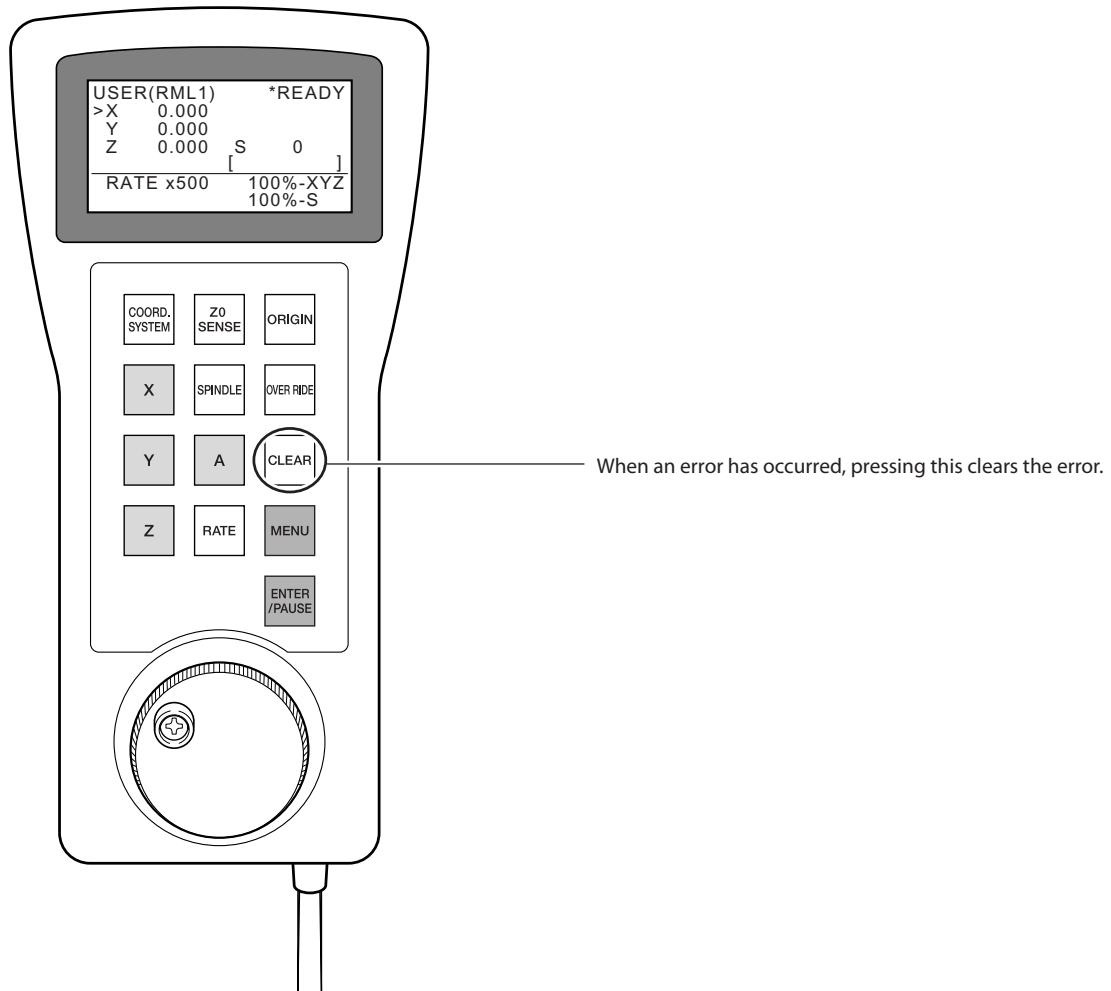


Chapter 6 Maintenance

6-1 Daily Care

Cleaning

- ⚠️WARNING** **Never use a pneumatic blower.**
This machine is not compatible with a pneumatic blower. Cutting waste may get inside the machine and cause fire or electrical shock.
- ⚠️WARNING** **Never use a solvent such as gasoline, alcohol, or thinner to perform cleaning.**
Doing so may cause fire.
- ⚠️WARNING** **Disconnect the power cord before performing cleaning or maintenance.**
Attempting such operations while the machine is connected to a power source may result in injury or electrical shock.
- ⚠️WARNING** **When using a vacuum cleaner to take up cutting waste, exercise caution to prevent fire or dust explosion.**
Taking up fine cuttings using an ordinary vacuum cleaner may cause danger of fire or explosion. Check with the manufacturer of the vacuum cleaner. When the safety of use cannot be determined, clean using a brush or the like, without using the vacuum cleaner.
- ⚠️CAUTION** **Caution: high temperatures.**
The cutting tool and spindle motor become hot. Exercise caution to avoid fire or burns.
- Carefully clean away cutting waste. Operating the machine with a large amount of cutting waste present may cause malfunction.
 - Never apply lubrication anywhere except at specified locations.
 - Never apply silicone substances (oil, grease, spray, etc.) to the machine. Doing so may cause poor switch contact.

Cleaning the X Axis

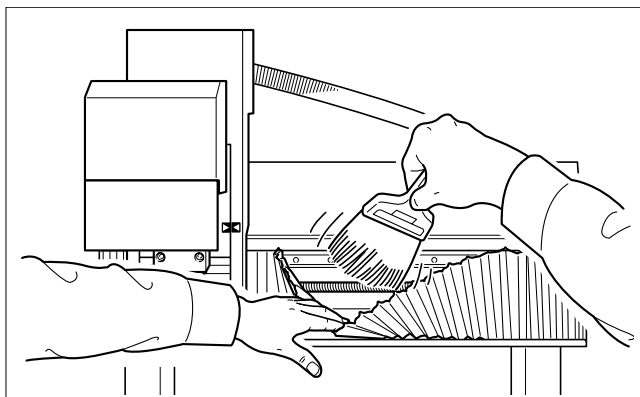


Pull back the cover and clean away any buildup of cuttings in the interior.


Cleaning the Y Axis

Detach the base cover and clean away any buildup of cuttings in the interior.


Procedure

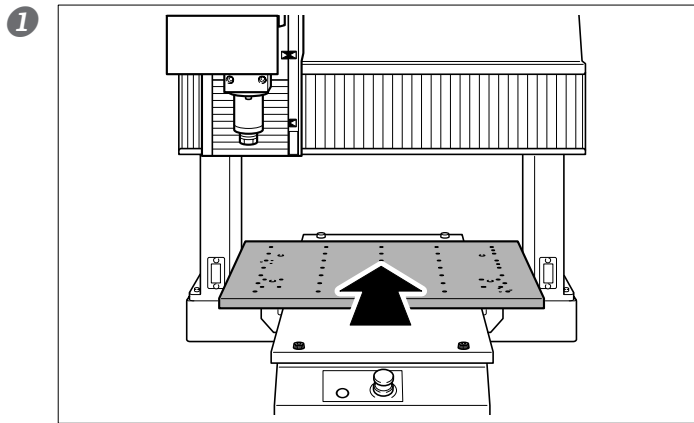


- ① Perform manual feed to move the table to the rear. Stop just before the screws at the rear become hidden.
- ② Switch off the power and disconnect the power cord.

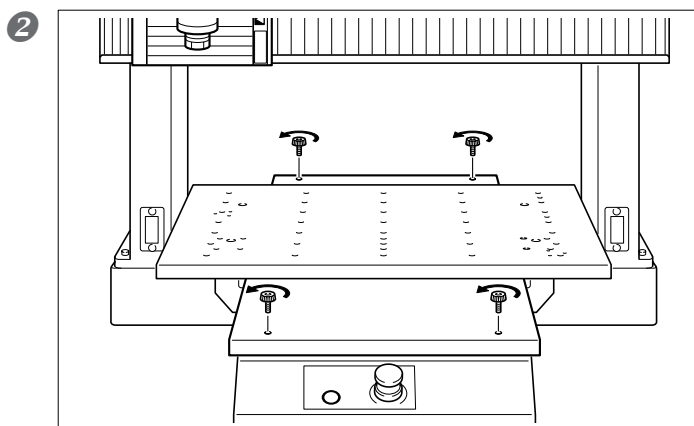

Remove the screws.

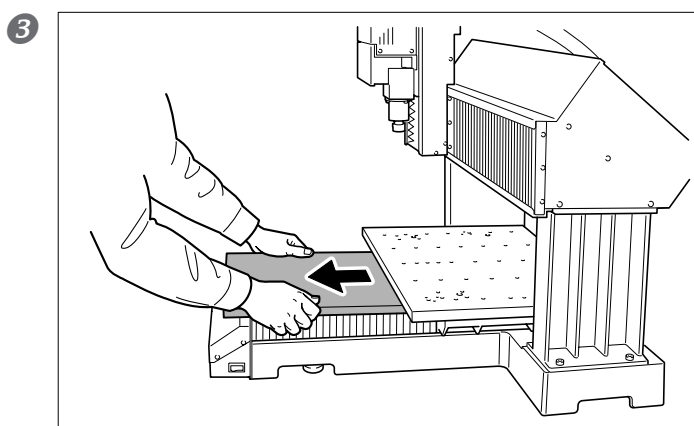


Lift up the front part slightly, and pull it back toward you to extract it.

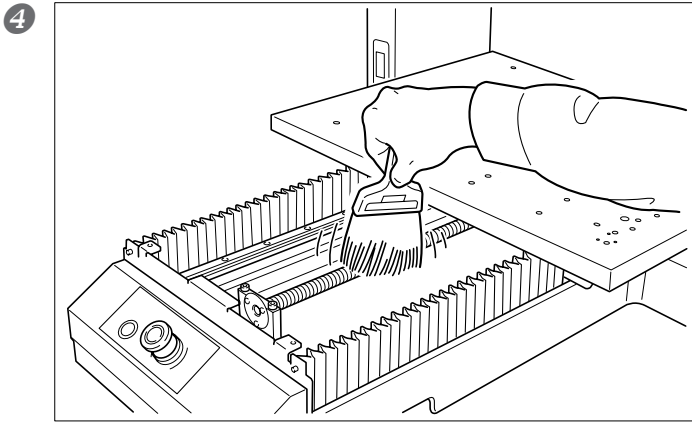


Clean the interior.

Cleaning the Z Axis

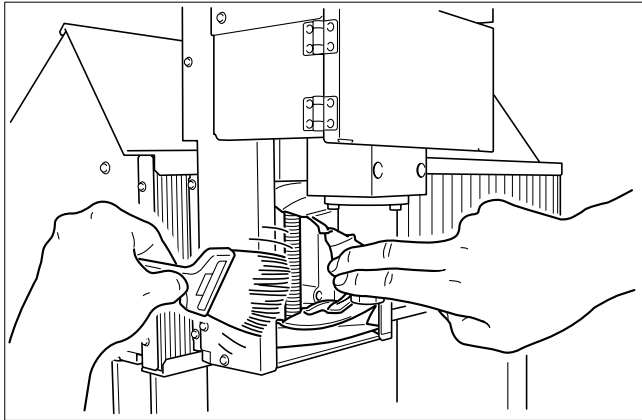


Pull back the cover and clean away any buildup of cuttings in the interior.

Care and Maintenance of the Collet and Spindle Nose

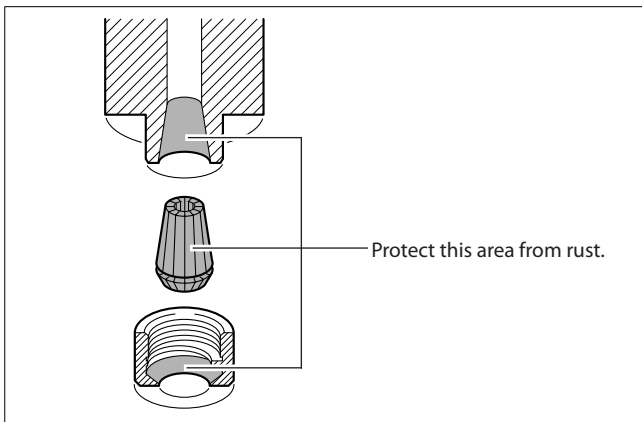

Before use, clean away any cutting waste and excess grease. Failure to do so may affect runout precision or cause slippage. Perform maintenance diligently to prevent rust. Thoroughly wipe off any skin oils or the like with a cleaning rag. When the machine is to be taken out of use for some time, apply machine oil to prevent rust.

Cleaning the Ventilation-duct Filter

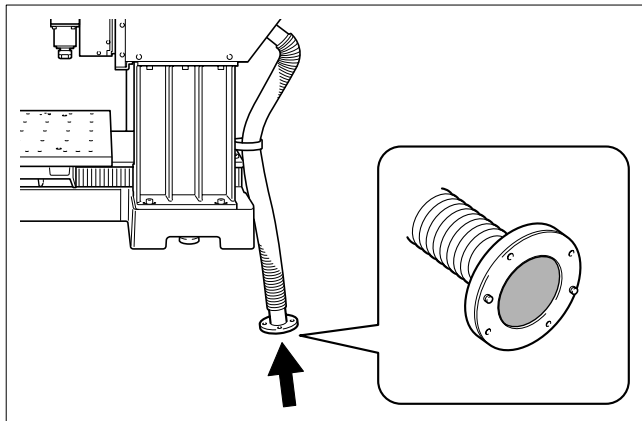

Use a vacuum cleaner to take up any buildup of dust on the filter.


6-2 Inspection and Maintenance

Checking the Total Working Time


This machine automatically keeps track of time in operation. Use this as a general guide for determining when to perform maintenance.

The time for which the spindle has rotated is taken to be the working time.

Procedure

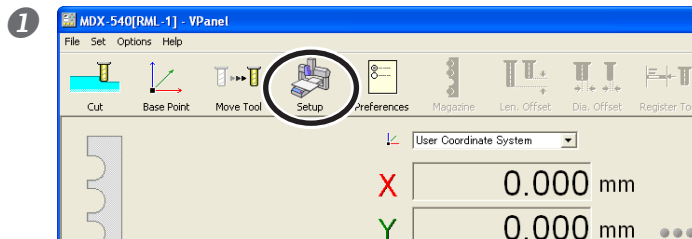

In VPanel, click the [Setup] icon.

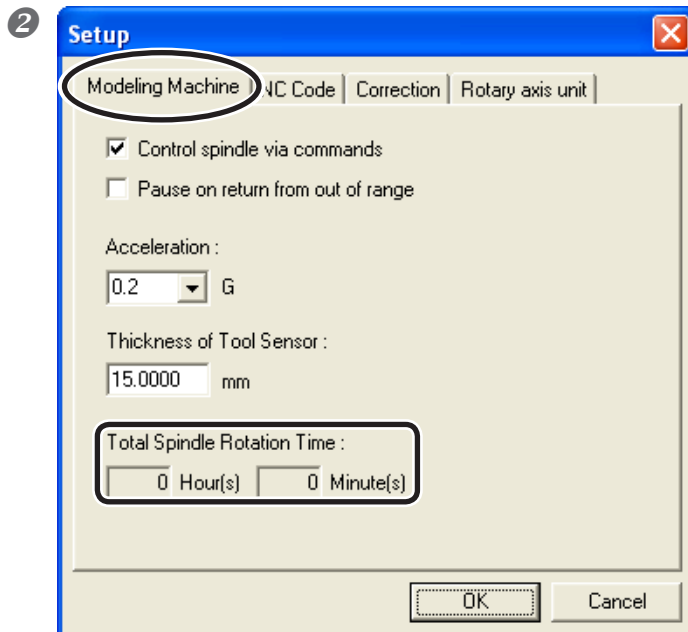


Click the [Modeling Machine] tab.


Lubricating the Ball Screws

⚠️ WARNING **Disconnect the power cord before performing cleaning or maintenance.**
Attempting such operations while the machine is connected to a power source may result in injury or electrical shock.

As a general guide, apply grease to the ball screws after every 1,000 hours. We recommend using No. 2 lithium grease. Never apply grease containing silicone. Doing so may cause poor switch contact.

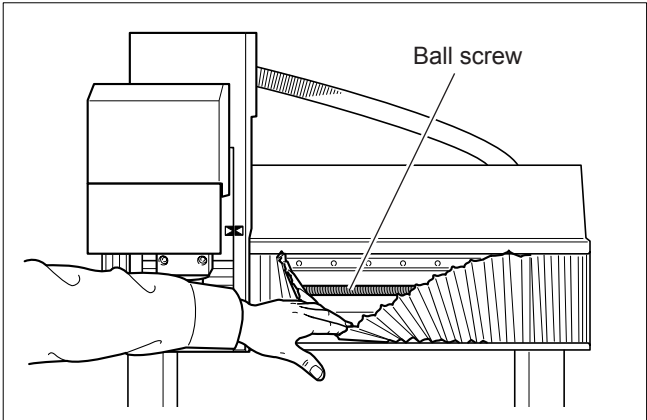


X Axis
Pull back the cover and apply grease over the entire surface of the ball screw.

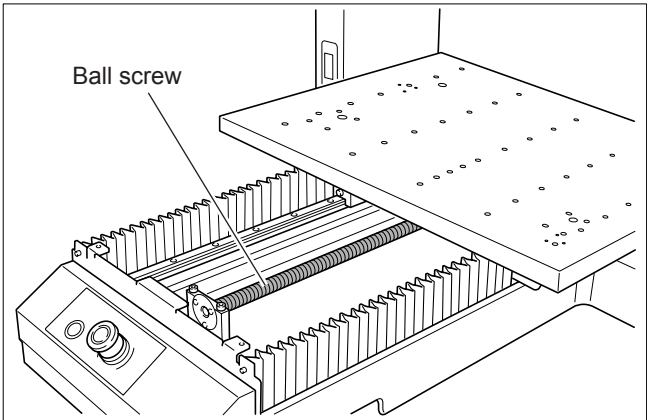

Y Axis
Detach the base cover and apply grease over the entire surface of the ball screw.

How to detach the base cover
☞ P. 95 "Cleaning the Y Axis"

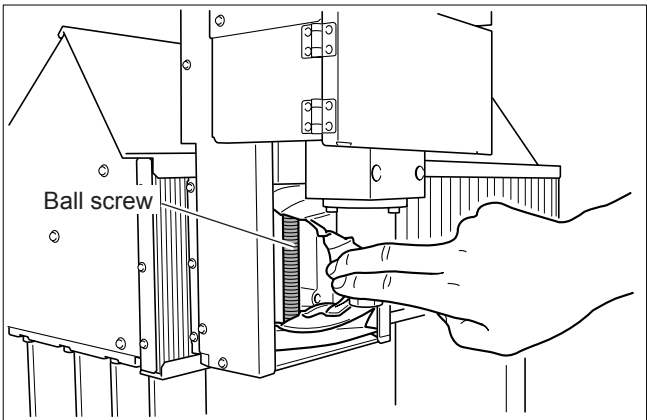

Z Axis
Pull back the cover and apply grease over the entire surface of the ball screw.

When to Service the Spindle

As a general guide, replace the bearings for the spindle unit after every 2,000 hours. Also, as a general guide, replace the spindle motor after every 8,000 hours. These replacement times may vary according to conditions of use. For replacement, contact your authorized Roland DG Corp. dealer or Roland DG Corp. service center.

Chapter 7 What to Do If...

7-1 What to Do If...

The power does not come on.

Has the Emergency Stop button been pressed?

When the Emergency Stop button is depressed, the power does not come on. Release the Emergency Stop button.

☞ P. 40 "To Cancel an Emergency Stop"

Initialization is not performed or initialization fails.

Has the spindle cover been closed?

To ensure safety, no operation is performed while the spindle cover is open. Close the spindle cover.

Is a large amount of cutting waste present?

Clean away any cutting waste. Clean especially carefully inside the spindle cover and around the X, Y, and Z axes in particular.

☞ P. 94 "6-1 Daily Care"

Is anything caught on the spindle or table?

Check whether something has become caught and is impeding initialization.

VPanel doesn't start correctly.

Has initialization been completed?

Before you start VPanel, first switch on the power to the machine.

☞ P. 42 "3-2 Starting and Quitting"

Is the computer connected?

Check whether the connector cable has come loose.

Is the driver installed correctly?

If the connection to the computer is not made in the sequence described, the driver may fail to be installed correctly. VPanel does not function normally when driver is misconfigured. Check again to ensure that the connection was made using the correct procedure.

☞ "Roland Software Package Software Guide"

Are two or more machines connected to a single computer?

VPanel cannot control more than one machine at the same time. When two or more machines are connected to a single computer, you can control only one. When you're connecting more than one machine, it is necessary to set the machine ID numbers in advance.

For more information about machine IDs, refer to the VPanel Online Help.

☞ P. 23 "How to View the Online Help"

Operations are ignored.

Was the machine started according to the correct procedure?

Simply switching on the power does not enable operation. Start the machine using the correct procedure.

☞ P. 42 "3-2 Starting and Quitting"

Is operation paused?

When the machine is paused, cutting stops and some operations are restricted. Cancel the paused state.

☞ P. 54 "3-6 Pausing and Quitting Cutting"

Has the spindle cover been closed?

To ensure safety, no operation is performed while the spindle cover is open. Close the spindle cover.

Is a large amount of cutting waste present?

Clean away any cutting waste. Clean especially carefully inside the spindle cover in particular.

Is the handy panel connected correctly?

Before inserting or removing the connector cable for the handy panel, switch off the power to the machine. The connection is not detected if made while the power is on.

Is the driver installed correctly?

If the connection to the computer is not made in the sequence described, the driver may fail to be installed correctly. VPanel does not function normally when driver is misconfigured. Check again to ensure that the connection was made using the correct procedure.

☞ "Roland Software Package Software Guide"

Are two or more machines connected to a single computer?

VPanel cannot control more than one machine at the same time. When two or more machines are connected to a single computer, you can control only one. When you're connecting more than one machine, it is necessary to set the machine ID numbers in advance.

For more information about machine IDs, refer to the VPanel Online Help.

☞ P. 23 "How to View the Online Help"

Is VPanel displaying an error message?

☞ P. 104 "7-2 Responding to an Error Message"

The spindle doesn't rotate.

Has the spindle cover been closed?

To ensure safety, no operation is performed while the spindle cover is open. Close the spindle cover.

Is a large amount of cutting waste present?

Clean away any cutting waste. Clean especially carefully inside the spindle cover in particular.

Has a setting been made to keep the spindle from rotating?

In VPanel, click the [Setup] icon, then click the [Modeling Machine] tab. Here, select the [Control spindle via commands] check box.

Abnormal cutting is performed.

Is the command mode correct?

Make sure the appropriate command mode for the program you're using has been selected. An incorrect command mode may lead to errors, unintended operation, or no operation.

☞ P. 45 "3-3 Selecting the Command Mode"

Were NC codes sent directly?

In the NC-code mode, be sure to use VPanel's output file list to output cutting data. Direct transmission from a program, data-storage device, or the like may lead to errors, unintended operation, or no operation.

☞ P. 67 "4-4 Starting Cutting (NC-code Mode)"

Have the origin been set at correct location?

Make sure the origin has been set correctly. An incorrect origin location may result in cutting at an unintended position or an abnormal cutting-in depth.

☞ P. 62 "4-3 Starting Cutting (RML-1 Mode)" and P. 67 "4-4 Starting Cutting (NC-code Mode)"

The origin is misaligned.

Is the correct workpiece coordinate system selected?

The NC-code mode has six origins, and it is important to verify which of them you're using. For instance, if the NC program uses G55, the origins must be set relative to workpiece coordinate system G55.

☞ P. 67 "4-4 Starting Cutting (NC-code Mode)"

Has the EXOFS setting been made?

An effect of EXOFS in the NC-code mode is to shift the origin. Set EXOFS to zero, then redo the settings for the origins.

How to set EXOFS to zero:

1. In VPanel, click the [Base Point] icon.
2. For [Set Base Point], select [EXOFS].
3. For [Set at next machine coordinate], enter "0" (zero) for X, Y, and Z, then click [Apply].

For more information, refer to the VPanel Online Help.

☞ P. 23 "How to View the Online Help"

The feed rate or spindle speed is wrong.

Has an override been set?

An override changes the rotation or spindle speed. Check the settings for overrides. Unless you have a special reason for changing them, leave all overrides set at 100%.

☞ P. 76 "4-6 Overrides"

The entered values for a registered tool have disappeared.


Has the machine been connected to a different computer?

The values you enter in the VPanel [Register Tool] dialog box are saved on the computer. The values entered in [Register Tool] cannot be carried over to a different computer.

7-2 Responding to an Error Message

Messages

If a window like this appears on the computer, take action as described below.

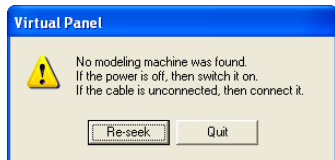

No modeling machine was found.

Click [Quit], then restart the machine from the beginning.

☞ P. 45 "3-2 Starting and Quitting"

No response is returned from machine.

Click [Quit]. The machine may have accidentally been switched off, or the connector cable may have come loose. After checking, restart the machine.

Several machines are found. Choose one machine.

Two or more machines are connected to a single computer. Select the machine you want to control, then click [OK]. Controlling more than one machine at the same time is not possible.

☞ P. 36 "Connecting Multiple Machines"


The next set of cutting data was not found. Ignore and continue?

Click [Cancel] to quit cutting. This error message is displayed if a file on the output file list has been deleted or overwritten, or if its file name has been changed. Check the file.

☞ P. 71 "Deleting the Output File List"

[Status] Box or Handy Panel Display

If a message appears in the VPanel [Status] box or on the handy panel, take action as described below.

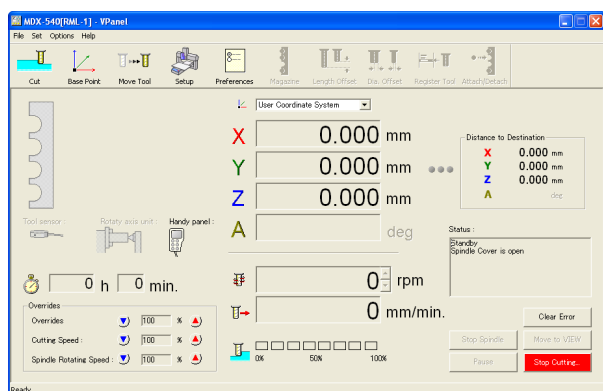

Address undefined. Paused...

(Not displayed on the handy panel.)

The received NC codes contained a value with no address. Click [Clear Error], then click [Stop Cutting]. Canceling the paused

state and resuming cutting instead of quitting is possible, but because unintended operation is highly likely, doing so is not recommended.

Check whether the correct command mode is selected, and check the program for errors.

☞ P. 45 "3-3 Selecting the Command Mode"

Bad parameter. Paused...

A parameter for an RML-1 command that was received contained an incorrect value. Click [Clear Error], then click [Stop Cutting]. Canceling the paused state and resuming cutting instead of quitting is possible, but because unintended operation is highly likely, doing so is not recommended.

Check whether the correct command mode is selected, and check whether the program you're using is compatible with the machine.

☞ P. 45 "3-3 Selecting the Command Mode"

Bad parameter. Paused...

(Not displayed on the handy panel.)

A received NC code contained a word and parameter that could not be interpreted. Click [Clear Error], then click [Stop Cutting]. Canceling the paused state and resuming cutting instead of quitting is possible, but because unintended operation is highly likely, doing so is not recommended.

Check whether the correct command mode is selected, and check the program for errors.

☞ P. 45 "3-3 Selecting the Command Mode"

Cannot execute code. Paused...

(Not displayed on the handy panel.)

A combination of NC codes that cannot be executed due to specifications was received. Click [Clear Error], then click [Stop Cutting]. Canceling the paused state and resuming cutting instead of quitting is possible, but because unintended operation is highly likely, doing so is not recommended.

Check whether the correct command mode is selected, and check the program for errors.

☞ P. 45 "3-3 Selecting the Command Mode"

Cannot set

(Not displayed in VPanel.)

An attempt was made to set an origin point using the handy panel while [MACHINE] was selected as the coordinate system. Setting origin points for the machine coordinate system is not possible. After a short wait, this message disappears. Select the correct coordinate system, then try the operation again.

☞ P. 86 "5-5 Setting the Origins"

Close main cover

(Not displayed in VPanel.)

An operation that makes the machine perform a task involving movement was attempted while the safety cover was open. (Note, however, that operations such as hand-wheel feed or jog

feed do not result in an error.) After a short wait, this message disappears. Close the cover, then try the operation again. (The safety cover is an optional item.)

Close spindle cover

(Not displayed in VPanel.)

An operation that makes the machine perform a task involving movement was attempted while the spindle cover was open. After a short wait, this message disappears. Close the cover, then try the operation again.

Command not recognized. Paused...

An RML-1 command that could not be interpreted was received. Click [Clear Error], then click [Stop Cutting]. Canceling the paused state and resuming cutting instead of quitting is possible, but because unintended operation is highly likely, doing so is not recommended.

Check whether the correct command mode is selected, and check whether the program you're using is compatible with the machine.

⇨ P. 45 "3-3 Selecting the Command Mode"

Command not recognized. Paused...

(Not displayed on the handy panel.)

An NC code that the machine does not support was received. Click [Clear Error], then click [Stop Cutting]. Canceling the paused state and resuming cutting instead of quitting is possible, but because unintended operation is highly likely, doing so is not recommended.

Check whether the correct command mode is selected, and check the program for errors.

⇨ P. 45 "3-3 Selecting the Command Mode"

Emergency stop

An emergency stop occurred because the spindle cover or safety cover was opened or the handy panel became detached while cutting was in progress. Cutting is interrupted and cannot be resumed. Shut down the machine. (The safety cover is an optional item.)

Incorrect parameter. Paused...

(Not displayed on the handy panel.)

Correct circular interpolation is not possible for a received NC code because of a reason such as an extremely large parameter. Click [Clear Error], then click [Stop Cutting]. Canceling the paused state and resuming cutting instead of quitting is possible, but because unintended operation is highly likely, doing so is not recommended.

Check whether the correct command mode is selected, and check the program for errors.

⇨ P. 45 "3-3 Selecting the Command Mode"

Main cover open

An emergency stop occurred because the safety cover was opened while feed was in progress. Closing the spindle cover

and clicking [Clear Error] returns the machine to the standby state. Cutting is interrupted and cannot be resumed. Redo the operation from the beginning. (The safety cover is an optional item.)

No tool sensor connected

The cable for the tool sensor has come loose. Click [Clear Error], then check the cable.

⇨ P. 73 "4-5 Using the Tool Sensor"

Parameter out of range. Paused...

(Not displayed on the handy panel.)

A received NC code contained a parameter that is outside the permitted range. Click [Clear Error], then click [Stop Cutting]. Canceling the paused state and resuming cutting instead of quitting is possible, but because unintended operation is highly likely, doing so is not recommended.

Check whether the correct command mode is selected, and check the program for errors.

⇨ P. 45 "3-3 Selecting the Command Mode"

Parameter undefined. Paused...

(Not displayed on the handy panel.)

The received NC codes contained an address with no value. Click [Clear Error], then click [Stop Cutting]. Canceling the paused state and resuming cutting instead of quitting is possible, but because unintended operation is highly likely, doing so is not recommended.

Check whether the correct command mode is selected, and check the program for errors.

⇨ P. 45 "3-3 Selecting the Command Mode"

S driver overheat

Cutting was stopped because the spindle-motor driver circuit overheated. Resuming is not possible. Shut down the machine.

S driver overload

Cutting was stopped because the load on the spindle-motor driver circuit exceeded its rated value. Resuming is not possible. Shut down the machine.

S motor overload. Paused...

Operation was paused because of large load on the spindle motor. Click [Clear Error], cancel the paused state, then resume cutting. Because the cutting may exceed the capacity of the machine, revising the cutting parameters is recommended.

S overheat

Cutting was stopped because the spindle motor overheated. Resuming is not possible. Shut down the machine.

S overload

Cutting was stopped because the load on the spindle motor exceeded its rated value. Resuming is not possible. Shut down the machine.

S power overload

Cutting was stopped because the load on the spindle-motor power circuit exceeded its rated value. Resuming is not possible. Shut down the machine.

Service call [XXXXX]

An unrecoverable error occurred. Make a note of the number displayed for "XXXXX" (the error number), then shut down the machine. Then contact your authorized Roland DG Corp. dealer or Roland DG Corp. service center. Provide the error number you noted.

Spindle cover open

An emergency stop occurred because the spindle cover was opened during feed operation. Closing the spindle cover and clicking [Clear Error] returns the machine to the standby state. Cutting is interrupted and cannot be resumed. Redo the operation from the beginning.

Tool sensor not found

At attempt was made to set the Z-axis origin using the tool sensor, but the tool did not reach the sensor. Click [Clear Error], then check the amount of extension of the tool. This error message is also displayed when the tool is positioned too far from the sensor when starting detection.

☞ P. 73 "4-5 Using the Tool Sensor"

Wrong number of parameters. Paused...

The number of parameters for a received RML-1 command is incorrect. Click [Clear Error], then click [Stop Cutting]. Canceling the paused state and resuming cutting instead of quitting is possible, but because unintended operation is highly likely, doing so is not recommended.

Check whether the correct command mode is selected, and check whether the program you're using is compatible with the machine.

☞ P. 45 "3-3 Selecting the Command Mode"

X motor overload. Paused...

Operation was paused because of large load on the X-axis motor. Click [Clear Error], cancel the paused state, then resume cutting. Because the cutting may exceed the capacity of the machine, revising the cutting parameters is recommended. Also, allow the machine to rest for around 30 minutes, because the motor may have overheated.

X overheat

Cutting was stopped because the X-axis motor overheated. Resuming is not possible. Shut down the machine.

X overload [XXX]

Cutting was stopped because the load on the X-axis motor exceeded its rated value. Resuming is not possible. Shut down the machine. Depending on how the load was applied, the value displayed for "XXX" may be either "peak," "short," or "long."

Y motor overload. Paused...

Operation was paused because of large load on the Y-axis motor. Click [Clear Error], cancel the paused state, then resume cutting. Because the cutting may exceed the capacity of the machine, revising the cutting parameters is recommended. Also, allow the machine to rest for around 30 minutes, because the motor may have overheated.

Y overheat

Cutting was stopped because the Y-axis motor overheated. Resuming is not possible. Shut down the machine.

Y overload [XXX]

Cutting was stopped because the load on the Y-axis motor exceeded its rated value. Resuming is not possible. Shut down the machine. Depending on how the load was applied, the value displayed for "XXX" may be either "peak," "short," or "long."

Z motor overload. Paused...

Operation was paused because of large load on the Z-axis motor. Click [Clear Error], cancel the paused state, then resume cutting. Because the cutting may exceed the capacity of the machine, revising the cutting parameters is recommended. Also, allow the machine to rest for around 30 minutes, because the motor may have overheated.

Z overheat

Cutting was stopped because the Z-axis motor overheated. Resuming is not possible. Shut down the machine.

Z overload [XXX]

Cutting was stopped because the load on the Z-axis motor exceeded its rated value. Resuming is not possible. Shut down the machine. Depending on how the load was applied, the value displayed for "XXX" may be either "peak," "short," or "long."

Chapter 8 Specifications


8-1 Locations of the Power Rating and Serial Number Labels

Serial Number

This is required when you seek maintenance, servicing, or support. Never peel off the label or let it get dirty.

Power Rating

Use an electrical outlet that meets the requirements for voltage and frequency given here. Provide a power supply whose amperage is 7 A or higher (for 100 to 120 V) or 4 A or higher (for 220 to 240 V).

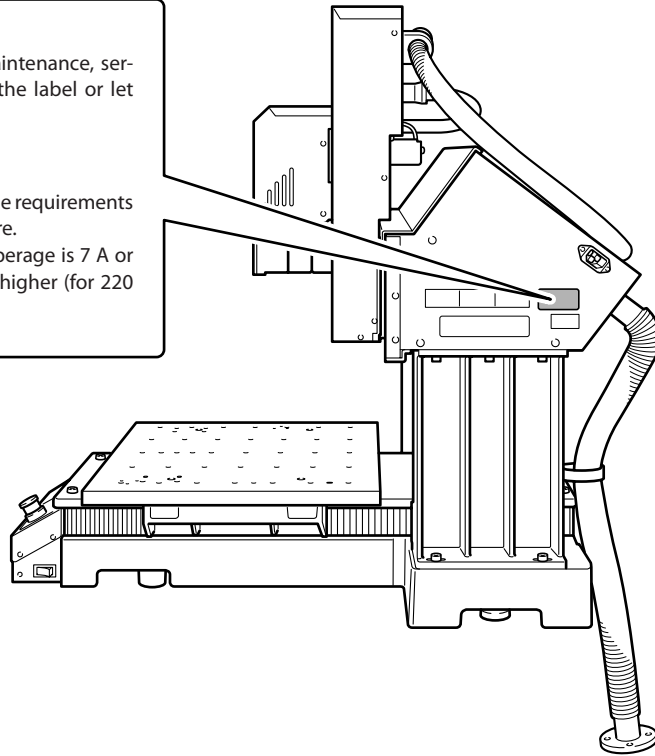

8-2 NC Code Specifications

Settings for NC Codes

This section groups together the settings involving the interpretation and execution of NC codes that you can manipulate on the machine. For others, use NC programs.

For detailed information on how to make the settings, refer to the VPanel Online Help.

+ P. 23 "How to View the Online Help"

+ "NC Code Reference Manual"

Value interpretation method

This selects the method of interpretation for numerical values containing a decimal point and the range for calculator-method interpretation. In VPanel, go to the [Setup] dialog box and display the [NC Code] tab.

Workpiece origin offset (G54 through G59)

This setting affects the location of the workpiece coordinate origin. Make the setting in VPanel's [Base Point] dialog box. Note that making the setting in an NC program by using G10 or G92 is also possible.

EXOFS

Make the setting in VPanel's [Base Point] dialog box. Note that making the setting in an NC program by using G10 is also possible.

Tool-diameter offset value (G41 and G42)

Make the setting in VPanel's [Dia. Offset] dialog box. Note that making the setting in an NC program by using G10 is also possible.

Tool-diameter offset type (G41 and G42)

This selects type A or type B. In VPanel, go to the [Setup] dialog box and display the [NC Code] tab.

Tool-length offset value (G43)

Make the setting in VPanel's [Length Offset] dialog box. This dialog box is enabled only when an ATC unit is installed.

Optional stop (M01)

On this machine, the optional stop is always enabled. No setting is available to enable or disable it.

Optional block skip (/)

This setting enables or disables optional block skip. In VPanel, go to the [Setup] dialog box and display the [NC Code] tab.

Overrides

These affect rapid feed (G00), the feed rate (F), and the spindle speed (S). Make the settings in VPanel's main window.

Items Related to the Mechanical Specifications

This section describes the NC codes that are dependent on the machine's mechanical specifications.

+ "NC Code Reference Manual"

Dimension word

Of dimension words X, Y, Z, and A, only X, Y, and Z are supported under the standard configuration. A is supported when a rotary axis unit is installed.

Data setting (G10)

The parameter range for G10 is as follows.

Parameter: number

Function: Offset number

Acceptable range: 1 through 8

Effective range: 1 through 8

Parameter: radius

Function: Tool-diameter offset value

Acceptable range: Range 1

Effective range: 0 through 10 mm (0 through 0.3937 inch)

Tool-diameter offset (G41 and G42)

The parameter ranges for G41 and G42 are as follows.

Parameter: number

Function: Offset number

Acceptable range: 0 through 8

Effective range: 0 through 8

Tool-length offset (G43)

G43 is supported only when an ATC unit is installed.

The parameter range is dependent on the specifications of the installed ATC unit. For more information, refer to the documentation for the ATC unit.

Tool selection (M06)

M06 is supported only when an ATC unit is installed.

The parameter range is dependent on the specifications of the installed ATC unit. For more information, refer to the documentation for the ATC unit.

Auxiliary-device control (M12 through M17)

M12 through M17 are not supported under the standard configuration. Support depends on whether corresponding optional devices are installed.

Spindle speed (S)

When the standard spindle is installed, the parameter range for S is as follows.

Parameter: revolution speed

Function: Spindle speed

Acceptable range: -65,535 to 65,535

Effective range: 30 through 12,000 (Specified as rpm)

52 through 82 (Numerical-code specification)

8-2 NC Code Specifications

Feed rate (F)

The parameter range for F is as follows.

Parameter: feed rate

Function: Feed rate

Acceptable range: Range 1

Effective range: 30 through 7,500 mm/min (1.2 through 295.2 inch/min)

Note: The feed rate for the A axis is dependent on the specifications of the rotary axis unit installed. For more information, refer to the documentation for the rotary axis unit.

Reference point (G28)

The reference point is (0, 0, 0) of the Machine Coordinate System.

Interpretation of Omitted NC Codes

When the format for NC codes is abbreviated and one or more NC codes are omitted, the machine performs interpretation as described below. The method of interpretation is specific to the machine. When you want to make a program generic, needless omission should be avoided.

+ "NC Code Reference Manual"

Measurement unit (G20 and G21)

When these are omitted, the interpretation is always for millimeter input (G21).

Tool-diameter offset (G41 and G42)

If the D word is omitted when an ATC unit is installed, the offset number set in the VPanel [Magazine] dialog box is used. When a tool is grasped by the automatic tool changer, the tool-diameter offset number assigned to the stocker number takes effect.

Tool-length offset (G43)

If the H word is omitted when an ATC unit is installed, the offset number set in the VPanel [Magazine] dialog box is used. When a tool is grasped by the automatic tool changer, the tool-length offset number assigned to the stocker number takes effect.

Workpiece coordinate system (G54 through G59)

When these are omitted, the interpretation is always for workpiece coordinate system 1 (G54).

Dimension (G90 and G91)

When these are omitted, the interpretation is always for absolute specification (G90).

Feed rate (F)


When F is not stated, the feed rate is 120 mm/min.

Spindle speed (S)

When S is not stated, the speed set at VPanel's main window is used.

8-3 Main Unit Specifications



External View

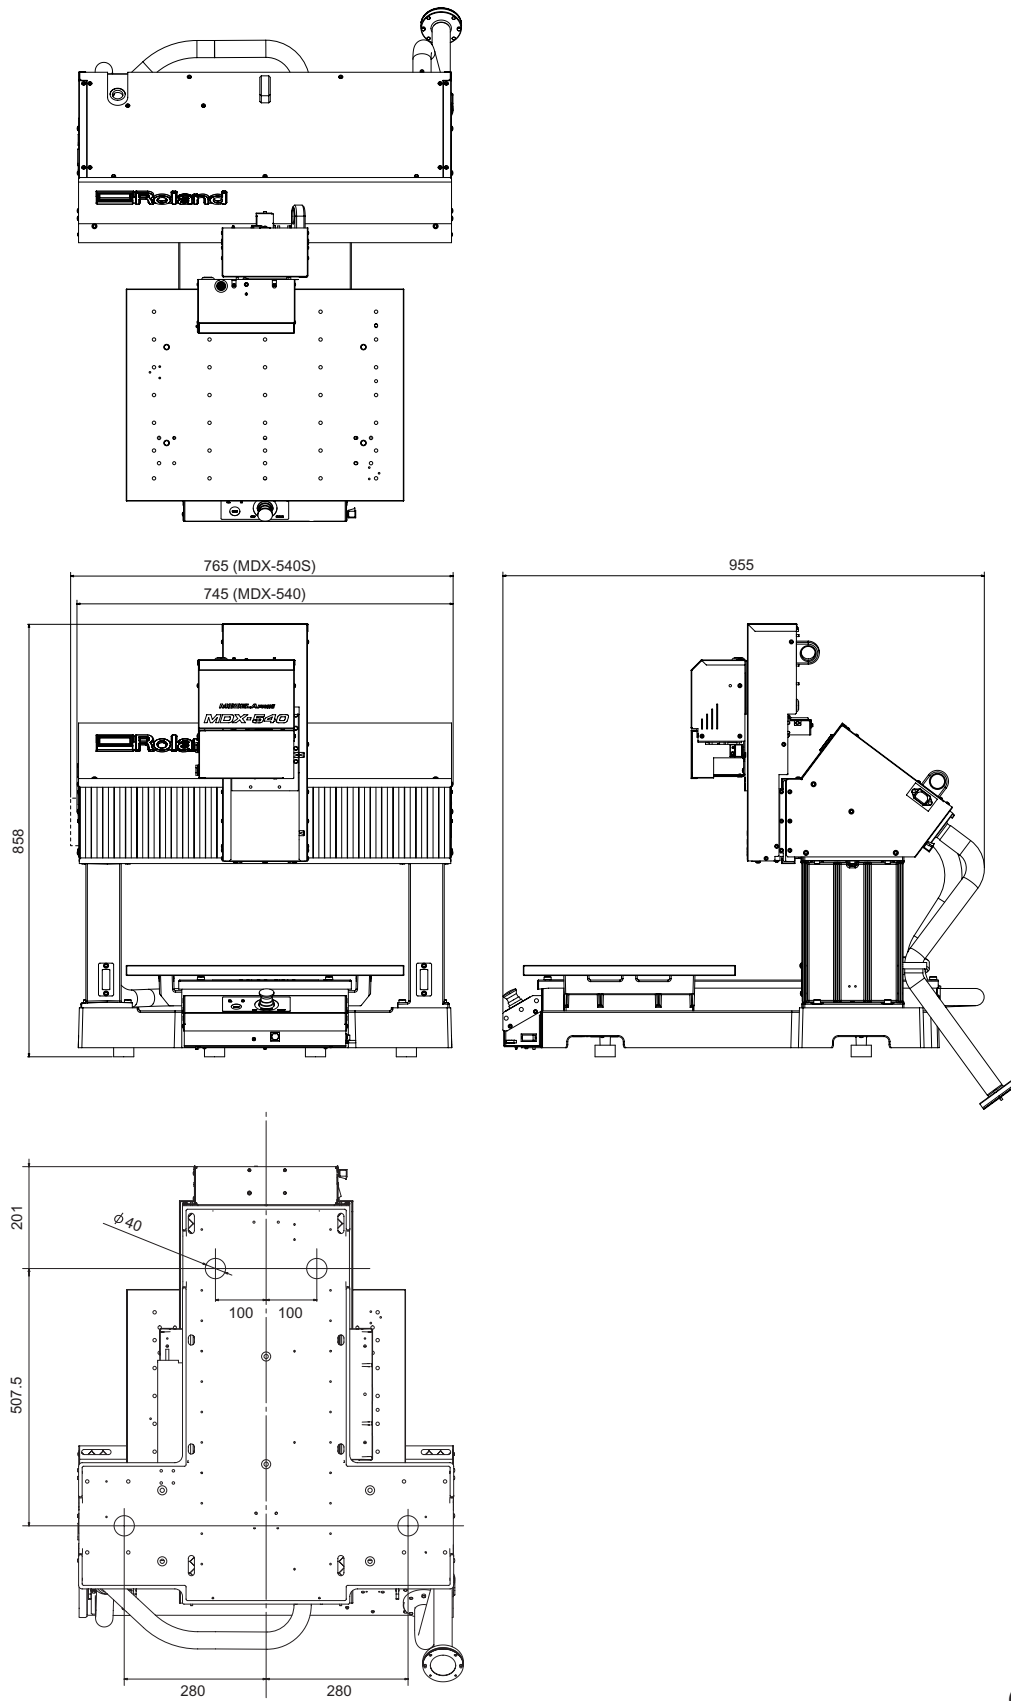

(Unit: mm)



Dimensional Drawings of the Table Area

Standard Table

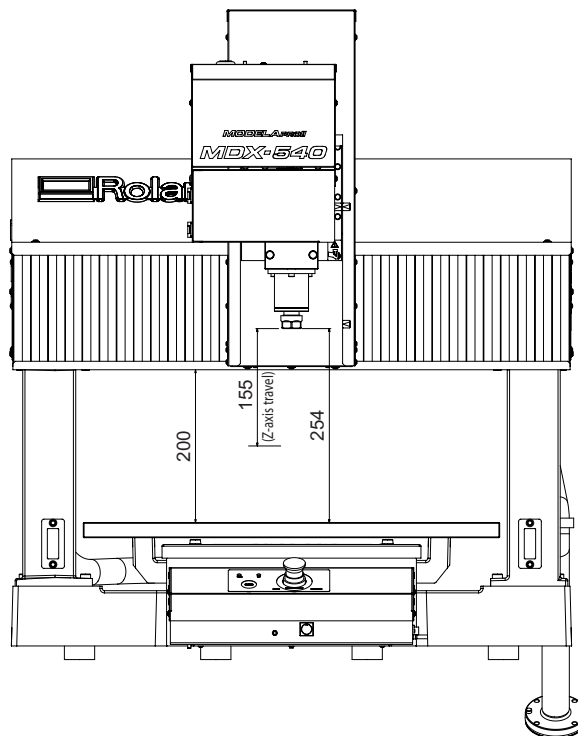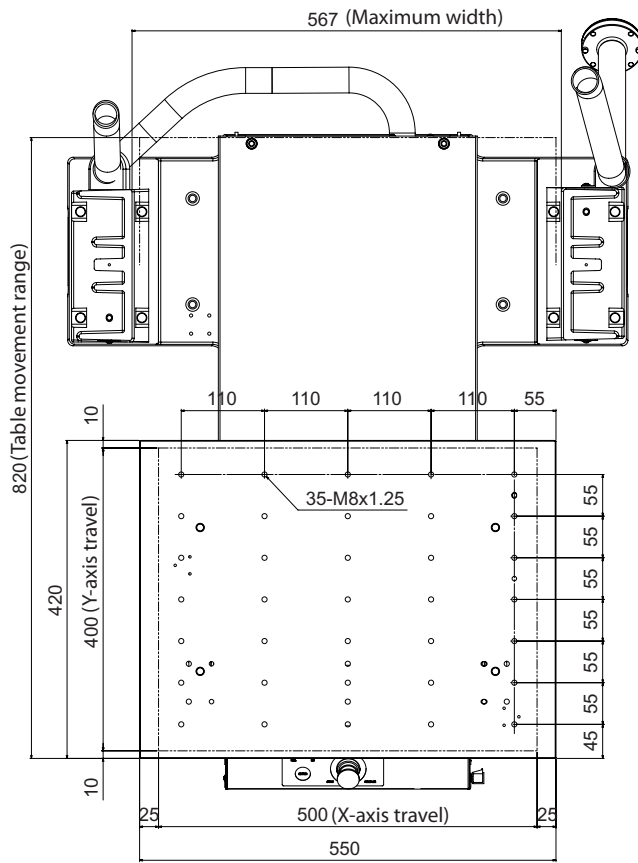

(Unit: mm)

T-slot Table (Optional)

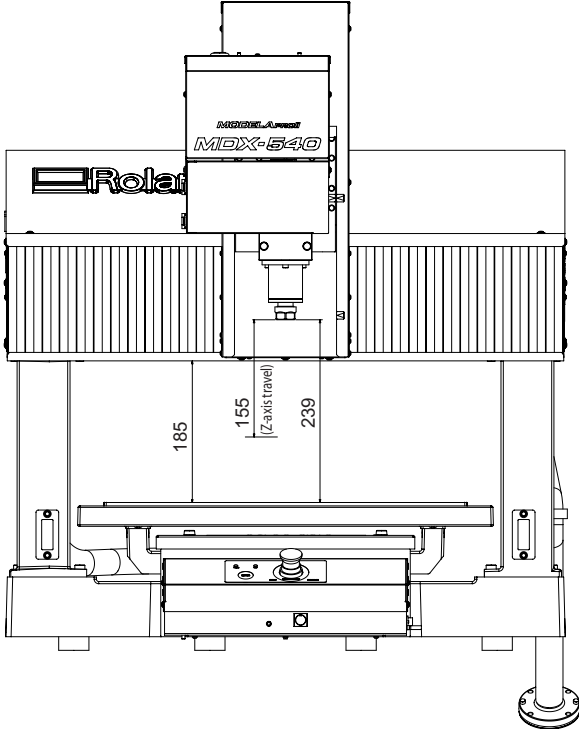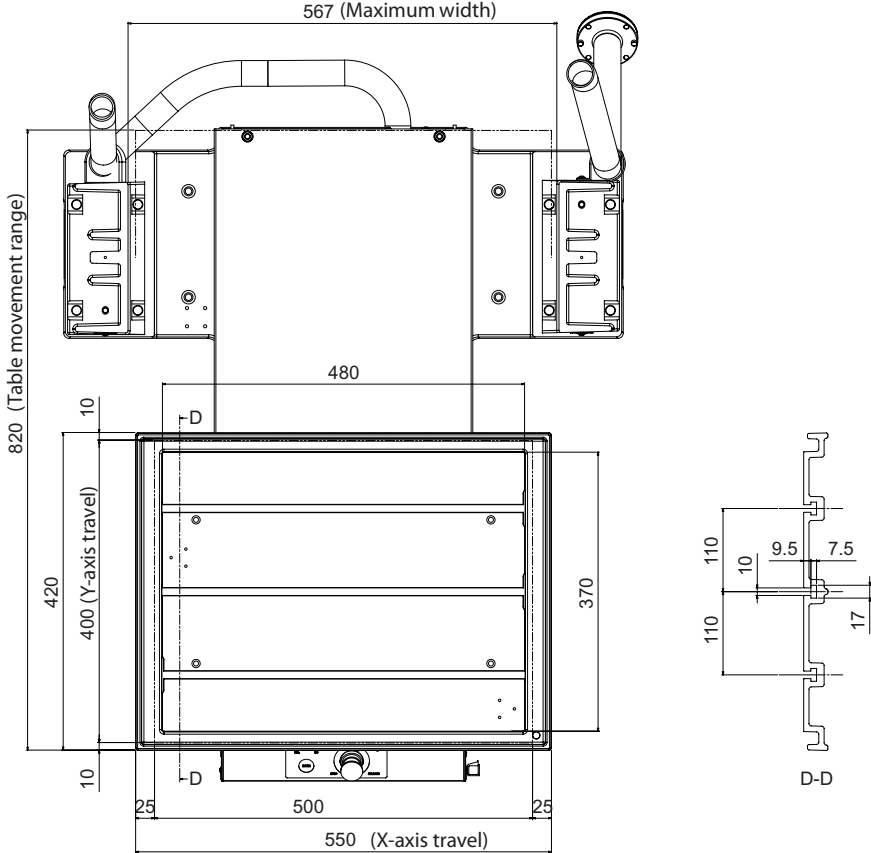

(Unit: mm)

Collet Specifications (ZS-540TY)

With the ZS-540TY, use the following collets and nuts.

Collets

- EY16, Yukiwa Seiko
- ER16, REGO-FIX
- ESX16, SCHAUBLIN

Nuts

- NY16H22, Yukiwa Seiko
- Hi-Q/ER16 (UM/ER16), REGO-FIX
- EX16, SCHAUBLIN

EY16 Collets, Yukiwa Seiko

Model number	Compatible shank (mm)	Model number	Compatible shank (mm)
EY16 - 1	1.0 to 0.5	EY16 - 5	5.0 to 4.0
EY16 - 1.5	1.5 to 1.0	EY16 - 6	6.0 to 5.0
EY16 - 2	2.0 to 1.5	EY16 - 7	7.0 to 6.0
EY16 - 2.5	2.5 to 2.0	EY16 - 8	8.0 to 7.0
EY16 - 3	3.0 to 2.5	EY16 - 9	9.0 to 8.0
EY16 - 3.5	3.5 to 3.0	EY16 - 10	10.0 to 9.0
EY16 - 4	4.0 to 3.5		

Main Specifications

Main specifications when installed with the ZS-540TY spindle and the standard table.

The workpiece area, axis travel, and other such specifications may vary when optional items are installed.

	MDX-540S	MDX-540
Cuttable material	Plastic resin and light metal	
XYZ-axis travels	X x Y x Z: 500 x 400 x 155 mm (19.6 x 15.7 x 6.1 in.)	
Distance from spindle nose to table	Maximum 254 mm (10 in.)	
Table size	Width x depth: 550 x 420 mm (21.7 x 16.5 in.)	
Loadable workpiece weight	At acceleration of 0.2 G: maximum 12 kg (26 lb.), 0.1 G: 20 kg (44 lb.), 0.05 G: 20 kg (44 lb.)	
XYZ-axis drive system	AC servo motor, 80 W	AC servo motor, 60 W
Operating speed	Maximum 7.5 m/min (295 in./min)	
Acceleration	0.2 G, 0.1 G, 0.05 G	
Software resolution	RML-1 mode: 0.01 mm (0.0004 in.), NC-code mode: 0.001 mm (0.00004 in.)	
Mechanical resolution	0.001 mm (0.00004 in.)	
Positioning accuracy	±0.1 mm/300 mm (±0.004 in./12 in.), under no-load conditions	
Repeat accuracy	±0.02 mm (±0.0008 in.), under no-load conditions	±0.05 mm (±0.002 in.), under no-load conditions
Origin reproducibility (when the power is switched on/off)	±0.02 mm (±0.0008 in.)	±0.05 mm (±0.002 in.)
Spindle motor	DC brushless motor, maximum 400 W	
Spindle speed	400 to 12,000 rpm; 400 to 3,000 rpm for positioning and centering	
Tool chuck	Collet method, maximum tool diameter: 10 mm (0.4 in.)	
Control command sets	RML-1 and NC codes	
Interface	USB (compliant with Universal Serial Bus Specification Revision 1.1)	
Power supply	Voltage and frequency: AC 100 to 120 V/220 to 240 V ±10%, 50/60 Hz Required power capacity: 7 A (100 to 120 V)/4 A (220 to 240 V)	
Power consumption	Approx. 700 W	
Acoustic noise level	During operation (no cutting): 65 dB (A) or less, during standby: 40 dB (A) or less	
Dimensions	Width x depth x height: 765 x 955 x 858 mm (30.1 x 37.6 x 33.8 in.)	Width x depth x height: 745 x 955 x 858 mm (29.3 x 37.6 x 33.8 in.)
Weight	102 kg (225 lb.)	
Operating temperature	5 to 40°C (41 to 104°F)	
Operating humidity	35 to 80% (no condensation)	
Included items	Handy panel, power cord, tool sensor, sensor cable, nut, nut wrench, wrench, hexagonal wrench, Roland Software Package CD-ROM, SRP Player CD-ROM, User's Manual, Roland Software Package Software Guide, SRP Player Installation and Setup Guide, NC Code Reference Manual	

MEMO

A series of horizontal dotted lines for writing, spanning the width of the page.



1000021636

R10-190731